DI1NH-09

DTC

B0116/48

Open in Side Squib (LH) Circuit

CIRCUIT DESCRIPTION

The side squib (LH) circuit consists of the airbag sensor assembly and side airbag assembly (LH). It causes the SRS to deploy when the SRS deployment conditions are satisfied.

For details of the function of each component, see OPERATION on page RS-2.

DTC B0116/48 is recorded when an open is detected in the side squib (LH) circuit.

| DTC No. | DTC Detecting Condition | Trouble Area |
|----------|--|---|
| B0116/48 | Open circuit in SFL+ wire harness or SFL- wire harness of squib Side squib (LH) malfunction Airbag sensor assembly malfunction | Side airbag assembly (LH) Airbag sensor assembly Wire harness |


WIRING DIAGRAM

See page DI-343.

INSPECTION PROCEDURE

| 1 | Prepare for inspection. (See step 1 on page DI–416) | | |
|------------------|---|--|--|
| | <u>,</u> | | |
| | | | |
| 2 | Check side squib (LH) circuit. | | |
| Squil | b (LH) | $\begin{tabular}{l} \hline \hline \textbf{CHECK:}\\ For the connector (on the side airbag assembly side) between the side airbag assembly (LH) and the airbag sensor assembly measure the resistance between SFL+ and SFL \\ \hline \textbf{OK:}\\ \hline \textbf{Resistance: Below 1} \ \Omega \end{tabular}$ | |
| H01019 W03859 | SFL- (-) (+) H01191 | NG Repair or replace harness or connector be- tween side airbag assembly (LH) and airbag sensor assembly. | |

ОК

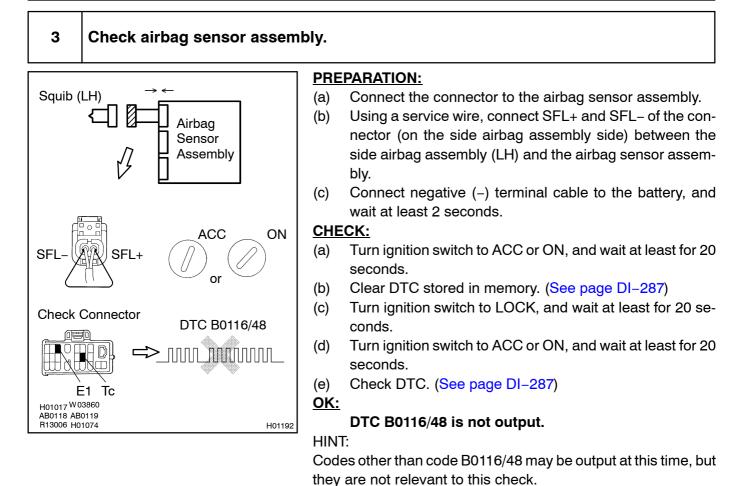


NG

Replace airbag sensor assembly.

ок



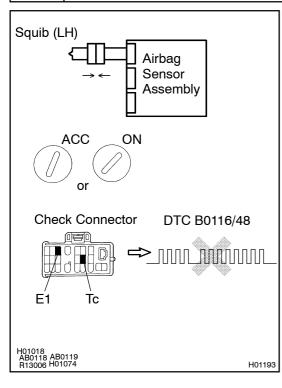

PREPARATION:

- (a) Turn ignition switch to LOCK.
- (b) Disconnect negative (–) terminal cable from the battery, and wait at least for 90 seconds.
- (c) Connect the side airbag assembly (LH) connector.
- (d) Connect negative (-) terminal cable to the battery, and wait at least for 2 seconds.

CHECK:

- (a) Turn ignition switch to ACC or ON, and wait at least for 20 seconds.
- (b) Clear DTC stored in memory. (See page DI-287)
- (c) Turn ignition switch to LOCK, and wait at least for 20 seconds.
- (d) Turn ignition switch to ACC or ON, and wait at least for 20 seconds.
- (e) Check DTC. (See page DI-287)

<u>OK:</u>

DTC B0116/48 is not output.

HINT:

Codes other than code B0116/48 may be output at this time, but they are not relevant to this check.

NG

Replace side airbag assembly (LH).

ОК

From the results of the above inspection, the malfunctioning part can now be considered normal. To make sure of this, use the simulation method to check.