

## Combination Meter ECU Power Source Circuit


### INSPECTION PROCEDURE

1 Check fuses (GAUGE, MPX-B and DOME fuse).

NG Replace fuse.

OK

2 Check voltage between terminals A15 and A19 of combination meter connector.

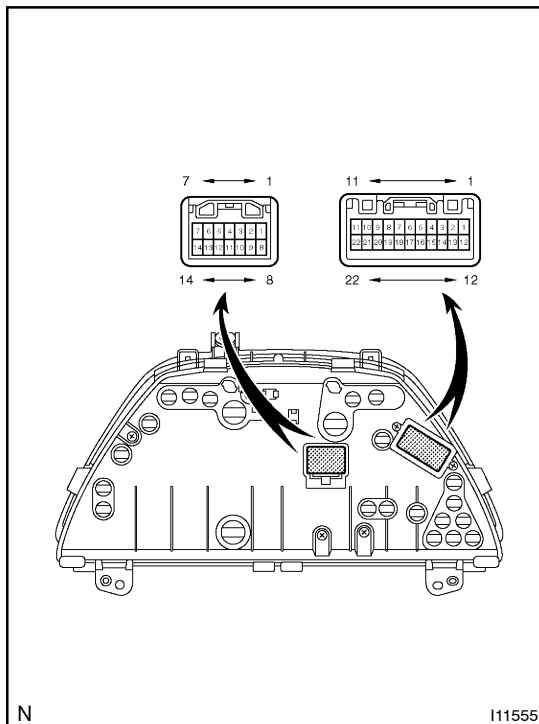

#### PREPARATION:

- (a) Remove combination meter.
- (b) Disconnect the combination meter connector.

#### CHECK:

Measure voltage between terminals A15 and A19 of combination meter connector.

#### OK:

Voltage: 10 - 14 V

OK Proceed to next circuit inspection shown in problem symptoms table (See page DI-531).

NG

3 Check for open in harness and connector between terminal GND of combination meter and body ground (See page IN-32).

NG

Repair or replace harness or connector.

OK

Check and repair harness and connector between combination meter and battery.