DI1AP-28

PROBLEM SYMPTOMS TABLE

Symptom	Suspect Area	See page
Immobiliser is not set. (Engine starts with key codes other than the registered key code.)	1. Engine and ECT ECU	IN-34
Engine does not start.	 Key Wire harness Transponder key coil Amplifier Engine and ECT ECU 	*1 IN-34 BE-201*3
Security indicator is always ON.	Security indicator Wire harness Engine and ECT ECU	*2 IN-34 IN-34
Security indicator is always ON. (Although code has been registered in the automatic registration mode, indicator is not OFF.)	1. Wire harness 2 Transponder key coil 3. Amplifier 4. Engine and ECT ECU	IN-34 BE-201*3 IN-34
Security indicator is OFF. (When DTC of immobiliser is output)	Wire harness Transponder key coil Amplifier Engine and ECT ECU	IN-34 BE-201*3 IN-34
Security indicator is OFF. (When DTC of immobiliser is not output)	Wire harness Engine and ECT ECU	IN-34 IN-34
Security indicator is abnormally blinking.	Wire harness Engine and ECT ECU	IN-34 IN-34

^{*1 :} Check that the key which did not start the engine has been registered and that it is possible to start with other already registered key.

^{*2 :} Finish the automatic registration mode because the mode might still remain.

^{*3 :} See Pub No. RM684E.