# MULTIPORT FUEL **INJECTION (MFI)** <1.8L ENGINE>

#### CONTENTS

13109000614

GE	ENERAL INFORMATION2
IN	JECTOR 153
0	N-VEHICLE SERVICE
	Basic Idle Speed Adjustment 144
	Closed Throttle Position Switch and Throttle Position Sensor Adjustment
	Closed Throttle Position Switch Check 149
	Component Location 144
	Curb Idle Speed Check Refer to GROUP 11A
	EGR Solenoid Check 152
	Engine Coolant Temperature Sensor Check
	Evaporative Emission Purge Solenoid Check
	Fixed SAS Adjustment 143
	Fuel Pressure Test 144
	Fuel Pump Connector Disconnection (How to Reduce Pressurized Fuel Lines)

	Fuel Pump Operation Check	144
	Heated Oxygen Sensor Check	150
	Idle Air Control Motor (Stepper Motor) Check	152
	Injector Check	152
	Intake Air Temperature Sensor Check	148
	Multiport Fuel Injection (MFI) Relay and Fuel Pump Relay Continuity Check	148
	Throttle Body (Throttle Valve Area) Cleaning	142
	Throttle Position Sensor Check	148
SE	ALANT	6
SE	RVICE SPECIFICATIONS	6
SF	PECIAL TOOLS	6
TF	ROUBLESHOOTING	8
T۲		155

## GENERAL INFORMATION

The Multiport Fuel Injection System consists of sensors which detect the engine conditions, the ENGINE CONTROL MODULE (ECM) which controls the system based on signals from these sensors, and actuators which operate under the control of the ECM.

The ECM carries out activities such as fuel injection control, idle air control, and ignition timing control. In addition, the ECM is equipped with several diagnostic test modes which simplify troubleshooting when a problem develops.

#### FUEL INJECTION CONTROL

The injector drive times and injector timing are controlled so that the optimum air/fuel mixture is supplied to the engine to correspond to the continually-changing engine operation conditions. A single injector is mounted at the intake port of each cylinder. Fuel is sent under pressure from the fuel tank to the fuel injectors by the fuel pump, with the pressure being regulated by the fuel pressure regulator. The regulated fuel is distributed to each of the injectors.

Fuel injection is normally carried out once for each cylinder for every two rotations of the crankshaft. The firing order is 1-3-4-2. Each cylinder has a dedicated fuel injector. This is called multiport. The ECM provides a richer air/fuel mixture by carrying out "open-loop" control when the engine is cold or operating under high load conditions in order to maintain engine performance.

In addition, when the engine is under normal operating temperature after warming-up, the ECM controls the air/fuel mixture by using the heated oxygen sensor signal to carry out "closed-loop" control. The closed-loop control achieves the theoretical air/fuel mixture radio where the catalytic converter can obtains the maximum cleaning performance.

#### IDLE AIR CONTROL

The idle speed is kept at the optimum speed by controlling the amount of air that bypasses the throttle valve in accordance with changes in idling conditions and engine load during idling.

The ECM drives the idle air control (IAC) motor to keep the engine running at the pre-set idle target speed in accordance with the engine coolant temperature and air conditioning load. In addition, when the air conditioning switch is turned off and on while the engine is idling, the IAC motor adjusts the thrcttle valve bypass air amount according to the engine load conditions to avoid fluctuations in the engine speed. 13100010715

#### IGNITION TIMING CONTROL

The ignition power transistor located in the ignition primary circuit turns ON and OFF to control the primary current flow to the ignition coil. This controls the ignition timing to provide the optimum ignition timing with respect to the engine operating conditions. The ignition timing is determined by the ECM from the engine speed, intake air volume, engine coolant temperature, and atmospheric pressure.

#### DIAGNOSTIC TEST MODE

- When an abnormality is detected in one of the sensors or actuators related to emission control, the SERVICE ENGINE SOON/MALFUNCTION INDICATOR LAMP illuminates to warn the driver.
- When an abnormality is detected in one of the sensors or actuators, a diagnostic trouble code corresponding to the abnormality is stored in the ECM.
- The RAM data inside the ECM that is related to the sensors and actuators can be read with the scan tool.
   In addition, the actuators can be controlled by the scan tool (MUT-II) under certain circumstances.

#### OTHER CONTROL FUNCTIONS


- Fuel Pump Control Turns the fuel pump relay ON so that current is supplied to the fuel pump while the engine is cranking or running.
- A/C Compressor Clutch Relay Control Turns the compressor clutch of the A/C ON and OFF.
- 3. Fan Relay Control The radiator fan and condenser fan speeds are controlled in response to the engine coolant temperature and vehicle speed.
- 4. Evaporative Emission Purge Control (Refer to GROUP 17.)
- 5. EGR Control (Refer to GROUP 17.)

## **GENERAL SPECIFICATIONS**


Items		Specifications
Throttle	Throttle bore mm (in.)	50 (1.97)
body	Throttle position sensor	Variable resistor type
	Idle air control motor	Stepper motor (Stepper motor type by-pass air control system with the air volume limiter)
	Closed throttle position switch	Rotary contact type, within throttle position sen- sor
	Idle air control valve position sensor	Hall element type
Engine control module (ECM)	Identification model No.	E2T73172 <federal> E2T73171 <california></california></federal>
Sensors	Volume air flow sensor	Karman vortex type
	Barometric pressure sensor	Semiconductor type
	Intake air temperature sensor	Thermistor type
	Engine coolant temperature sensor	Thermistor type
	Heated oxygen sensor	Zirconia type
	Vehicle speed sensor	Electromagnetic resistance element type
	Park/Neutral position switch	Contact switch type
	Camshaft position sensor	Hall element type
	Crankshaft position sensor	Hall element type
	Power steering pressure switch	Contact switch type
Actuators	Multiport fuel injection (MFI) relay	Contact switch type
	Fuel pump relay	Contact switch type
	Injector type and number	Electromagnetic type, 4
	Injector identification mark	CDH210
	EGR solenoid	Duty cycle type solenoid valve
	Evaporative emission purge solenoid	Duty cycle type solenoid valve
Fuel pressure regulator	Regulator pressure kPa (psi)	335 (47.6)

#### MULTIPORT FUEL INJECTION (MFI) SYSTEM DIAGRAM

#### <Vehicles for Federal>

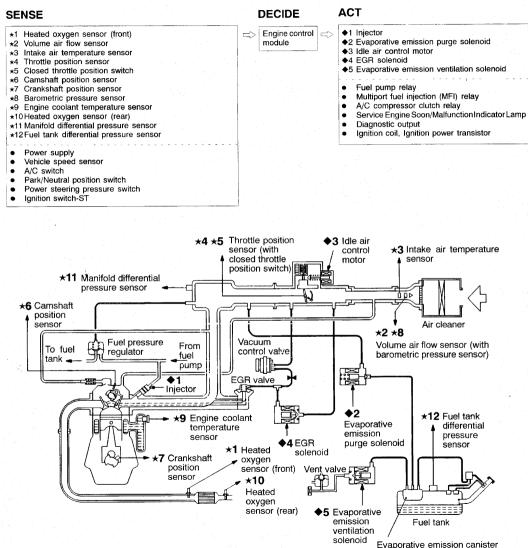

#### <Vehicles for California>

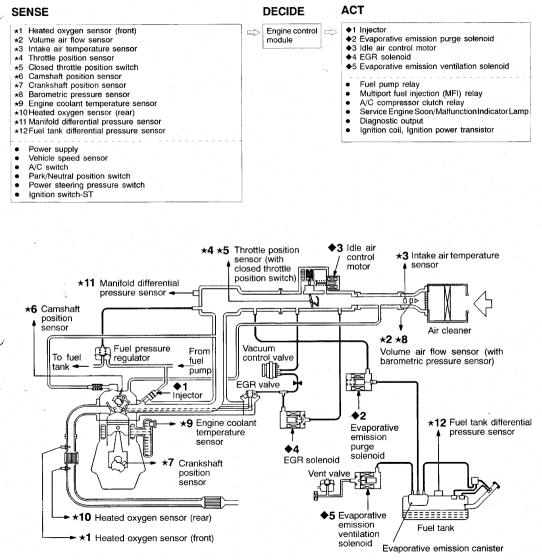

## SERVICE SPECIFICATIONS

13100030483

Items		Standard value	
Basic ignition timing		5° BTDC $\pm$ 3° at curb idle	
Curb idle speed r/min	Curb idle speed r/min		700 ± 100
Idle speed when A/C is ON r/min	· · · · · · · · · · · · · · · · · · ·		850 in Neutral
Basic idle speed r/min	e e la calendaria de la c	a state a state	700 ± 50
Throttle position sensor adjusting	voltage mV		400-1000
Throttle position sensor resistance	e kΩ		3.5–6.5
Intake air temperature sensor resistance $\ensuremath{k\Omega}$		20°C (86°F)	2.3–3.0
		80°C (176°F)	0.30-0.42
Engine coolant temperature sense	or resistance $k\Omega$	20°C (68°F)	2.1-2.7
		80°C (176°F)	0.26–0.36
Heated oxygen sensor output voltage V			0.6–1.0
Fuel pressure kPa (psi) Vacuum hose di		connected	330-350 (47-50) at curb idle
	Vacuum hose co	nnected	Approx. 270 (38) at curb idle
Injector coil resistance $\Omega$		13–16 [at 20°C (68°F)]	
Idle air control motor coil resistance $\Omega$		28–33 [at 20°C (68°F)]	

## SEALANT

13100050021

Item	Specified sealant
Engine coolant temperature sensor threaded portion	3M Nut Locking Part No. 4171 or equivalent

## SPECIAL TOOLS

13100060543

Tool	Tool number and name	Supersession	Application
	MB991502 Scan tool <mut-ii></mut-ii>	MB991496-OD	<ul> <li>Reading diagnostic trouble code</li> <li>MFI system inspection</li> </ul>
	MB991348 Test harness set	MB991348-01	<ul> <li>Adjustment of closed throttle position switch, throttle position sensor</li> <li>Inspection using an analyzer</li> </ul>

## MFI <1.8L Engine> – Special Tools

Тооі	Tool number and name	Supersession	Application
and the	MB991709 Test harness set	Tool not available	Inspection using an analyzer
	MB991529 Diagnostic trouble code check harness	Tool not necessary if scan tool <mut-ii> is available</mut-ii>	Check for diagnostic trouble codes.
	MD998463 Test harness (6 pin, square)	MD998463-01	<ul> <li>Inspection of idle air control motor</li> <li>Inspection using an analyzer</li> </ul>
	MD998464 Test harness (4 pin, square)	MD998464-01	<ul> <li>Inspection of heated oxygen sensor</li> <li>Inspection using an analyzer</li> </ul>
S	MD998478 Test harness (3 pin, triangle)	MD998478-01	Inspection using an analyzer
	MD998709 Adaptor hose	MIT210196	Measurement of fuel pressure
E	MD998742 Hose adaptor	MD998742-01	Measurement of fuel pressure
ROURS 2	MB991637 Fuel pressure gauge set	Tool not available	Measurement of fuel pressure


B991637


13B-7

## TROUBLESHOOTING

13100850430

#### DIAGNOSTIC TROUBLESHOOTING FLOW

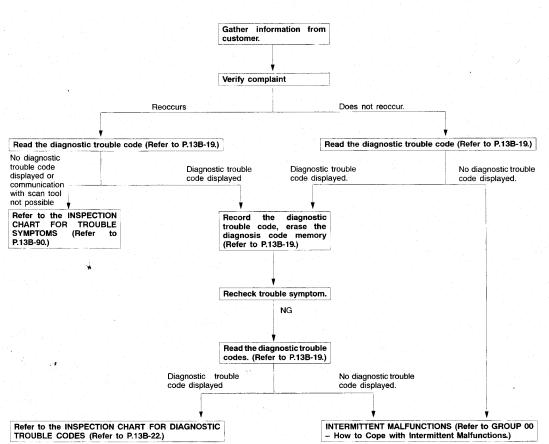

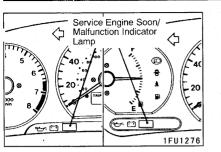

#### DIAGNOSTIC TEST MODE

13100860655

13B-9

# SERVICE ENGINE SOON/MALFUNCTION INDICATOR

Among the on-board diagnostic items, a Service Engine Soon/ Malfunction Indicator Lamp illuminates to notify the driver of an emission control malfunction.

However, when an irregular signal returns to normal and the engine control module judges that it has returned to normal, the Service Engine Soon/Malfunction Indicator Lamp is switched off.

Moreover, when the ignition switch is turned off, the lamp is switched off. Even if the ignition switch is turned on again, the lamp does not illuminate until the malfunction is detected. Immediately after the ignition switch is turned on, the Service Engine Soon/Malfunction Indicator Lamp is lit for 5 seconds to indicate that the Service Engine Soon/Malfunction Indicator Lamp operates normally.

#### Items Indicated by the Service Engine Soon/Malfunction Idicator Lamp

DCT No.	Items
-	Engine control module (ECM) malfunction
P0100	Volume air flow circuit malfunction
P0105	Barometric pressure circuit malfunction
P0110	Intake air temperature circuit malfunction
P0115	Engine coolant temperature circuit malfunction
P0120	Throttle position circuit malfunction
P0125*	Excessive time to enter closed loop fuel control
P0130	Heated oxygen sensor circuit malfunction (sensor 1)
P0135	Heated oxygen sensor heater circuit malfunction (sensor 1)
P0136	Heated oxygen sensor circuit malfunction (sensor 2)
P0141	Heated oxygen sensor heater circuit malfunction (sensor 2)
P0170	Fuel trim malfunction
P0201	Injector circuit malfunction cylinder-1
P0202	Injector circuit malfunction cylinder-2
P0203	Injector circuit malfunction cylinder-3
P0204	Injector circuit malfunction cylinder-4
P0300*	Random misfire detected
P0301*	Cylinder 1 misfire detected
P0302*	Cylinder 2 misfire detected
P0303*	Cylinder 3 misfire detected
P0304*	Cylinder 4 misfire detected
P0335	Crankshaft position sensor circuit malfunction
P0340	Camshaft position sensor circuit malfunction
P0400	Exhaust gas recirculation flow malfunction
P0403	Exhaust gas recirculation solenoid malfunction

#### MFI <1.8L Engine> - Troubleshooting

DCT No.	Items
P0420	Catalyst system efficiency below threshold <federal></federal>
P0421	Warm up catalyst efficiency below threshold <california></california>
P0442	Evaporative emission control system leak detected
P0443	Evaporative emission control system purge control valve circuit malfunction
P0446	Evaporative emission control system vent control malfunction
P0450	Evaporative emission control system pressure sensor malfunction
P0455	Evaporative emission control system leak detected (Gross leak)
P0505	Idle control system malfunction
P0510	Closed throttle position switch malfunction
P0551	Power steering pressure sensor circuit range/performance
P0705	Transmission range sensor circuit malfunction (PRND2L input)
P0710	Transmission fluid temperature sensor circuit malfunction
P0715	Input/turbine speed sensor circuit malfunction
P0720	Output speed sensor circuit malfunction
P0725	Engine speed input circuit malfunction
P0740	Torque converter clutch system malfunction
P0750	Shift solenoid A malfunction
P0755	Shift solenoid B malfunction
P0760	Shift solenoid C malfunction
P0765	Shift solenoid D malfunction
P1400	Manifold differential pressure sensor circuit malfunction
P1600	Serial communication link malfunction
P1751	A/T control relay malfunction
P1795	Throttle position input circuit malfunction

#### NOTE

- 1. After the Engine Control Module (ECM) detects a malfunction, the Service Engine Soon/malfunction indicator lamp illuminates when the engine is next turned on and the same malfunction is re-detected. However, for items marked with a "\*", the Service Engine Soon/Malfunction Indicator Lamp illuminates on the first detection of the malfunction.
- After the Service Engine Soon/Malfunction Indicator Lamp illuminates, it will be switched off under the following conditions.
- When the ECM monitored the powertrain malfunction three times\* and detected no malfunction.
  - \*: In this case, "one time" indicates from engine start to stop.
- For misfiring or a fuel trim malfunction, when driving conditions (engine speed, engine coolant temperature, etc.) are similar to those when the malfunction was first recorded.

#### Caution

If the Service Engine Soon/Malfunction Indicator Lamp illuminates because of a malfunction of the ECM, transmission between the scan tool and the ECM cannot occur. In this case, the diagnostic trouble code cannot be read.

#### **ON-BOARD DIAGNOSTICS**

The engine control module monitors the input/output signals (some signals all the time and others under specified conditions) of the engine control module.

When a malfunction continues for a specified time or longer after the irregular signal is initially monitored, the engine control module judges that a malfunction has occurred.

After the engine control module first detects a malfunction, a diagnostic trouble code is recorded when the engine is restarted and the same malfunction is re-detected. However, for items marked with a "\*", a diagnostic trouble code is recorded on the first detection of the malfunction.

There are 49 diagnostic items. The diagnostic results can be read out with a scan tool.

Since memorization of the diagnostic trouble codes is backed up directly by the battery, the diagnostic results are memorized even if the ignition key is turned off. The diagnostic trouble codes will, however, be erased when the battery terminal or the engine control module connector is disconnected. In addition, the diagnostic trouble code can also be erased by turning the ignition switch to ON and sending the diagnostic trouble code erase signal from the scan tool to the engine control module.

#### Caution

If the sensor connector is disconnected with the ignition switch turned on, the diagnostic trouble code is memorized. In this case, send the diagnostic trouble code erase signal to the engine control module in order to erase the diagnostic memory.

The 49 diagnostic items are all indicated sequentially from the smallest code number.

The engine control module records the engine operating condition when the diagnostic trouble code is set. This data is called "Freeze-frame" data. This data can be read by using the scan tool, and can then be used in simulation tests for troubleshooting. Data items are as follows.

Data	Unit
Engine coolant temperature	°C or °F
Engine speed	r/min
Vehicle speed	km/h or mph
Long-term fuel compensation (Long-term fuel trim)	%
Short-term fuel compensation (Short-term fuel trim)	%
Fuel control condition	<ul> <li>Open loop</li> <li>Closed loop</li> <li>Open loop-drive condition</li> <li>Open loop-DTC set</li> <li>Closed loop-O<sub>2</sub> (rear) failed</li> </ul>
Calculation load value	%
Diagnostic trouble code during data recording	

## **OBD-II DRIVE CYCLE**

All kinds of diagnostic trouble codes can be monitored by carrying out a short drive in accordance with the following 6 drive cycle patterns. In other words, doing such a drive allows to regenerate any kind of trouble which involves illuminating the Service Engine Soon/Malfunction Indicator Lamp and to check the repair procedure has eliminated the trouble (the Service Engine Soon/Malfunction Indicator Lamp is no longer illuminated).

#### Caution

Two mechanics should always get on the vehicle when carrying out a drive test.


#### Catalytic converter monitor (P0420, P0421)

#### Test requirements/procedure

- 1. All of the following requirements should be met when carrying out a drive test.
  - (1) Atmospheric temperature: -10°C (14°F) or more
    - (2) Condition of A/T:
      - Selector lever position: D range
  - (3) A/C switch: OFF
- One trip monitor will be completed by driving according to the steps below (from start to switch off). It will take 20 minutes.
  - \*1: Start the engine, and accelerate gradually to 72 km/h (45 mph) or more.
  - \*2: Preparation period; continue driving between 72 and 97 km/h (45 and 60 mph) for 300 seconds. Brake may be applied for this period if it continues for only a few seconds.
  - \*3: Decelerate to 56 64 km/h (35 40 mph).
  - ◆4: Drive between 56 and 64 km/h (35 and 40 mph) at a constant throttle angle (by not moving the throttle pedal as much as possible) for 90 seconds or more during monitor.
  - \*5: Decelerate with the throttle valve fully closed (Brake may be applied for this period). After the vehicle is being decelerated for ten seconds, accelerate gradually to 56 64 km/h (35 40 mph).

 $\star$ 6: Decelerate and stop the vehicle. Then turn off the ignition switch.

#### Drive cycle pattern

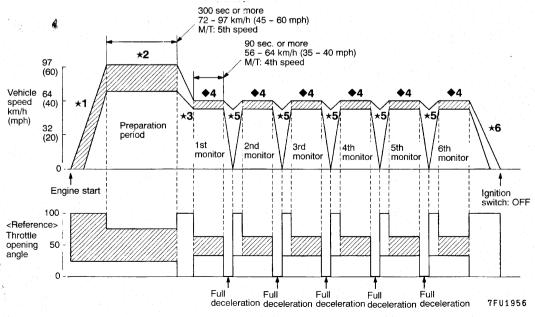

#### Caution


Vehicle speed and throttle opening angle should be within the shaded rage.

#### Evaporative emission control system leak monitor (P0422, P0450, P0455)

#### Test requirements/procedure

- 1. All of the following requirements should be met when carrying out a drive test.
  - (1) Engine coolant temperature: 45°C (113°F) or less (before starting drive test, engine stopped)
  - (2) Atmospheric temperature: 5°C (41°F) or more, 45°C (113°F) or less
  - (3) Condition of A/T:
    - Selector lever position: D range
    - Overdrive switch: ON
- One trip monitor will be completed by driving according to the steps below (from start to switch off). (It takes approx. 8 minutes.)
  - \*1: Check that both engine coolant temperature and air intake temperature satisfy requirement 1 (engine stopped).
  - \*2: Monitor preparation period; Start the engine, and accelerate to 89 97 km/h (55 60 mph). For this period, acceleration, deceleration, or braking may be carried out.
    - Continue driving between 89 and 97 km/h (55 and 60 mph) for 200 seconds or more. For this period, braking or throttle operation may be carried out if vehicle speed is within the specified value.
  - ◆3: Drive between 89 and 97 km/h (55 and 60 mph) at a constant throttle angle (by not moving the throttle pedal as much as possible) for 150 seconds or more during monitor. Moreover, do not turn the steering wheel suddenly.
  - \*4: Decelerate and stop the vehicle. After stop, turn off the ignition switch.

Drive cycle pattern

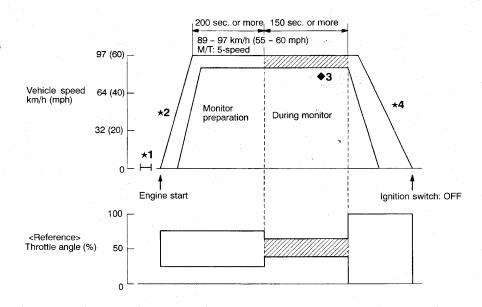

7FU1957

#### Caution


Drive within the shaded area in the graph above.

#### Heated oxygen sensor monitor (P0130, P0136)

#### Test requirements/procedure

- 1. Test requirements/procedure
  - (1) Engine coolant temperature: 80°C (176°F) or more (Engine fully warmed up)
  - (2) Atmospheric temperature: -10°C (14°F) or more
  - (3) Condition of A/T:
    - Selector lever position: D range
- 2. One trip monitor will be completed by driving according to the steps below (from start to switch off). It will take 5 minutes.
  - $\star$ 1: After warming up the engine, turn off the ignition switch.
  - \*2: Start the engine, and accelerate to 56 64 km/h (35 40 mph).
  - •3: Drive between 56 and 64 km/h (35 and 40 mph) at a constant throttle angle (by not moving the throttle pedal as much as possible) for 120 seconds or more during monitor. Moreover, do not turn the steering wheel suddenly.
  - \*4: Decelerate and stop the vehicle. Then turn off the ignition switch.

#### Drive cycle pattern

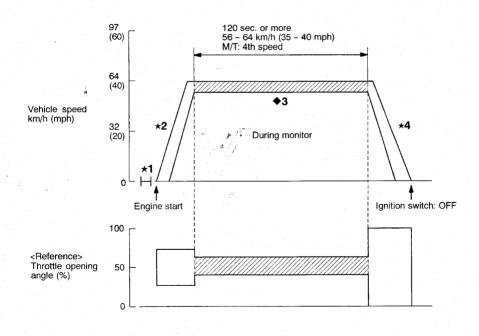

7FU1958

#### Caution


Vehicle speed and throttle opening angle should be within the shaded rage.

#### Exhaust gas recirculation (EGR) system monitor (P0400)

#### Test requirements/procedure

- 1. All of the following requirements should be met when carrying out a drive test.
  - (1) Engine coolant temperature: 80°C (176°F) or more (Engine fully warmed up)
  - (2) Atmospheric temperature: 5°C (41°F) or more
  - (3) Condition of A/T:
    - Selector lever position: D range
  - (4) A/C switch: OFF
- 2. One trip monitor will be completed by driving according to the steps below (from start to switch off). It will take approx. 10 minutes.
  - \*1: After warming up, turn off the ignition switch.
  - \*2: Start the engine, and accelerate to 56 64 km/h (35 40 mph).
  - S: Close the throttle fully from 2000 3000 r/min with the clutch engaged <M/T>, and then decelerate to 900 r/min without applying brakes. Moreover, do not turn the steering wheel or switch on or off the lights.
  - ★4: Accelerate to 56 64 km/h (35 40 mph), and continue driving for 20 seconds. (After 1st monitor (deceleration), wait for 20 seconds or more until the next monitor (deceleration) starts). Then repeat ◆3 and ★4 steps eight times.
  - \*5: Decelerate and stop. Then turn off the ignition switch.

#### Drive cycle pattern

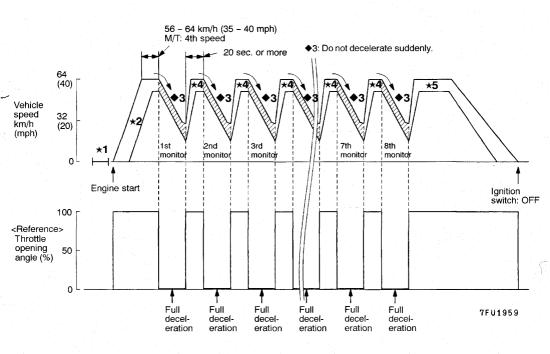


Caution Vehicle speed should be within the shaded rage.

#### Fuel trim monitor (P0170)

#### Test requirements/procedure

- 1. All of the following requirements should be met when carrying out a drive test.
  - (1) Engine coolant temperature: 80°C 97°C (176 207°F) (Engine fully warmed up)
  - (2) Atmospheric temperature: -10°C (14°F) or more, 60°C (140°F) or less
  - (3) Condition of A/T:
    - Selector lever position: D range
- One trip monitor will be completed by driving according to the steps below (from start to switch off). It will take 35 minutes.
  - \*1: After warming up the engine, turn off the ignition switch.
  - \*2: Start the engine, and accelerate to 89 97 km/h (55 60 mph).
  - ◆3: Drive between 89 and 97 km/h (55 and 60 mph) for 30 minutes or more during monitor. Moreover, do not drive the vehicle at the constant speed range for 120 seconds or more. (Accelerate or decelerate lightly within the 120 seconds. Brake may be applied, but avoid decelerating or accelerating suddenly).
  - \*4: Decelerate and stop the vehicle. Then turn off the ignition switch.

#### Drive cycle pattern

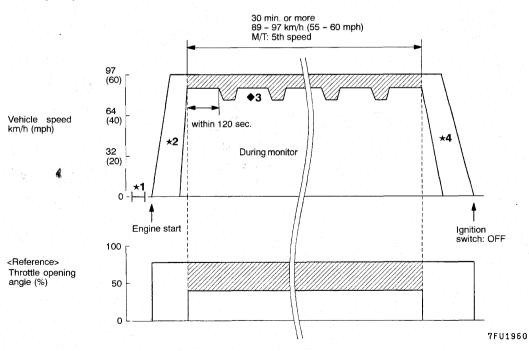

#### Caution

Vehicle speed and throttle opening angle should be within the shaded rage.

#### Other monitors


- Misfire (P0300, P0301, P0302, P0303, P0304)
- Evaporative emission control system (P0440)
- Idle air control system (P0505)
- Manifold differential pressure sensor (P1400)
- Excessive time to enter closed loop fuel control (P0125)
- Throttle position sensor (P0120)
- Barometric pressure sensor (P0105)
- Intake air temperature sensor (P0110)
- Serial communication link <A/T> (P1600)
- Crankshaft position sensor (P0335)
- Camshaft position sensor (P0340)

- Volume air flow sensor (P0100)
- Engine coolant temperature sensor (P0115)
- Closed throttle position switch (P0510)
- Generator FR terminal circuit (P1500)
- O<sub>2</sub> sensor circuit (P0130, P0136)
- $O_2^-$  sensor heater circuit (P0135, P0141)
- EGR solenoid (P0430)
- Evaporative emission purge solenoid (P0443)
- Injector circuit (P0201, P0202, P0203, P0204)
- Evaporative emission ventilation solenoid (P0446)

#### Test requirements/procedure

- 1. All of the following requirements should be met when carrying out a drive test.
  - (1) Engine coolant temperature: 80°C (176°F) or more (Engine fully warmed up)
  - (2) Atmospheric temperature: 5°C (41°F) or more
  - (3) Condition of A/T:
    - Selector lever position: D range
- 2. One trip monitor will be completed by driving according to the steps below (from start to switch off). It will take approx. 10 minutes.
  - \*1: After warming up, turn off the ignition switch.
  - ★2: Start the engine, accelerate to 56 64 km/h (35 40 mph), continue driving for 300 seconds or more at that speed range and stop. Moreover, brake or throttle may be applied for this period.
  - \*3: After stopping the vehicle, continue idling for 300 seconds or more, and then turn off the ignition switch. Moreover, the vehicle should be set to the following conditions for idling.
    - A/C switch: OFF
    - Lights, electric cooling fan and all accessories: OFF
    - Transaxle: Neutral (A/T for P range)
    - Steering wheel: Straight-forward position

#### Drive cycle pattern

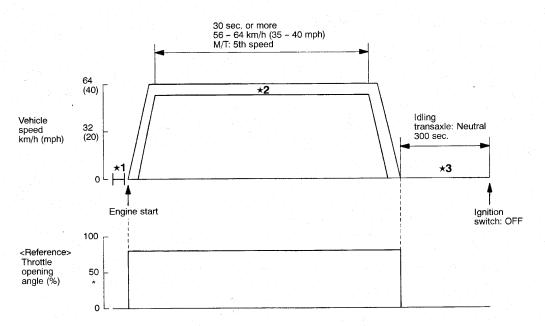

7FU1961

NOTE Drive according to the graph above.

#### READINESS TEST STATUS

The ECM monitors the following main diagnosis items and records whether the evaluation passing or failing in the past. These records can be read with a scan tool. (When using MUT-II, "Complete" will appear to indicate that the evaluation has been completed.)

These records will all be reset if the battery terminal is disconnected or the DTC are erased, etc.

To complete the readiness test status which has been reset, the "OBD-II Drive Cycle" related to a diagnosis item should be carried out.

#### NOTE

If the vehicle is normal, the readiness test status will be complete by carrying out the "OBD-II Drive Cycle" once. If the ECM detects a malfunction of the vehicle, the readiness test status will be complete by carrying out the "OBD-II Drive Cycle" twice. In addition, after all readiness test status are complete, a DTC should be interrogated. If a DTC is stored, perform repair by referring to the relevant DTC procedures. Then complete the readiness test status by repeating the "OBD-II Drive Cycle". If a DTC is not stored, no further action will be neede.

- Catalyst: P0420, P0421
- Evaporative system: P0442, P0455
- Heated oxygen sensor: P0130, P0136
- Heated oxygen sensor heater: P0135, P0141
- EGR system: P0400

## HOW TO READ AND ERASE DIAGNOSTIC TROUBLE CODES


#### Caution

- If battery voltage is low, diagnostic trouble codes may not be output. Be sure to check the battery and charging system before continuing.
- If the battery is disconnected or if the engine control module connector is disconnected, the diagnostic trouble code memory will be erased. Do not disconnect the battery or engine control module until after the diagnostic trouble codes are recorded.
- 3. Turn the ignition switch off before connecting or disconnecting the scan tool.

#### NOTE

If a DTC is erased, its "freeze frame" data will be also erased and the readiness test status will be reset. If necessary, take a note of the "freeze frame" data before erasing the DTC.

#### MFI <1.8L Engine> - Troubleshooting

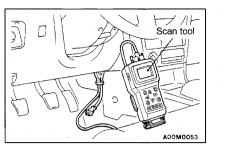

- 1. Connect the scan tool to the data link connector, and read the diagnostic trouble codes.
- 2. Repair the malfunction while referring to the INSPECTION CHART FOR DIAGNOSTIC TROUBLE CODES.
- 3. Turn the ignition switch to OFF and then back to ON again.
- 4. Erase the diagnostic trouble codes using the scan tool.
- Confirm that the diagnostic trouble code reading show is normal.

#### PROVISIONAL DTCs [MUT-II OBD-II Test Mode – Results (Mode 5)]

MUT-II will display the Provisional DTCs reported by ECM if the ECM detects some malfunction for "Misfire", "Fuel System" and "Comprehensive" monitoring during a SINGLE Driving Cycle.

The intended use of this data is to assist the technician after a vehicle repair, and after clearing diagnostic information, by reporting test result after a SINGLE Driving Cycle.

Note that the test results reported by this mode do not necessarily indicate a faulty component/system. If test results indicate a failure after ADDITIONAL (consecutive) driving, then the MIL will be illuminated and a DTC will set.

#### DIAGNOSTIC BY DIAGNOSTIC TEST MODE II (INCREASED SENSITIVITY)

When mode II is selected with MUT-II, the Service Engine Soon/Malfunction Indicator Lamp will light when the ECM first detects the trouble. (Note that this is only for engine related trouble.) At the same time, the relevant diagnostic trouble codes will be registered.

In respect to the comprehensive component electrical faults (opens/shorts), the time for the DTC to be registered after the fault occurrence is shortened (4 sec.  $\rightarrow$  1 sec.)

With this, the confirmation of the trouble symptom and the confirmation after completing repairs can be reduced.

To return to the normal mode I after mode II has been selected once, the ignition switch must be turned OFF once or mode I must be reselected with the MUT-II. The DTC, readiness test status and freeze frame data, etc., will be erased when mode I is returned to, so record these if necessary.

- Using the scan tool, changeover the diagnostic test mode of the engine control module to DIAGNOSTIC TEST MODE II. (INCREASED SENSITIVITY)
- (2) Road test the vehicle.
- (3) Read the diagnostic trouble code in the same manner as "READ OUT OF DIAGNOSTIC TROUBLE CODE" and repair the malfunctioning part.
- (4) Turn OFF the ignition switch.

#### NOTE

Turning OFF the ignition switch will cause the ECM to changeover from the diagnostic test mode II to the diagnostic test mode I.



#### INSPECTION USING SCAN TOOL DATA LIST AND ACTUA-TOR TESTING

1. Carry out inspection by means of the data list and the actuator test function.

If there is an abnormality, check and repair the chassis harnesses and components.

- 2. After repairing, re-check using the scan tool and check to be sure that the abnormal input and output have re-turned to normal as a result of the repairs.
- 3. Erase the diagnostic trouble code(s).
- 4. Remove the scan tool.
- 5. Start the engine again and road test to confirm that the problem is eliminated.

NOTE

Refer to P.13B-125 for Data list. Refer to P.13B-130 for Actuator tests.

#### FAIL-SAFE/BACKUP FUNCTION TABLE

#### 13100910213

When the main sensor malfunctions are detected by the diagnostic test mode, the vehicle is controlled by means of the following defaults.

Malfunctioning item	Control contents during malfunction
Volume air flow sensor	<ol> <li>Uses the throttle position sensor signal and engine speed signal (crankshaft position sensor signal) for basic injector drive time and basic ignition timing from the pre-set mapping.</li> <li>Fixes the IAC motor in the appointed position so idle air control is not performed.</li> </ol>
Intake air temperature sensor	Controls as if the intake air temperature is 25°C (77°F).
Throttle position sensor (TPS)	No increase in fuel injection amount during acceleration due to the unreliable throttle posi- tion sensor signal.
Engine coolant temperature sensor	Controls as if the engine coolant temperature is 80°C (176°F).
Camshaft position sensor	Injects fuel into the cylinders in the order 1-3-4-2 with irregular timing. (After the ignition switch is turned to ON, the No. 1 cylinder top dead center is not detected at all.)
Barometric pressure sensor	Controls as if the barometric pressure is 101 kPa (30 in.Hg) (sea level).
Heated oxygen sensor <front></front>	Air/fuel ratio closed loop control is not performed
Heated oxygen sensor <rear></rear>	Performs the closed loop control of the air/fuel ratio by using only the signal of the heated oxygen sensor (front) installed on the front side of the catalytic converter.
Generator FR terminal	No generator output suppression control is performed for the electrical load (to be oper- ated as an ordinary generator).
Misfire detection	The ECM stops supplying fuel to the cylinder with the highest misfiring rate if a misfiring that could damage the catalytic converter is detected.

## INSPECTION CHART FOR DIAGNOSTIC TROUBLE CODES (FAULT TREE)

1310087075	7

•

DTC No.	Diagnostic items	Check items (Remedy)	Memory	Reference page
P0100	Volume Air Flow Circuit Malfunction	<ul> <li>Harness and connector (If harness and connector are normal, replace volume air flow sensor assembly.)</li> </ul>	Retained	13B-26
P0105	Barometric Pressure Circuit Malfunction	<ul> <li>Harness and connector (If harness and connector are normal, replace volume air flow sensor assembly.)</li> </ul>	Retained	13B-27
P0110	Intake Air Temperature Circuit Malfunction	<ul> <li>Harness and connector</li> <li>Intake air temperature sensor</li> </ul>	Retained	13B-28
P0115	Engine Coolant Temperature Circuit Malfunction	<ul><li>Harness and connector</li><li>Engine coolant temperature sensor</li></ul>	Retained	13B-29
P0120	Throttle Position Circuit Malfunction	<ul> <li>Harness and connector</li> <li>Throttle position sensor</li> <li>Closed throttle position switch</li> </ul>	Retained	13B-30
P0125	Excessive Time to Enter Closed Loop Fuel Control*	<ul> <li>O<sub>2</sub> sensor (front)</li> <li>O<sub>2</sub> sensor harness and connector</li> <li>Injector</li> </ul>	Retained	13B-31
P0130	O <sub>2</sub> Sensor Circuit Malfunction (Sensor 1)	<ul> <li>Harness and connector [If harness and connector are normal, replace O<sub>2</sub> sensor (front).]</li> </ul>	Retained	13B-32
P0135	O2 Sensor Heater Circuit Malfunction (Sensor 1)	<ul> <li>Harness and connector</li> <li>O<sub>2</sub> sensor (front) heater</li> </ul>	Retained	13B-33
P0136	O <sub>2</sub> Sensor Circuit Malfunction (Sensor 2)	<ul> <li>Harness and connector</li> <li>O<sub>2</sub> sensor (rear)</li> </ul>	Retained	13B-34
P0141	O <sub>2</sub> Sensor Heater Circuit Malfunction (Sensor 2)	<ul> <li>Harness and connector</li> <li>O<sub>2</sub> sensor (rear) heater</li> </ul>	Retained	13B-35
P0170	Fuel Trim Malfunction	<ul> <li>Volume air flow sensor output frequency</li> <li>Injector</li> <li>Fuel pressure</li> <li>Intake air leaks</li> <li>Engine coolant temperature sensor</li> <li>Intake air temperature sensor</li> <li>Barometric pressure sensor</li> <li>O<sub>2</sub> Sensor</li> <li>Exhaust manifold cracks</li> </ul>	Retained	13B-36
P0201	Injector Circuit Malfunction – Cylinder 1	<ul><li>Harness and connector</li><li>Injector</li></ul>	Retained	13B-37
P0202	Injector Circuit Malfunction – Cylinder 2			
P0203	Injector Circuit Malfunction – Cylinder 3			
P0204	Injector Circuit Malfunction – Cylinder 4			

## MFI <1.8L Engine> - Troubleshooting

DTC No.	Diagnostic items	Check items (Remedy)	Memory	Reference page
P0300	Random Misfire Detected	<ul> <li>Ignition coil</li> <li>Ignition power transistor</li> <li>Spark plug</li> <li>Ignition circuit</li> <li>Injector</li> <li>O<sub>2</sub> Sensor</li> <li>Compression</li> <li>Timing belt</li> <li>Crankshaft position sensor</li> <li>Air intake</li> <li>Fuel pressure</li> <li>Crankshaft position sensor circuit and connector</li> </ul>	Retained	13B-38
P0301 P0302	Cylinder 1 Misfire Detected Cylinder 2 Misfire Detected	<ul> <li>Ignition coil</li> <li>Ignition power transistor</li> <li>Spark plug</li> <li>Ignition circuit</li> <li>Injector</li> <li>O<sub>2</sub> Sensor</li> </ul>	Retained	13B-39
P0303 P0304	Cylinder 3 Misfire Detected Cylinder 4 Misfire Detected	<ul> <li>Compression</li> <li>Timing belt</li> <li>Crankshaft position sensor</li> <li>Air intake</li> <li>Fuel pressure</li> <li>Crankshaft position sensor circuit and connector</li> </ul>		
P0335	Crankshaft Position Sensor Circuit Malfunction	<ul> <li>Harness and connector (If harness and connector are normal, replace crankshaft position sensor.)</li> </ul>	Retained	13B-40
P0340	Camshaft Position Sensor Circuit Malfunction	<ul> <li>Harness and connector (If harness and connector are normal, replace camshaft position sensor.)</li> </ul>	Retained	13B-41
P0400	Exhaust Gas Recirculation Flow Malfunction	<ul> <li>Harness and connector</li> <li>EGR valve</li> <li>EGR solenoid</li> <li>EGR valve control vacuum</li> <li>Manifold differential pressure sensor</li> </ul>	Retained	13B-42
P0403	Exhaust Gas Recirculation Sole- noid Malfunction	<ul> <li>Harness and connector</li> <li>EGR solenoid</li> </ul>	Retained	13B-43
P0420	Catalyst Efficiency Below Thresh- old <federal></federal>	<ul> <li>Exhaust manifold (Replace the catalytic converter if there is no cracks, etc.)</li> </ul>	Retained	13B-44
P0421	Warm Up Catalyst Efficiency Below Threshold <california></california>	<ul> <li>Exhaust manifold (Replace the catalytic converter if there is no cracks, etc.)</li> </ul>	Retained	13B-45
P0442	Evaporative Emission Control System Leak Detected	<ul> <li>Harness and connector</li> <li>Evaporative emission purge solenoid</li> <li>Evaporative emission ventilation solenoid</li> <li>Vacuum hoses routing</li> </ul>	Retained	13B-46

## MFI <1.8L Engine> - Troubleshooting

.

DTC No.	Diagnostic items	Check items (Remedy)	Memory	Reference page
P0443	Evaporative Emission Control System Purge Control Valve Circuit Malfunction	<ul> <li>Harness and connector</li> <li>Evaporative emission purge solenoid</li> </ul>	Retained	13B-56
P0446	Evaporative Emission Control System Vent Control Malfunction	<ul> <li>Harness and connector</li> <li>Evaporative emission ventilation solenoid</li> </ul>	Retained	13B-57
P0450	Evaporative Emission Control System Pressure Sensor Malfunc- tion	<ul> <li>Harness and connector</li> <li>Fuel tank differential pressure sensor</li> </ul>	Retained	13B-58
P0455	Evaporative Emission Control System Leak Detected (Gross Leak)	<ul> <li>Harness and connector</li> <li>Evaporative emission ventilation solenoid</li> </ul>	Retained	13B-70
P0500	Vehicle Speed Sensor Malfunction	<ul><li>Harness and connector</li><li>Vehicle speed sensor</li></ul>	Retained	13B-80
P0505	Idle Control System Malfunction	<ul><li>Harness connector</li><li>Idle air control motor</li></ul>	Retained	13B-81
P0510	Closed Throttle Position Switch Malfunction	<ul><li>Harness and connector</li><li>Closed throttle position switch</li></ul>	Retained	13B-82
P0551	Power Steering Pressure Sensor Circuit Range/Performance	<ul><li>Harness and connector</li><li>Power steering pressure switch</li></ul>	Retained	13B-83
P0705	Transmission Range Sensor Cir- cuit Malfunction (PRND2L Input)	<ul> <li>Harness and connector</li> <li>Park/Neutral position switch</li> </ul>	Retained	13B-83
P0710	Transmission Fluid Temperature Sensor Circuit Malfunction	<ul><li>Harness and connector</li><li>Transaxle fluid temperature sensor</li></ul>	Retained	13B-83
P0715	Input/turbine Speed Sensor Circuit Malfunction	<ul><li>Harness and connector</li><li>Pulse generator</li></ul>	Retained	13B-84
P0720	Output Speed Sensor Circuit Malfunction	<ul><li>Harness and connector</li><li>Pulse generator</li></ul>	Retained	13B-84
P0725	Engine Speed Input Circuit Malfunction	• Harness and connector	Retained	13B-84
P0740	Torque Converter Clutch System Malfunction	<ul> <li>Harness and connector</li> <li>Torque converter clutch solenoid</li> </ul>	Retained	13B-84
P0750	Shift Solenoid A Malfunction	<ul><li>Harness and connector</li><li>Low-reverse solenoid</li></ul>	Retained	13B-84
P0755	Shift Solenoid B Malfunction	<ul><li>Harness and connector</li><li>Underdrive solenoid</li></ul>	Retained	13B-85
P0760	Shift Solenoid C Malfunction	<ul><li>Harness and connector</li><li>Second solenoid</li></ul>	Retained	13B-85
P0765	Shift Solenoid D Malfunction	<ul> <li>Harness and connector</li> <li>Overdrive solenoid</li> </ul>	Retained	13B-85
P1400	Manifold Differential Pressure (MDP) Sensor Circuit Malfunction	<ul><li>Harness and connector</li><li>MDP sensor</li></ul>	Retained	13B-86
P1500	Generator FR Terminal Circuit Malfunction	Harness and connector	Retained	13B-88
P1600	Serial Communication Link Malfunction	Harness and connector	Retained	13B-89
P1720	Vehicle Speed Sensor Signal Line Malfunction	Harness and connector	Retained	13B-89

#### MFI <1.8L Engine> - Troubleshooting

DTC No.	Diagnostic items	Check items (Remedy)	Memory	Reference page
P1751	A/T Control Relay Malfunction	<ul> <li>Harness and connector</li> <li>A/T control relay</li> </ul>	Retained	13B-89
P1795	Throttle Position Input Circuit Malfunction	Harness and connector	Retained	13B-89

#### NOTE

- 1. Do not replace the engine control module (ECM) until a thorough terminal check reveals there are no short/open circuits.
- After the ECM detects a malfunction, a diagnostic trouble code is recorded the next time the engine started and the same malfunction is re-detected. However, for items marked with a "\*", the diagnostic trouble code is recorded on the first detection of the malfunction.
- 3. O2 : Heated oxygen sensor
- 4. Sensor 1 : indicates sensors which are mounted closest to the engine.
- 5. Sensor 2 : indicates sensors which are mounted next-closest to the engine.

.

## INSPECTION PROCEDURE FOR DIAGNOSTIC TROUBLE CODES

Code No. P0100 Volume Air	Flow Circuit Malfunction	Probable cause		
<ul> <li>which corresponds to the volume of</li> <li>The engine control module checks v</li> </ul>	ime air flow sensor outputs a pulse signal air flow. /hether the frequency of this signal output the engine is running at or above the set	<ul> <li>Volume air flow sensor failed</li> <li>Open or shorted volume airflow sensor circuit, or loose connector</li> <li>Engine control module failed</li> </ul>		
<ul> <li>Engine speed is not lower than 500 Judgment Criteria</li> <li>Sensor output frequency has continu Check Area</li> </ul>				
<ul> <li>Throttle position sensor voltage is 2'</li> <li>Engine speed is not higher than 200 Judgment Criteria</li> <li>Sensor output frequency has continued</li> </ul>	0 r/min.			
Check Area Throttle position sensor voltage is 1 Engine speed is 2000 r/min or more Judgment Criteria Sensor output frequency is 60 Hz o				
Measure at the volume air flow sensor connector A-58. • Measure with the connector connected. (Use the test harness: MB991709).	Check the volume air flow sensor → circuit. (Refer to P.13B-123, IN- SPECTION PROCEDURE 47.)			
1. Voltage between 3 and ground (Engine: idling) OK: 2.2–3.2 V 2. Voltage between 7 and ground	<ul> <li>Measure at the ECM connectors</li> <li>B-40.</li> <li>Measure with the connector</li> </ul>	Check the following connector: NG ► Repair A-58		
OK: 0-1 V (Engine: idling) 6-9 V (3,000 r/min)	<ul> <li>voltage between 19 and ground (Ignition switch: ON)</li> </ul>	Check trouble symptom.		
VOK Replace the ECM.	<b>ОК:</b> 6–9 V	NG		
	Check the following connector: B-40	≻ Repair		
	ОК	Replace the volume air flow sensor.		
	Check trouble symptom.			
	Replace the ECM.			

·	i me a gue		$ \mathcal{F}_{i}  =  \mathcal{F}_{i}  +  $	
Code No. P0105 Barometric Malfunction	Pressure Circuit		Probable cause	
barometric pressure. • The engine control module checks wi Check Area • 2 sec or more have passed since t • Battery voltage is not lower than 8V Judgment Criteria • Sensor output voltage has continue barometric pressure of 114 kPa (17 or	d to be 4.5V or higher [corresponding to ' psi) or higher] for 10 sec, ad to be 0.195V or lower [corresponding	ge. ba	<ul> <li>Barometric pressure sen</li> <li>Open or shorted barome or loose connector</li> <li>Engine control module fa</li> </ul>	etric pressure sensor circuit,
Measure at the volume air flow sen- sor connector A-58. Measure with the connector connected. (Use the test harness: MB991709) Voltage between 2 and ground (Ignition switch: ON) OK: 3.7-4.3 V	<ul> <li>Measure at the volume air flow sensor connector A-58.</li> <li>Disconnect the connector, and measure at the harness side.</li> <li>Voltage between 1 and ground (Ignition switch: ON)</li> <li>OK: 4.8–5.2 V</li> <li>Continuity between 5 and</li> </ul>	G	Check the following conne B-37 V OK Check trouble symptom.	ector: NG ► Repair
[Altitude: 0 m (0 ft.)] 3.2–3.8 V [Altitude: 1,200 m (3,937 ft.)]	ground OK: Continuity OK		Check the harness wire bet the ECM and the barometric sure sensor connector.	ween Repair
ОК	Check the following connector: A-58	IG	► Repair	
Measure at the ECM connector NG B-37. • Measure with the connector	OK Check trouble symptom.		Replace the ECM.	
<ul> <li>connected.</li> <li>Voltage between 65 and</li> </ul>	NG	١G	32	······································

- ground (Ignition switch: ON) OK: 3.7-4.3 V [Altitude: 0 m (0 ft.)] 3.2-3.8 V
  - ¥ [(Altitude: 1,200 m (3,937 ft.)]

OK

Check the harness wire between the ECM and the barometric pressure sensor connector. Repair, if necessary.

Check the harness wire between

the ECM and the barometric pres-

Replace the volume air flow sensor.

OK

sure sensor connector.

NG Check the following connector:

OK ÷.

Check trouble symptom. NG Ŷ

B-37


Replace the ECM.

Repair


Repair

٠

Code No. P0110 Intake Air Temperature Circuit Malfunction	Probable cause
<ul> <li>Background</li> <li>The intake air temperature sensor converts the intake air temperature to a voltage and outputs it.</li> <li>The engine control module checks whether the voltage is within a specified range.</li> </ul>	<ul> <li>Intake air temperature sensor failed</li> <li>Open or shorted intake air temperature sensor circuit, or loose connector</li> <li>Engine control module failed</li> </ul>
<ul> <li>Check Area</li> <li>2 sec or more have passed since the starting sequence was completed.</li> <li>Judgment Criteria</li> <li>Sensor output voltage has continued to be 4.6V or higher [corresponding to an term of the sector of the se</li></ul>	
<ul> <li>intake air temperature of -45°C (-49°F) or lower] for 2 sec,</li> <li>or</li> <li>Sensor output voltage has continued to be 0.2V or lower [corresponding to an intake air temperature of 125°C (257°F) or higher] for 2 sec.</li> </ul>	

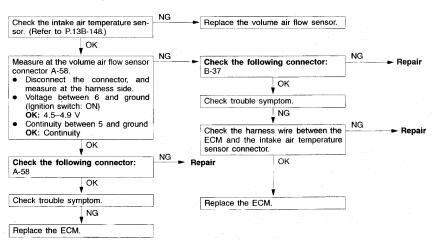


Code No. P0115 Engine Coolant Temperature Circuit Malfunction	Probable cause
<ul> <li>Background</li> <li>The engine coolant temperature sensor converts the engine coolant temperature to a voltage and outputs it.</li> <li>The engine control module checks whether the voltage is within a specified range in addition, it checks that the engine coolant temperature (signal) does not drop while the engine is warming up.</li> </ul>	<ul> <li>circuit, or loose connector</li> <li>Engine control module failed</li> </ul>
<ul> <li>Check Area</li> <li>At least 2 seconds have passed since the ignition switch was turned on or the starting sequence was completed.</li> <li>Judgment Criteria</li> </ul>	
<ul> <li>Sensor output voltage has continued to be 4.6V or higher [corresponding to a coolant temperature of -45°C (-49°F) or lower] for 2 sec, or</li> </ul>	
<ul> <li>Sensor output voltage has continued to be 0.1V or lower [corresponding to a coolant temperature of 140°C (284°F) or higher] for 2 sec.</li> <li>Check Area</li> </ul>	<ul> <li>A Constraint of the state of th</li></ul>
<ul> <li>Judgment Criteria</li> <li>Sensor output voltage increased from a value lower than 1.6V to a value higher than 1.6V [Coolant temperature decreases from a higher than 40°C (104°F temperature to a lower than 40°C (104°F) temperature.].</li> <li>Then the sensor output voltage has continued to be 1.6V or higher for 5 min Check Area Judgment Criteria</li> </ul>	)
<ul> <li>About 5 min or more have passed for the engine coolant temperature to rise to about 40°C (104°F) after starting sequence was completed.</li> <li>Note that time must not be counted when average output frequency of the volum air flow sensor is 70 Hz or lower, or when fuel is being shut off.</li> <li>Check Area</li> </ul>	
<ul> <li>Engine coolant temperature was 20°C (68°F) <federal> or 7°C (44.6°F <california> or more immediately before the engine was stopped at the last drive</california></federal></li> <li>Engine coolant temperature is higher than 20°C (68°F) <federal> or 7°C (44.6°F <california> when the engine is started.</california></federal></li> <li>Judgement Criteria</li> </ul>	2.
<ul> <li>Engine coolant temperature fluctuates within 1°C (1.8°F) after 5 minutes hav passed since the engine was started.</li> <li>However, time is not counted in any of the following conditions: (1) Intake air temperature is 60°C (140°F) or higher.</li> </ul>	3 
<ul> <li>(2) Engine speed is 1,500r/min or higher.</li> <li>(3) Volumetric efficiency is 25% or lower.</li> <li>(4) During fuel shut-off operation.</li> <li>Monitored only once per trip.</li> </ul>	
Check the engine coolant temperature NG  Replace sensor. (Refer to P.13B-148.)	
OK NG	NG
Measure at the engine coolant  Check the following connect tamparature expected to 60	stor: Repair

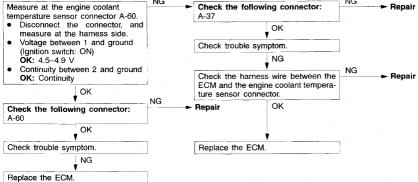

Code No. P0120 Throttle P	osition Circuit Malfunction	Probable cause
valve opening angle. • The engine control module checks w sensor is within a specified range In addition, it checks that the volt the engine is idling. Check Area	age output does not become too large whi	<ul> <li>connector</li> <li>Closed throttle position switch malfunction</li> <li>Closed throttle position switch signal wire shorted</li> </ul>
<ul> <li>At least 2 seconds have passed a Judgment Criteria</li> <li>With the close throttle position swi continued to be 2V or higher for 2 or</li> </ul>	tch set to ON, the sensor output voltage ha	15
<ul> <li>Sensor output voltage has continu Check Area</li> <li>At least 2 seconds have passed a</li> <li>Engine speed is 3000 r/min or less</li> <li>Volume efficiency is 30% or less.</li> <li>Judgment Criteria</li> <li>Sensor output voltage has continu Check Area</li> <li>At least 2 seconds have passed a</li> <li>Engine speed is 2000 r/min or more Volume efficiency is 60 % or more Judgment Criteria</li> <li>Sensor output voltage has continu Check Area</li> <li>Engine speed is 2000 r/min or more Judgment Criteria</li> <li>Sensor output voltage is 0.8 V or</li> </ul>	after the engine was started. ss. led to be 4.6V or higher for 2 sec. after the engine was started. ore. e.	
SCAN TOOL Data list 26 Closed throttle position switch system OK: With the throttle valve at the idle position: ON With the throttle valve slightly open: OFF	NG Check the closed throttle switch system. (Refer to P.13B-110, INSF PROCEDURE 30.)	
OK Check the throttle position sensor.	NG Replace	
(Refer to P.13B-148.)	NG	
Measure at the throttle position sensor connector A-52.	Check the following conne B-37	ector: Repair

- Disconnect the connector, and measure at the harness side.
- Voltage between 1 and ground (Ignition switch: ON)
   OK: 4.8–5.2 V
- Continuity between 4 and ground OK: Continuity



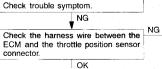

Ý

Replace the ECM.


► Repair

Code No. P0125 Excessive Time to Enter Closed Loop Fuel Control	Probable cause	
Background The MFI system reduces exhaust emissions by means of closed-loop fuel control. The engine control module checks the time taken until closed-loop fuel control commences.	<ul> <li>Heated oxygen sensor failed</li> <li>Injector failed</li> <li>Fuel pressure regulator failed</li> <li>Fuel pump failed</li> </ul>	
Check Area • At least 2 seconds have passed after the engine started. • Engine coolant temperature is higher than 80°C (176°F).	<ul> <li>Fuel filter is clogged</li> <li>Intake system vacuum leak</li> <li>Exhaust leak</li> </ul>	
<ul> <li>Engine speed is at between about 1800 and 3500 r/min.</li> <li>Volumetric efficiency is 16% - 62%.</li> </ul>	<ul> <li>Engine control module failed</li> </ul>	
<ul> <li>Engine operating within the air-fuel ratio feedback zone.</li> <li>Monitoring time: 30 sec</li> </ul>		
Judgment Criteria Multiport fuel injection system doesn't enter the closed loop control within about		
<ul> <li>30 sec.</li> <li>Monitored only once per trip.</li> </ul>		


		NG	
Check the heated ox	kygen sensor (front). (Refer to P.13B-150.)		<ul> <li>Replace</li> </ul>
	ОК	NG	
Check the following A-67, A-83, B-37	g connectors:		► Repair
-	OK	NG	
Check the harness wi sensor (front) connect	ire between the ECM and the heated oxygen ctor.		► Repair
	ОК		
Check the Injector, (	Befer to P13B-152.)	NG	Replace
	OK	1	•
<u>.</u>	<b>V</b>	NG	Develo
Check the following A-70, A-71, A-72, A-			
	ок	NG	3°243 N. 18
Check the harness wi tor.	re between the ECM and the injector connec-	ING	
	ОК		1
Check the fuel press	sure. (Refer to P.13B-144.)	].	
	OK		
<ul> <li>Check for exhaus cracks in exhaus</li> <li>Check for cloggir</li> </ul>	tem vacuum leak. st leaks (oxygen sensor installation section, t manifold, cracks in front pipe, etc.). g of the fuel filter and fuel line. ump (insufficient discharge rate).		
	ок		
Replace the ECM.		1	


Code No. P0130 Oxygen Sensor Circuit Malfunction Sensor 1)	Probable cause
Background	Heated oxygen sensor deteriorated
<ul> <li>When the heated oxygen sensor begins to deteriorate, the oxygen sensor signal response becomes poor.</li> </ul>	<ul> <li>Open circuit in heated oxygen sensor output line</li> <li>Engine control module failed</li> </ul>
The engine control module forcibly varies the air/fuel mixture to make it leaner and richer and checks the response speed of the heated oxygen sensor. In addition,	
the engine control module also checks for an open circuit in the heated oxygen sensor output line.	
Check Area	
<ul> <li>Coolant temperature sensor: normal</li> <li>Heated oxygen sensor signal voltage has continued to be 0.2V or lower for 3 min or more after the starting sequence was completed.</li> </ul>	
<ul> <li>Engine speed is higher than 1200 //min.</li> </ul>	
Volumetric efficiency is not lower than 25%. Monitoring time: 7 sec	
udgment Criteria Input voltage supplied to the engine control module interface circuit is not lower	
than 4.5V when 5V is applied to the heated oxygen sensor output line via a resistor. Monitored only once per trip.	
Check Area	
<ul> <li>Engine coolant temperature is not lower than 50°C (122°F).</li> <li>Engine speed is between 1600 and 3000 r/min <m t=""> or 1400 and 3000 r/min <a t=""></a></m></li></ul>	
<ul> <li>Volumetric efficiency is 22 - 60% <m t=""> or 25 - 60% <a t="">.</a></m></li> <li>Intake air temperature is -10°C (14°F) or more</li> </ul>	
<ul> <li>Atmospheric pressure is 76 kPa (11 psi) or more.</li> <li>Under the closed loop air-fuel control.</li> </ul>	
Vehicle speed is 30 km/h (18.7 mph) or higher. Throttle valve opening angle (TPS output voltage) fluctuates within 0.117V every 250 milliseconds.	
Monitoring Time: 5 – 20 sec	
When the air-fuel ratio is forcibly changed (lean to rich and rich to lean), the heated oxygen sensor signal doesn't provide response within 1.2 sec. or	
<ul> <li>The heated oxygen sensor sends "lean" and "rich" signals alternately nine times or less for ten seconds.</li> </ul>	
Monitored only three times per trip.	
NOTE: If the sensor switch time is longer than the Judgment Criteria due to the MUT-II OBD-II test Mode – H02S Test Results, it is assumed that the heated oxygen	
sensor has deteriorated. If it is short, it is assumed that the harness wire is broken or has a short circuit. If the heated oxygen sensor signal voltage has not changed even once (lean/rich)	
after the DTC was erased, the sensor switch time will display as 0 seconds.	
OK	NG
Check the heated oxygen sensor Check the following connector front). (Refer to P.13B-150.) A-67, A-83, B-37	rs:► Repair
NGOK	

OK		
Check trouble symptom.	]	
NG	NG	
Check the harness wire between the ECM and the heated oxygen sensor (front) connector.	NG ► Repa	
ОК		
Replace the oxygen sensor (front).	]	
a de la compañía de l		
Check trouble symptom.		
NG		
Replace the ECM.	1	

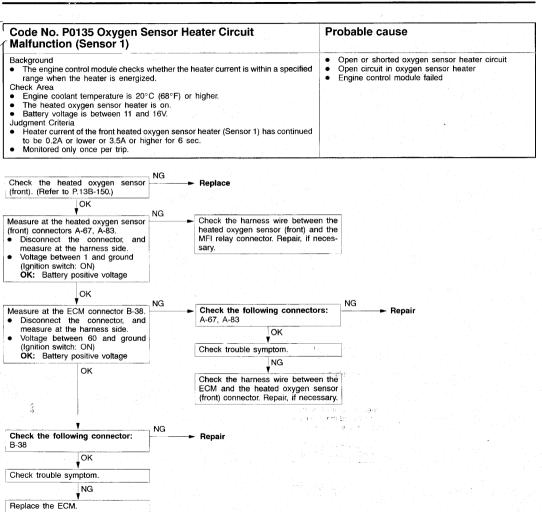

Code No. P0136 Oxygen Sensor Circuit Malfunction (Sensor 2)	Probable cause where we have	
Background	<ul> <li>Heated oxygen sensor failed</li> </ul>	
<ul> <li>The engine controls module checks for an open circuit in the heated oxygen sensor output line.</li> </ul>	<ul> <li>Open circuit in heated oxygen sensor output line</li> <li>Engine control module failed</li> </ul>	
Check Area		
<ul> <li>Coolant temperature sensor: normal</li> </ul>	[1] A. A. A. M. Market, "International control of the state of the	
<ul> <li>Heated oxygen sensor signal voltage has continued to be 0.1V or lower for 3</li> </ul>		
min or more after the starting sequence was completed.	Constraints and the standard second state of the second s second second se second second sec second second sec	
<ul> <li>Engine coolant temperature is not lower than 80°C (176°F).</li> </ul>	•	
Engine speed is higher than 1200 r/min.		
<ul> <li>Volumetric efficiency is not lower than 25%.</li> </ul>		
<ul> <li>Monitoring time: 7 sec.</li> </ul>		
Judgment Criteria	Construction of the second se second second sec	
<ul> <li>Input voltage supplied to the engine control module interface circuit is not lower</li> </ul>		
than 4.5V when 5V is applied to the heated oxygen sensor output line via a resistor.		
<ul> <li>Monitored only once per trip.</li> </ul>		
Check Area		
Heated oxygen sensor (rear) signal voltage remains 0.1V or less for at least 3		
minutes after the engine is started.		
<ul> <li>Engine coolant temperature is about 80°C (176°F) or higher.</li> </ul>		
<ul> <li>Engine speed is about 1,200 rpm or higher.</li> </ul>		
<ul> <li>Volumetric efficiency is 25% or higher.</li> </ul>		
<ul> <li>Output frequency of the volume air flow sensor is 113 Hz or higher.</li> </ul>		
<ul> <li>At least 20 seconds have passed since fuel supply shut-off control was released.</li> </ul>		
<ul> <li>At least 20 seconds have passed since her supply share in control was released.</li> <li>Output voltage of the oxygen sensor (front) is 0.5V or higher.</li> </ul>		
<ul> <li>Monitoring time: 10 seconds.</li> </ul>	and the second	
Judgement Criteria		
<ul> <li>Making the air-fuel ratio 15% richer doesn't result in raising the heated oxygen</li> </ul>		
sensor output voltage beyond 0.1V.	[1] A. M. Martin, "A strain of the strain	
Monitored only once per trip. Check Area		
<ul> <li>Engine coolant temperature is about 80°C (176°F) or higher.</li> <li>Barometric pressure is 76 kPa (11 psi) or higher.</li> </ul>		
<ul> <li>The heated oxygen sensor (front) is operating.</li> <li>The sense for at least 10 sense is fuel ratio is rish.</li> </ul>		
• The engine runs for at least 10 seconds when air-fuel ratio is rich.	[1] A.	
• The heated oxygen sensor (rear) output voltage is 0.4V or more before fuel shut-off		
commences.		
While fuel is being shut off.		
Judgement Criteria		
At least 1 second has passed before heated oxygen sensor (rear) output voltage		
falls to 0.15 - 0.40V.		
or the second		
At least 3 seconds have passed before the heated oxygen sensor (rear) output		
voltage fails to 0.15V or less.		

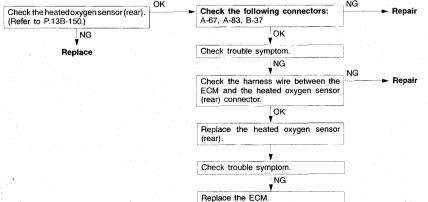

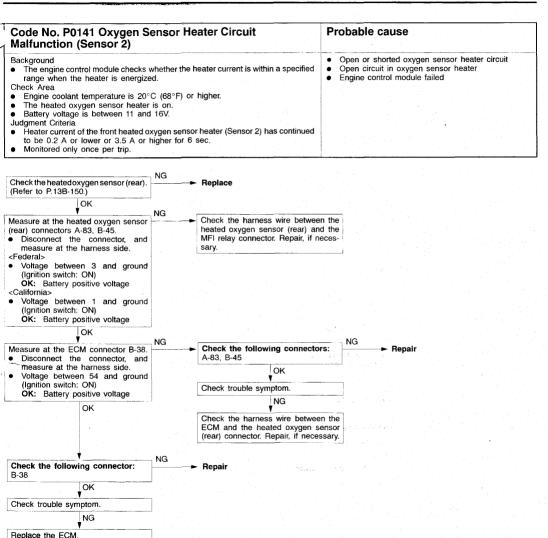


•

Code No. P0170 Fuel Trim Malf	Probable cause			
<ul> <li>Background</li> <li>If a malfunction occurs in the fuel system, the fuel trim value becomes too large or too small.</li> <li>The engine control module checks whether the fuel trim value is within a specified</li> <li>Incorrect fuel pressure</li> <li>Air drawn in from gaps in gasket seals, etc.</li> <li>Heated oxygen sensor failed</li> <li>Incarke air temperature is -10°C (14°F) or higher.</li> <li>Intake air temperature -10°C (14°F) or more</li> <li>Atmospheric pressure is 76 kPa (11 psi) or more.</li> <li>Output frequency of the volume air flow sensor is 113 Hz or higher.</li> <li>Judgment Criteria</li> <li>Long-range fuel correction has continued to be +12.5% or higher or -12.5% or lower for 10 sec.</li> <li>Short-range fuel correction has continued to be +7.4% or higher -7.4% or lower</li> </ul>				
	NG			
SCAN TOOL Data list 13 Intake air temperature sensor (Refer to P.13B-125.)		<ul> <li>Check the intake air temperature circuit malfunction. (Refer to P.13B-28, INSPECTION PROCEDURE FOR DIAGNOSTIC TROUBLE CODE P0110)</li> </ul>		
ОК				
Y	NG	Obselv the engine explore temperature size it molf-unation. (Defer		
SCAN TOOL Data list 21 Engine coolant temperature sensor (Refe OK	r to P.13B-125.)	<ul> <li>Check the engine coolant temperature circuit malfunction (Refer to P.13B-29, INSPECTION PROCEDURE FOR DIAGNOSTIC TROUBLE CODE P0115)</li> </ul>		
SCAN TOOL Data list		Check the barometric pressure circuit malfunction (Refer to		
25 Barometric pressure sensor (Refer to P.1	3B-125.)	P.13B-27, INSPECTION PROCEDURE FOR DIAGNOSTIC TROUBLE CODE P0105)		
ОК				
•	NG	Periode and the second s		
Check the injector (Refer to P.13B-152.)		—► Replace		
VOK	NG			
Check the following connectors: A-70, A-71, A-72, A-73, B-40		— ▶ Repair		
ок	NO			
Check the harness wire between the ECM and tor.	the injector connec-	—► Repair		
ок				
Check the fuel pressure (Refer to P.13B-144	L)			
ОК	More			
SCAN TOOL Data list 81 Long-term fuel compensation (Refer to P	than ze	ero ► Check if air was drawn NG ► Repair into the intake system.		
Is fuel trim more or less than zero?		ОК		
12 Volume air flow sensor (Refer to P.13B-125.)	heck for fuel leaks m injector, heck for entry of reign matter (water,	SCAN TOOL Data list     No       12 Volume air flow sensor (Refer to P.13B-125) <ul> <li>Check for clogging of the injector.</li> <li>Check for clogging of</li> <li>Che</li></ul>		
cate more than the	erosene, etc.) into	standard value?		
standard value? th	e fuel.	Yes (insufficient discharge rate).		
Yes	OK V	Beplace the volume air		
Replace the volume air flow sensor.	ice the ECM	flow sensor leaks (oxygen sensor installation section, cracks in exhaust manifold, cracks in front pipe, etc.). • Check for entry of foreign matter (water, kerosene, etc.) into the fuel.		
		Replace the ECM		

### MFI <1.8L Engine> - Troubleshooting

Code No. P0201, P0202, P0203, P0204 Injector Circuit Malfunction (Cylinder-1, Cylinder-2, Cylinder-3, Cylin- der-4)	Probable cause
<ul> <li>Background</li> <li>A surge voltage is generated when the injectors are driven and the current flowing to the injector coil is shut off.</li> <li>The engine control module checks this surge voltage.</li> <li>Check Area</li> <li>Engine speed is between 50 and 1000 r/min.</li> </ul>	<ul> <li>Injector failed</li> <li>Open or shorted injector circuit, or loose connector</li> <li>Engine control module failed</li> </ul>
<ul> <li>Throttle position sensor output voltage is lower than 1.16V.</li> <li>Judgment Criteria</li> <li>Injector coil surge voltage (more than system voltage +2V) has not been detected for 2 sec.</li> </ul>	

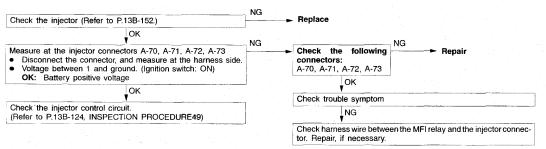


٠

Code No. P0300 Random Misfire Detected		Probable cause
<ul> <li>Background</li> <li>If a misfiring occurs while the engine is running, the engine speed</li> <li>The engine control module checks for changes in the engine Check Area</li> <li>5 sec or more have passed after the engine was started.</li> <li>Engine speed is between 500 and 6500 r/min.</li> <li>Engine coolant temperature is -10°C (14°F) or more.</li> <li>Intake air temperature -10°C (14°F) or more.</li> <li>Adaptive learning is complete for the vane which generates a signal.</li> <li>While the engine is running, excluding gear shifting, de acceleration/deceleration and A/C compressor switching.</li> <li>Judgment Criteria (change in the angular acceleration of the cramisfire detection.)</li> <li>Misfire has occurred more frequently than the allowed number of (1742°F)].</li> <li>or</li> <li>Misfire has occurred more frequently than the allowed number of 1000 motor revolutions. (Misfire exceeding 1.5 times the limit of 1000 motor revolutions.</li> </ul>	e speed. crankshaft po celeration, su inkshaft is us of times (2%) o nigher than s of times (2%) o	Incorrect air/fuel ratio     Low compression pressure     Engine coolant temperature sensor failed     Timing belt teeth jumped     Injector failed     EGR valve failed     Engine control module failed solution udden ed for during be0° C during
	NG	NG
SCAN TOOL Data list 22 Crankshaft position sensor (Refer to P.13B-125.) • Crankshaft position sensor wave form check • Engine speed: stable OK: Constant pulse range		Check the following connectors: A-82, B-37 OK V NG
ОК		Check the harness wire Repair
		between the ECM and the Crankshaft Position Sen- sor connector.
		NG
		Check if the Crankshaft → Repair Position Sensor and sensing plate are installed properly.
		OK
		Replace the Crankshaft Position Sensor.
Check the injector (Refer to P.13B-152.)	NG	Replace
Ток		
Check the following connectors:	NG	Repair
A-70, A-71, A-72, A-73, B-40		
OK	-	
Check the harness wire between the ECM and the injector connector	NG	Repair
ОК	J., .	
SCAN TOOL Data list 81 Long-term fuel compensation (Refer to P.13B-125.)	NG	
	1	
SCAN TOOL Data list 82 Short-term fuel compensation (Refer to P.13B-125.)	NG	Check the fuel trim malfunction (Refer to P.13B-36, INSPECTION PROCEDURE FOR DIAGNOSTIC TROUBLE CODE P0170)
OK		
SCAN TOOL Data list 21 Engine coolant temperature sensor (Refer to P.13B-125.)	NG	Check the engine coolant temperature circuit malfunction (Refer to P.13B-29, INSPECTION PROCEDURE FOR DIAGNOSTIC TROUBLE CODE P0115)
OK		
<ul> <li>Check the following items.</li> <li>Check the ignition coil, spark plugs, spark plug cables.</li> <li>Check the compression pressure.</li> <li>Check the timing belt for jumping teeth.</li> <li>Check the EGR system and EGR valve.</li> </ul>		

MFI <1.8L Engine> - Troubleshooting

Code No. P0301, P0302, P0303, P0304, Misfire Detected (Cylinder-1, Cylinder-2, Cylinder-3, Cylinder-4)	Probable cause
Background If a misfiring occurs while the engine is running, the engine speed suddenly changes. The engine control module checks for changes in the engine speed. Check Area	<ul> <li>Ignition system related part(s) failed</li> <li>Low compression pressure</li> <li>Injector failed</li> <li>Engine control module failed</li> </ul>
<ul> <li>5 sec or more have passed after the engine was started.</li> <li>Engine speed is between 500 and 6500 r/min.</li> <li>Engine coolant temperature is -10°C (14°F) or more.</li> <li>Intake air temperature -10°C (14°F) or more.</li> </ul>	
<ul> <li>Atmospheric pressure is 76 kPa (11 psi) or more.</li> <li>Adaptive learning is complete for the vane which generates a crankshaft position signal.</li> </ul>	
<ul> <li>While the engine is running, excluding gear shifting, deceleration, sudden acceleration/deceleration and A/C compressor switching.</li> <li>Judgment Criteria (change in the augular acceleration of the crankshaft is used for</li> </ul>	
<ul> <li>Misfire detection.)</li> <li>Misfire has occurred in the engine more than allowed (2.0%) per 200 revolutions [when the catalyst temperature is higher than 950°C (1742°F)].</li> <li>or</li> </ul>	
<ul> <li>Misfire has occurred more frequently that the allowed number of times (2%) during 1000 motor revolutions. (Misfire exceeding 1.5 times the limit of emission standard.)</li> </ul>	

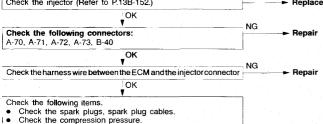

,

Code No. P0335 Crankshaft Position Se Malfunction	nsor Circui	t	Probable cause	
Background • When the engine is running, the crankshaft position ser • The engine control module checks whether the pulse engine is cranking. Check Area • Engine is being cranked. Judgment Criteria • Sensor output voltage has not changed (no pulse sig Check Area Judgment Criteria • Normal signal pattern has not been input for cylinder ident position sensor signal and camshaft position sensor	e signal is input gnal is input) for ificationfrom the c	while the 2 sec. crankshaft	<ul> <li>Crankshaft position sensor failed</li> <li>Open or shorted crankshaft position sensor circuit or loose connector</li> <li>Engine control module failed</li> </ul>	t,
Measure at the crankshaft position sensor connector A-82.	ок	Replace th	bo ECM	
<ul> <li>Measure at the crankshart position sensor connector A-b2.</li> <li>Measure with the connector connected. (Use the test harness: MD998478.)</li> <li>Voltage between 2 (black clip) and ground (Engine:</li> </ul>		Replace tr	ne EGM.	
cranking) OK: 0.4-4.0 V	1			
<ul> <li>Voltage between 2 (black clip) and ground (Engine: idling)</li> </ul>				
<b>OK:</b> 1.5–2.5 V	and the second second			
NG				· .
Measure at the crankshaft position sensor connector A-82. • Disconnect the connector, and measure at the harness	1. NG		e harness wire between the crankshaft position sensor an elay connector. Repair, if necessary.	۱d
side. 1. Voltage between 3 and ground (Ignition switch: ON)	2. NG		NG	
OK: Battery positive voltage 2. Voltage between 2 and ground (Ignition switch: ON) OK: 4.8–5.2 V	3. NG	Check the conector:		
3. Continuity between 1 and ground OK: Continuity		B-37	OK	
ОК	39-85-15-15-15-15-15-15-15-15-15-15-15-15-15	Chaoly tro	uible sumstam	
NG	- 207 (A.) 	Спеск по	buble symptom.	
Check the following Repair	l sala i		NG MG	
conector: A-82		Check th	ne harness wire	
		betweent	the ECM and the	
↓ OK			aft position sen-	
Check trouble symptom.		sor conne	the second se	
LNG			OK	
Replace the crankshaft position sensor.		Replace the	the ECM.	
L		Chaole +	a harnoon wire between the grankshaft position	
			e harness wire between the crankshaft position nd the ground. Repair, if necessary.	

Code No. P0340 Camshaft Position Sen Malfunction	sor Circuit		Probable of	ause	
<ul> <li>Background</li> <li>When the engine is running, the camshaft position sen</li> <li>The engine control module checks whether the pulse Check Area</li> <li>Engine speed is about 50r/min or higher.</li> <li>Judgment Criteria</li> <li>Sensor output voltage has not changed (no pulse sig Check Area</li> <li>Engine speed is about 50r/min or higher.</li> <li>Judgment Criteria</li> <li>Normal signal pattern has not been input for cylinder ident position sensor and camshaft position sensor signal</li> </ul>	signal is input. gnal is input) for ificationfrom the	2 sec.	<ul> <li>Open or sh loose conne</li> </ul>		unction ition sensor circuit or
	ок				
Measure at the camshaft position sensor connector A-65. • Measure with the connector connected. • Voltage between 2 and ground (Engine: cranking) OK: 0.4–3.0 V • Voltage between 2 and ground (Engine: idling) OK: 0.5–2.0 V NG		- Replace th	ie ECM.		
<b>T</b>	1. NG				
<ul> <li>Measure at the camshaft position sensor connector A-65.</li> <li>Disconnect the connector, and measure at the harness side.</li> </ul>				etween the camsha epair, if necessary.	ft position sensor and
1. Voltage between 3 and ground (Ignition switch: ON) OK: Battery positive voltage	2. NG	Check th		NG ► Repair	
2. Voltage between 2 and ground (Ignition switch: ON) $OK$ : 4.8–5.2 V	3. NG	conector: B-37			
<ol> <li>Continuity between 1 and ground OK: Continuity</li> </ol>			OK ▼		
_OK		Check trou	ible symptom.		
Check the following conector: A-65 OK		between th	harness wire e ECM and the position sensor	NG ► Repair	
Check trouble symptom.		· · · · ·	ОК		
NG		Replace th	FCM		
Replace the camshaft position sensor.					
	Ľ	Check the	harness wire be	tween the camsha	ft position sensor and
			. Repair, if nece		rection concor and

### 13B-42

Code No. P0400 Exhaust Gas Recirculation Flow Malfunction	Probable cause and a second se
<ul> <li>Background</li> <li>When the EGR solenoid switches from OFF to ON while the engine is running, EGR gas flows.</li> <li>The engine control module checks how the EGR gas flow signal changes. Check Area</li> <li>At least 20 seconds have passed after the last monitor finished.</li> <li>Engine coolant temperature is higher than 80°C (176°F).</li> <li>Engine speed is between 1000 and 2000 r/min <m t=""> or 1000 and 1700 r/min <a t="">.</a></m></li> <li>Intake air temperature is 5°C (41°F) or more.</li> <li>At least ninety seconds have passed since manifold differential pressure sensor output voltage fluctuated 1.5V or more.</li> <li>Closed throttle position switch: ON</li> <li>Volumetric efficiency 15% <a t=""> or less.</a></li> <li>Fuel is being shut off <m t="">.</m></li> <li>Monitoring Time: 2 sec</li> </ul>	<ul> <li>EGR valve does not open</li> <li>EGR control vacuum is too low</li> <li>EGR solenoid failed</li> <li>Open or shorted EGR solenoid circuit, or loose connector</li> <li>Manifold differential pressure sensor failed</li> <li>Engine control module failed</li> </ul>
<ul> <li>The fluctuation in the intake system is low when the EGR solenoid is turned ON.</li> <li>Monitored only three times per trip.</li> </ul>	<ul> <li>A second sec second second sec</li></ul>

14. Car 15 19 19

NG

OK

ОК NG Replace

Check the following items.

- Vacuum hoses
- EGR port vacuum
- EGR valve (Refer to GROUP 17 Emission Control System.)

SCAN TOOL Data list

95 Manifold differential pressure sensor (Refer to P.13B-125.)

OK Check the EGR valve and EGR route for clogging, and clean. Check the manifold differential pressure sensor circuit malfunction (Refer to P.13B-86, INSPECTION PROCEDURE FOR DIAGNOS-TIC TROUBLE CODE P1400)


Code No. P0403 Exhaust Gas Recircula Malfunction	tion Solenoid		Probable cause	
<ul> <li>Background</li> <li>The engine control module checks current flows in the when the solenoid is ON and OFF.</li> <li>Check Area</li> <li>Battery voltage is not lower than 10V.</li> <li>Judgment Criteria</li> <li>Solenoid coil surge voltage (more than system voltage the EGR solenoid is turned on/off.</li> <li>Monitored only once per trip.</li> </ul>			<ul> <li>EGR solenoid failed.</li> <li>Open or shorted evaporativ or loose connector.</li> <li>Engine control module failed</li> </ul>	
	NG			
Check the EGR solenoid. (Refer to GROUP 17 – Emission Control System.)	► Re	place		
ОК	- 			
Measure at the EGR solenoid connector A-48. • Disconnect the connector and measure at the harness side.			arness wire between MFI relay nd repair if necessary.	and solenoid valve
• Voltage between 1 and ground (Ignition switch: ON) OK: Battery positive voltage				
ОК				
Measure at the ECM connector B-40.  Disconnect the connector and measure at the harness side.		heck the onnector: 48	following Rep	air
<ul> <li>Voltage between 6 and ground (Ignition switch: ON)</li> <li>OK: Battery positive voltage</li> </ul>			ОК	
OK	Ch	neck troub	le symptom.	
Check the following Repair			NG	
connector: B-40			arness wire between ECM and s necessary.	olenoid valve connector,
ОК				· · · ·
Check trouble symptom.				
NG				
Replace the ECM.			19 <b>2 - 9</b> 00 - 10 - 10 - 10 - 10 - 10 - 10 - 10 -	

Code No. P0420 Catalyst System Efficiency E Threshold	Below	Probable cause
<ul> <li>Background</li> <li>The signal from the heated oxygen sensor which follows the differs from that which precedes the catalytic converter. That is be converter purifies exhaust gas. When the catalytic converter the signal from the heated oxygen sensor which follows the becomes similar to that which precedes the catalytic converter.</li> <li>The engine control module checks the outputs of the heated oxygen encode the catalytic converter.</li> <li>The engine speed is not higher than 3000 r/min.</li> <li>Volume air flow sensor output frequency is between 69 and I intake air temperature is -10°C (14°F) or more.</li> <li>Atmospheric pressure is 7.6 kPa (11 psi) or more.</li> <li>Closed throttle position switch: OFF</li> <li>Under the closed loop air-fuel ratio control.</li> <li>Vehicle speed is 1.5 km/h (0.93 mph) or higher.</li> <li>Monitoring time: 140 sec</li> <li>Judgment Criteria</li> <li>Fault in the oxygen sensor (rear) signal and oxygen sensor</li> </ul>	ecause the cat r has deterio catalytic con ter. gen sensor sig 144 Hz.	e Engine control module failed prated, iverter gnals.
	NG	
Check the exhaust manifold (For cracks and leaks.)		Replace
ок	NG	
SCAN TOOL Data list 59 Heated oxygen sensor (rear) • Transaxle: 2nd gear <m t="">, L range <a t=""> • Drive with wide open throttle OK: 600 - 1000 mV</a></m>		Check the oxygen sensor circuit malfunction (sensor 2) (Refer to P.13B-34, INSPECTION PROCEDURE FOR DIAGNOSTIC TROUBLE CODE P0136)
∮ок		
SCAN TOOL Data list 11 Heated oxygen sensor (front) • Sudden racing OK: 600 – 1000 mV	NG	Check the oxygen sensor circuit malfunction (sensor 1) (Refer to P.13B-32, INSPECTION PROCEDURE FOR DIAGNOSTIC TROUBLE CODE P0130)
↓OK		
<ul> <li>SCAN TOOL Data list</li> <li>11 Heated oxygen sensor (front)</li> <li>Engine: 2000 r/min</li> <li>OK: The switch between 0 - 400 ↔ 600 - 1000 mV is 15 or more times in 10 sec.</li> </ul>	NG	Replace the heated oxygen sensor (front)
OK		
Replace the heated oxygen sensor (rear)	1	
	J	
Check the trouble symptom	1 5 5	
NG		
Replace the catalytic converter.	1	
ויבטוועפונפו.	]	
Check trouble symptom.	]	
NG		

Replace the ECM.

Code No. P0421 Warm Up Catalyst Efficiency Below Threshold		P	Probable cause		
<ul> <li>Background</li> <li>The signal from the heated oxygen sensor which follows the differs from that which precedes the catalytic converter. That is b converter purifies exhaust gas. When the catalytic converter the signal from the heated oxygen sensor which follows the becomes similar to that which precedes the catalytic converter. The engine control module checks the outputs of the heated oxy Check Area</li> <li>Engine speed is not higher than 3000 r/min.</li> <li>Volume air flow sensor output frequency is between 69 and Intake air temperature is -10°C (14°F) or more.</li> <li>Atmospheric pressure is 76 kPa (11 psi) or more.</li> <li>Closed throttle position switch: OFF</li> <li>Under the closed loop air-fuel ratio control.</li> <li>Vehicle speed is 1.5 km/h (0.93 mph) or higher.</li> <li>Monitoring time: 140 sec</li> <li>Judgment Criteria</li> <li>Fault in the heated oxygen sensor (rear) signal and heated or signal.</li> </ul>	vecause the ca er has deteric e catalytic con rter. /gen sensor si 1 144 Hz.	elytic rated, verter gnals.	Catalytic converter deteriorated Heated oxygen sensor failed Engine control module failed		
A	NG	-			
Check the exhaust manifold (For cracks and leaks.)		Replace			
ок	NG	ан. 1997 - Алар			
SCAN TOOL Data list			e oxygen sensor circuit malfunction (sensor 2) (Refer		
59 Heated oxygen sensor (rear)	1		34, INSPECTION PROCEDURE FOR DIAGNOSTIC		
<ul> <li>Transaxle: 2nd gear <m t="">, L range <a t=""></a></m></li> <li>Drive with wide open throttle</li> </ul>		TROUBLE	CODE P0136)		
OK: 600 - 1000 mV					
LOK					
SCAN TOOL Data list	NG	Check the	e oxygen sensor circuit malfunction (sensor 1) (Refer		
11 Heated oxygen sensor (front)	-	to P.13B-	32, INSPECTION PROCEDURE FOR DIAGNOSTIC		
Sudden racing		TROUBLE	E CODE P0130)		
<b>OK:</b> 600 – 1000 mV					
OK					
SCAN TOOL Data list	NG	Replace t	he heated oxygen sensor (front)		
11 Heated oxygen sensor (front)					
• Engine: 2000 r/min					
OK: The switch between 0 - 400 ↔ 600 - 1000 mV is 15 or more times in 10 sec.	1				
Replace the heated oxygen sensor (rear)	<b>1</b>				
• • • • • • • • • • • • • • • • • • •					
Check the trouble symptom					
NG A A A A A A A A A A A A A A A A A A A					
Replace the catalytic converter.					
Check trouble symptom.	7				
NG					
· · · · · · · · · · · · · · · · · · ·					

Replace the ECM.

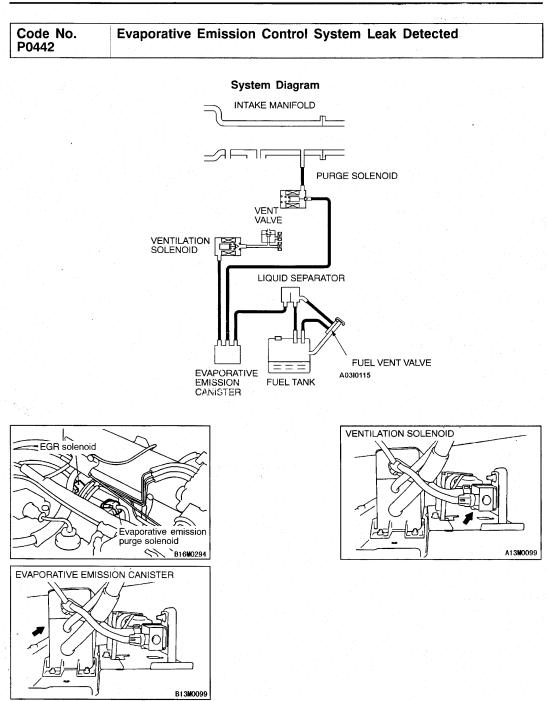

### TECHNICAL DESCRIPTION

• The ECM turns on the evaporative emission ventilation solenoid which shuts off the evaporative emission canister outlet port. Then the evaporative emission purge solenoid is driven. As a result, the fuel system will be set into a negative pressure.

When the fuel system reaches negative pressure, the evaporative emission purge solenoid is turned "off," and the fuel system are sealed. As the fuel pressure inside the fuel tank changes, the ECM judges if there is a leak in the fuel system.

### DTC SET CONDITIONS

### Check Area

- At least sixteen minutes have passed since the starting sequence was completed.
- Engine coolant temperature higher than 60°C (140°F).
- Engine speed is 1,600 r/min or more.
- Power steering pressure switch: "OFF."
- Barometric pressure is higher than 76 kPa (11 psi).
- Volumetric efficiency is at between 20 and 80 percent.
- The engine coolant temperature is 30°C (86°F) or less when the engine is started.
- Intake air temperature is higher than 5°C (41°F).
- The pressure rise when the evaporative emission purge solenoid and evaporative emission ventilation solenoid are closed is less than 451 Pa (0.065 psi).

### OVERVIEW OF TROUBLESHOOTING

- The pressure fluctuation width is less than 647 Pa (0.094 psi).
- At least twenty seconds have passed since pressure fluctuation detection commenced.
- Fuel tank differential pressure sensor output voltage is 1 4 volts.
- Intake air temperature is 30°C (86°F) or less when the engine started.
- Vehicle speed is 30 km/h (18.7 mph) or more.
- Monitoring time: 75 125 seconds


### **Judgment Criteria**

• Internal pressure of the fuel tank has changed more than 843 Pa (0.122 psi) in 20 seconds after the tank and vapor line were closed.

### TROUBLESHOOTING HINTS

The most likely causes for this code to be set are:

- Loose fuel cap.
- Fuel cap relief pressure is incorrect.
- Evaporative emission canister seal is faulty.
- Evaporative emission canister is clogged.
- Fuel vent valve failed.
- Purge line or vapor line is clogged.
- Fuel tank, purge line or vapor line seal failed.
- Evaporative emission purge solenoid failed.
- Evaporative emission ventilation solenoid failed.
- Fuel tank differential pressure sensor failed.
- Engine coolant temperature sensor failed.
- Intake air temperature sensor failed.
- · Power steering pressure switch failed.
- Use of incorrect fuel.
- To determine the cause of DTC P0442, a performance test is needed. The performance test uses a mechanical vacuum gauge and scan tool MB991502 set on the fuel tank differential pressure sensor (TANK PRS SNSR 73). The mechanical gauge reading is used to verify scan tool MB991502 reading. A comparison of the mechanical gauge to scan tool MB991502 determines the problem in the system.
- Prior to doing the performance test, several simple inspections are needed to exclude some possibilities
  of the symptom.

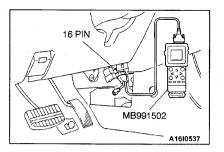

### DIAGNOSIS

Required Special Tool: MB991502: Scan Tool (MUT-II)

#### Caution

To prevent damage to scan tool MB991502, turn the ignition switch off before connecting or disconnecting scan tool MB991502.

In this procedure, scan tool MB991502 should be used in the metric mode (showing the value in kPa). If not, set scan tool MB991502 by selecting the "System Setup" at the main menu.

### STEP 1. Check for other DTCs.

If any other DTCs are set, please check those DTCs first then follow the steps below.

### STEP 2. Evaporative Emission System Leak Monitor Test using scan tool MB991502.

NOTE: This monitor is carried out at an engine speed of 1,600 r/min or more, transmission is in "N" or "R" position. The engine speed has to be automatically adjusted.

- (1) Erase the DTCs using scan tool MB991502. Ensure that the fuel cap is securely tightened.
- (2) Select "System Test" and press "YES" key.
- (3) Select "Evap Leak Mon" and press "YES" key.
- (4) If "Evap Leak Mon" is selected before starting the engine, "Engine must be running." is displayed. In this case, start the engine and then select "Evap Leak Mon" again.
- (5) If "Keep the TPS in idle position. during the test." is displayed, the ECM adjusts engine speed automatically. A manual adjustment for engine speed is not needed.
- (6) Keep the idling position during the monitor.

NOTE: If the engine speed does not reach 2,000 r/min during the monitor test, adjustment of the Speed Adjusting Screw may be needed. Refer to P.13B-143 for the adjustment procedure.

- (7) Item "In Progress" is displayed during the monitor. Keep the engine speed and load within the defined range. Scan tool MB991502 shows these items on the screen. Item "In Progress" will be change from "NO" to "YES" by keeping engine conditions.
- (8) Message "Evap Leak Mon. Completed. Test Passed." is displayed when the test has been completed without malfunction. Evaporative emission system is working property at this time. Please explain to customer that improperly tightened fuel cap can cause to MIL turn on. No further steps are needed.
- (9) Message "Evap Leak Mon. Completed. Test Failed & DTCs Set." is displayed when a malfunction has been detected during the test. Go to Step 3.

(10) Message "Evap Leak Mon. discontinued. Retest again from the first" is displayed when the monitor was discontinued by a certain reason (input vehicle speed, engine speed and engine load was put of the specified range). Turn the ignition switch off once and start monitoring from the beginning.

NOTE: Monitoring will not start unless turning off the ignition switch is turned off once and the engine restarted.

### STEP 3. Using scan tool MB991502, check "Fuel tank differential pressure sensor (date list 73)" output.

In this step, the fuel tank differential pressure sensor reading is checked to determine if the fuel tank differential pressure sensor output is within the normal range.

- (1) Check the MFI data list item: TANK PRS SNSR 73
- (2) Watch the sensor reading. This value varies depending on pressure inside the fuel tank.
- (3) Remove the fuel cap.

NOTE: If the fuel cap is not securely tightened, it might have the cause of a leak in the EVAP system and set the DTC P0442.

- (4) After the fuel cap has been removed, the pressure sensor reading should be between -0.5 kPa (-0.07 psi) and 0.5 kPa (0.07 psi).
  - If the reading is between -0.5 kPa (-0.07 psi) and 0.5 kPa (0.07 psi), the fuel tank differential pressure sensor circuit is OK. Therefore, go to Step 4.
  - If the reading is not between -0.5 kPa (-0.07 psi) and 0.5 kPa (0.07 psi), the fuel tank differential pressure sensor is not working properly. Replace the fuel tank differential pressure sensor.


# STEP 4. Check the fuel vent valve plunger and flapper door operation.


NOTE: When a fuel nozzle is inserted to the fuel tank filler tube and the flapper door is opened, the fuel vent valve is closed (plunger moves towards the top of the neck). When the fuel cap is closed, the fuel cap pushes the plunger back in, which then opens the vent valve. If the flapper door or plunger does not operate properly, the vent valve stays closed even after the fuel cap is closed. This may block the vapor passage. A faulty vent valve plunger may also cause the fuel cap not to seat properly. Either of these conditions can set DTC P0442.

- (1) Remove the fuel cap.
- (2) Push the flapper in to operate the valve.


NOTE: When the flapper is pushed in, the plunger of the valve should move towards the top.

- (3) Reinstall and tighten the fuel cap until three clicks are heard.
- (4) Remove the cap again and check the protrusion of the plunger to verify if it is pushed back.

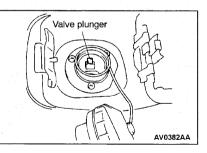

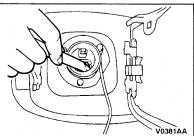


- (5) Distance between the tip of vent valve plunger and that of fuel tank filler tube should be 28 mm (1.1 inches) or more.
  - If the plunger does not return, replace the fuel tank filler tube and securely tighten the cap.
  - If the operation is OK, install and securely tighten the fuel cap.

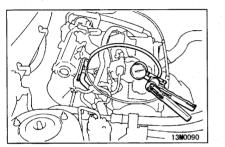


# STEP 5. Using scan tool MB991502, actuator test item 08 : Evaporative Emission Purge Solenoid.


- (1) Disconnect the hose connected to the evaporative emission canister from the purge solenoid.
- (2) Connect a hand vacuum pump to the nipple where the hose is disconnected at the previous step.
- (3) The vacuum should be maintained when vacuum is applied and vacuum should leak when the purge solenoid is activated by the actuator test of scan tool MB991502.
  - If correct, go to Step 6.
  - If not, refer to DTC P0443 (Evaporative Emission Control System Purge Control Valve Circuit Malfunction) on P.13B-56.

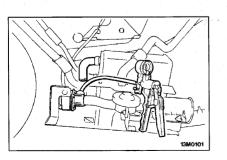

# STEP 6. Using scan tool MB991502, actuator test item 29 : evaporative Emission Ventilation Solenoid.

- (1) Disconnect the hose connected to the vent solenoid valve from the evaporative emission canister.
- (2) Connect a hand vacuum pump to the hose that is disconnected in the previous step.
- (3) The vacuum should leak when vacuum is applied, and the vacuum should be maintained when the purge solenoid is activated by the actuator test of scan tool MB991502.
  - If correct, go to Step 7.
  - If not, refer to DTC P0446 (Evaporative Emission Control System Vent Control Malfunction) on P.13B-57.

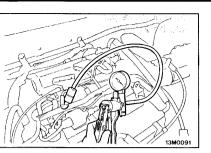

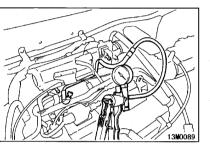

### STEP 7. Check the purge solenoid-to-air intake plenum hose for blockage.

- (1) Disconnect the purge solenoid-to-air intake plenum hose at the purge solenoid side.
- (2) Connect a hand vacuum pump to the disconnected hose end.
- (3) Apply vacuum, and check if the vacuum is not maintained.
  - If not maintained, go to STEP 8.
  - If maintained, replace the hose or intake plenum. Then go to STEP 9.

# STEP 8. Check the purge solenoid-to-air intake plenum hose for vacuum leakage.

- (1) Plug the purge solenoid-to-air intake plenum hose at the purge solenoid side.
- (2) Disconnect the purge solenoid-to-air intake plenum hose at the air intake plenum side.
- (3) Connect a hand vacuum pump to disconnected hose end.
- (4) Apply vacuum, and check if the vacuum is maintained.
   If maintained, go to STEP 9.
  - If not maintained, replace the hose. Then go to STEP 9.

### STEP 9. Performance test.

NOTE: Fuel temperature should be lower than  $40^{\circ}C$  (104°F) during the performance test.

In this step, verify if the EVAP system works properly, or determine which area of the evaporative emission system has a failure.


### Caution

As a 0 – 6.2 kPa (0 – 0.90 psi) range vacuum gauge is used, the gauge may be broken if excessive vacuum pressure is applied. Do not apply a vacuum of more than 2.9 kPa (0.42 psi).


To achieve the performance test efficiently, a mechanical vacuum gauge [0 - 6.2 kPa (0 - 0.90 psi) range] and scan tool MB991502 should be used, and the engine to generate vacuum.

### 13B-52


### MFI <1.8L Engine> - Troubleshooting (PR)

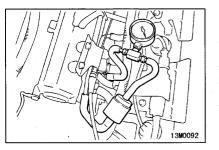

- Install a mechanical vacuum gauge [0 6.2 kPa (0 0.90 psi) range] between the EVAP purge solenoid valve and the purge hose that comes from the evaporative emission canister.
- (2) Before starting the performance test, set the vehicle in the following condition.
  - Engine coolant temperature: 80 90°C (176 203°F)
  - Lights and all accessories: OFF
  - Transmission: "N" or "P" position
- (3) Select the item TANK PRS SNSR (data list 73) on scan tool MB991502 to see the differential pressure sensor output.
- (4) Run the engine at idle.

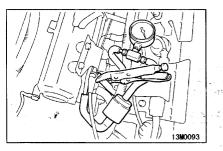

(5) Using locking pliers, pinch the hose between the purge solenoid and the intake plenum to close the purge flow, as a preparation of the performance test.

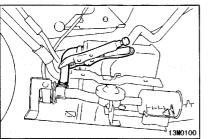

- (6) Using another locking pliers, pinch the vent hose between the evaporative emission canister and the vent solenoid. Momentary, remove the locking pliers at the purge hose; this will cause the vacuum build up in the EVAP system.
- (7) The engine vacuum comes from the purge port through the purge solenoid.

NOTE: During this operation, the purge solenoid may turn off but will resume operation in about 20 seconds. Operation of the purge solenoid can be checked by needle fluctuation of the mechanical vacuum gauge. Lese at-

- (8) Watch the vacuum reading on the mechanical vacuum gauge and scan tool MB991502.
- (9) When the vacuum reading reaches 2.9 kPa (0.42 psi) on the mechanical vacuum gauge and -2.9 kPa (-0.42 psi) on scan tool MB991502, pinch the hose between the purge solenoid and the intake manifold plenum using another locking pliers; this stops the application of vacuum and seals the EVAP system for the leak test.

NOTE: If there is a system failure, either of both vacuum readings may not reach to the above specifications. In this case, it is not necessary to pinch off the purge hose as shown. Refer to the performance test results table below for further steps.

- (10) After an elapsed time of 20 seconds, check the fuel tank differential pressure reading on scan tool MB991502.
  - OK: Change in pressure reading is 0.4 kPa (0.06 psi) or less [holding –2.5 kPa (–0.36 psi) or more vacuum].

#### Performance test result table:

MECHANICAL VACUUM GAUGE READING	SCAN TOOL MB991502 READING	RESULT	GO TO
Reaches 2.9 kPa (0.42 psi).	Reaches -2.9 kPa (-0.42 psi) and vacuum drops not more than 0.4 kPa (0.06 psi) in 20 seconds.	Satisfactory. No leak nor blockage detected.	Step 10
Reaches 2.9 kPa (0.42 psi).	Does not reach -2.9 kPa (-0.42 psi).*	Blockage in the system or bad differential sensor.	Step 11
Does not reach 2.9 kPa (0.42 psi).	Does not reach -2.9 kPa (-0.42 psi).	Large leak in EVAP system.	Step 13
Reaches 2.9 kPa (0.42 psi).	Reaches -2.9 kPa (-0.42 psi) but vacuum drops more than 0.4 kPa (0.06 psi) in 20 seconds.	Small leak in EVAP system.	Step 14


#### NOTE

\*: If there is a blockage, scan tool MB991502 reading can be a positive value (positive pressure) due to the heat of return fuel from the engine.

STEP 10. Vacuum reading on both the mechanical gauge and scan tool MB991502 reaches the specifications and satisfy the specifications after 20 seconds:

EVAP system is properly working at the moment. The cause of DTC might have been a loose fuel cap and the customer may have already tightened fuel cap causing the MIL to turn on. No further steps are needed. STEP 11. Vacuum reading on the mechanical gauge reaches 2.9 kPa (0.42 psi) but scan tool MB991502 does not reach -2.9 kPa (-0.42 psi) :

- (1) If the vacuum reading on the gauge reaches 2.9 kPa (0.42 psi) but the reading on scan tool MB991502 does not reach -2.9 kPa (-0.42 psi), either a system blockage or a bad differential pressure sensor may be the cause.
- (2) To determine if there is a blockage in the system, remove the fuel cap.
  - If the vacuum reading on the vacuum gauge [at this point 2.9 kPa (0.42 psi)] remains the same, there is a blockage in the system. Go to Step 12.
  - If the reading drops to about 0 kPa (0 psi), there is no blockage in the EVAP system. The fuel tank differential pressure sensor needs to be replaced. After replacing the differential pressure sensor, go to Step 15.

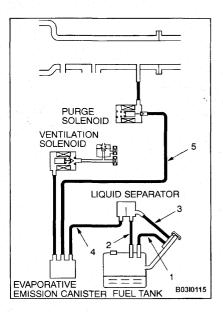


### STEP 12. System blockage inspection.

- Disconnect the number 1 and 2 hoses shown in the illustration, check the mechanical vacuum gauge reading. If the vacuum reading does not drop, then the blockage is not in the fuel tank.
- (2) Disconnect one portion of the EVAP system at a time working towards the front of the vehicle until blockage is found (number 1 to 5 hoses in the illustration).
- (3) Repair the location of the blockage and go to Step 15.

STEP 13. Vacuum readings on both the mechanical gauge and scan tool MB991502 do not reach the specifications [2.9 kPa (0.42 psi) and -2.9 kPa (-0.42 psi)]:


This condition shows that there is a significant leakage in the system. The inspection procedure for the large system leakage is the same as the small leakage test in Step 14.

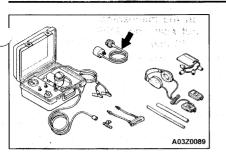

STEP 14. Vacuum readings on both the mechanical gauge and scan tool MB991502 do not reach the specification [2.9 kPa (0.42 psi) and -2.9 kPa (-0.42 psi)] but do not maintain the vacuum.

This condition shows that there is a slight leakage in the system. Follow the procedure below to locate the source of the leak.

- (1) The fuel cap relief valve inspection.
  - a. Remove the fuel cap and install the fuel tank filler tube adapter in the emission system tester kit in place of the fuel cap.
  - b. Plug the nipple on the fuel tank filler tube adapter.
  - c. Repeat the performance test. If the EVAP system holds the vacuum, then the fuel cap is faulty. Replace the fuel cap, and go to Step 15.

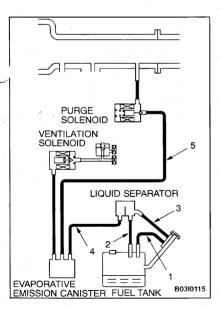

(2) To find the vacuum leakage in the system, clamp the number 1 and 2 hoses shown in the illustration. Repeat the performance test. This will determine if the vacuum leak is either in the fuel tank area or in the rest of the system.

NOTE: In this case, as we clamped off the vacuum hose connecting to the fuel tank, scan tool MB991502 reading will not change. Please use the mechanical gauge reading.


- If the EVAP system hold the vacuum leak is in the fuel tank area. To locate the leakage, pressurize the EVAP system to 3.4 kPa (0.49 psi) and look for leaky area using the ultrasonic leak detector in the Evaporative Emission System Tester. After repairing the leakage, go to Step 15.
- If the vacuum leak still exists, the leak is at other than fuel tank area.
- (3) Clamp off the vacuum hose one component at a time working towards the front of the vehicle until leakage is found (number 1 to 5 hoses shown in the illustration).
- (4) Repair the leakage at that location and go to Step 15.

#### STEP 15. Confirmation test.


After system failures are repaired, repeat the Evaporative Emission System Leak Monitor test (Step 2) to check that the EVAP system operates correctly.

.


Code No. P0443 Evaporative Emission Purge Control Valve Circuit Malfunction	Control Sys	stem	Probable cause
<ul> <li>Background</li> <li>The engine control module checks current flows in the solenoid (No.1) drive circuit when the solenoid is Of Check Area</li> <li>Battery voltage is not lower than 10V.</li> <li>Judgment Criteria</li> <li>Solenoid coil surge voltage (more than system voltage the EVAP purge solenoid is turned on/off.</li> <li>Monitored only once per trip.</li> </ul>	N and OFF.		<ul> <li>Evaporative emission purge solenoid failed</li> <li>Open or shorted evaporative emission purge solenoid circuit, or loose connector</li> <li>Engine control module failed</li> </ul>
Check the evaporative emission purge solenoid. (Refer to GROUP 17 - Emission Control System.)	NG	Replace	
OK			
Measure at the evaporative emission purge solenoid con- nector A-45. • Disconnect the connector and measure at the harness side. • Voltage between 2 and ground (Ignition switch: ON) OK: Battery positive voltage	NG	Check the h Repair, if n	arness wire between MFI relay and solenoid valve connector. ecessary.
ОК			NG
Measure at the ECM connector B-40.  Disconnect the connector and measure at the harness side.	NG	Check th connector A-45	e following Repair
Voltage between 9 and ground (Ignition switch: ON)     OK: Battery positive voltage			▼
NG		Check trou	ble symptom.
Check the following Repair			NG
B-40	et journes Roch	Check the Repair, if n	harness wire between ECM and solenoid valve connector. necessary.
v ok	11. K.		
Check trouble symptom.			
NG <sup>1</sup>	$e^{-i\omega_{\rm e}} = h_{\rm e} e^{-i\omega_{\rm e}}$		
Replace the ECM.	]		

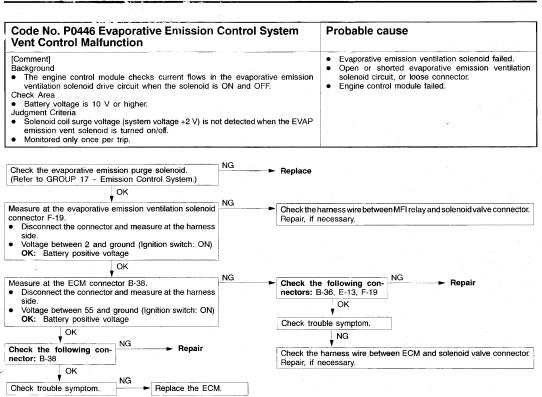

### 13B-58

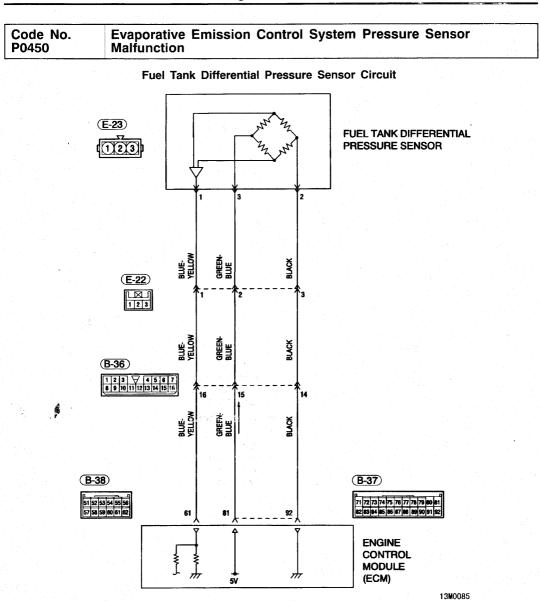

### MFI <1.8L Engine> - Troubleshooting

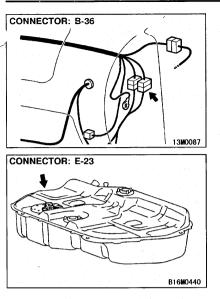

#### **CIRCUIT OPERATION**

- A 5-volt voltage is supplied to the power terminal of the fuel tank differential pressure sensor (terminal 3) from the ECM (terminal 81). The ground terminal (terminal 2) is grounded with the ECM (terminal 92).
- A voltage proportional to the pressure in the fuel tank is sent from the output terminal of the fuel tank differential pressure sensor (terminal 1) to the ECM (terminal 61).

### **TECHNICAL DESCRIPTION**

- The fuel tank differential pressure sensor outputs the voltage in proportion to the pressure in the fuel tank (differential pressure against the barometric pressure).
- The ECM checks whether the output voltage of the fuel tank differential pressure sensor is with in the specified range.


### DTC SET CONDITIONS

#### **Check Area**

- Intake air temperature is higher than 5°C (41°F).
- Engine speed is higher than 1,600 r/min.
- Volumetric efficiency is between 20 and 80 percent.

#### Judgement Criteria

 The sensor output voltage is more than 4 volts for 10 seconds even if the evaporative emission purge solenoid is driven at a 100 percent duty when the intake air temperature is between 5 and 45°C (41 – 113°F).

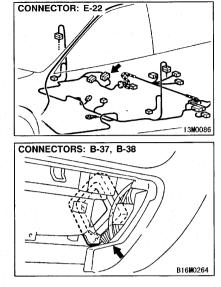

13B-59

 The sensor output voltage is less than 1 volt for 10 seconds even if the evaporative emission purge solenoid is not driven when the intake air temperature is 5°C (41°F) or more.

#### **Check Area**

- The throttle valve is closed.
- Engine speed is 840 r/min or less.
- Vehicle speed is 1.5 km/h (0.93 mph) or less.

#### **Judgement Criteria**

- The events are counted 20 times or more that sudden pressure fluctuation of at least 0.2 volts is detected for 25 milliseconds or more.
- The above events are detected continuous eight times during normal driving condition.

NOTE: If the number of the pressure fluctuation does not reach 20 during one engine idling, the count number will be reset to zero. In addition, the count number will be also reset to zero if the ignition switch is turned off.

NOTE: The engine control module determines that the engine has deflected from the idle operation if all of the following conditions are met.

- Engine speed is higher than 2,500 r/min.
- Vehicle speed is 15 km/h (9.3 mph) or more.
- Volumetric efficiency is 55 percent or more.

### TROUBLESHOOTING HINTS


The most likely causes for this code to be set are:

- Fuel tank differential pressure sensor failed.
- Open or shorted fuel tank differential pressure sensor circuit, or loose connector.
- ECM failed.

or

### OVERVIEW OF TROUBLESHOOTING

- DTC P0450 can be set if either of the following conditions occur:
  - 1. Faulty fuel tank differential pressure sensor, related circuit, or ECM.
  - 2. Faulty fuel tank filler tube vent valve or blocked vapor line.
- If the fuel tank filler tube vent valve is faulty and stays closed or the vapor line is blocked, the pressure
  inside the fuel tank is increased as the evaporative fuel is not purged especially at hot ambient
  temperatures. Once the pressure inside the fuel tank reaches 6 kPa, the sensor output voltage also
  reaches and remains 4.5 volts. This will set DTC P0450.
- To check a system blockage, do a performance test which uses a mechanical vacuum gauge and scan tool MB991502 (MUT-II) set on the fuel tank differential pressure sensor (TANK PRS SNSR 73). The mechanical gauge reading is used to verify scan tool MB991502 reading. A comparison of the mechanical gauge to scan tool MB991502 determines the problem in the system.

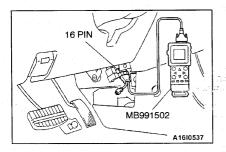

### DIAGNOSIS

Required Special Tool: MB991502: Scan Tool (MUT-II)

### Caution


To prevent damage to scan tool MB991502, turn the ignition switch off before connecting or disconnecting scan tool MB991502.


In this procedure, scan tool MB991502 should be used in the metric mode (showing the value in kPa). If not, set scan tool MB991502 by selecting the "System Setup" at the main menu.

### STEP 1. Using scan tool MB991502, check "Fuel tank differential pressure sensor (date list 73)" output.

In this step, check the fuel tank differential pressure sensor reading to determine if the fuel tank differential pressure sensor is operating correctly.

- (1) Check the MFI data list item: TANK PRS SNSR 73
- (2) Watch the sensor reading. This value varies depending on pressure inside the fuel tank.
- (3) Remove the fuel cap.
- (4) After the fuel cap has been removed, the pressure sensor reading should be between -0.5 kPa (-0.07 psi) and 0.5 kPa (0.07 psi).
  - If the reading is between -0.5 kPa (-0.07 psi) and 0.5 kPa (0.07 psi), the DTC could be caused by an intermittent electrical malfunction, or by a blockage in the EVAP system. Go to step 2.
  - If the reading is not between -0.5 kPa (-0.07 psi) and 0.5 kPa (0.07 psi), there is an electrical malfunction. Go to step 9.

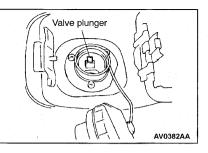

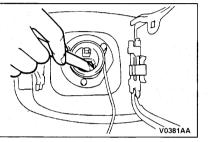

### STEP 2. Check the fuel vent valve plunger and flapper door operation.

NOTE: When a fuel nozzle is inserted to the fuel tank filler tube and the flapper door is opened, the fuel vent valve is closed (plunger moves towards the top of the neck). When the fuel cap is closed, the fuel cap pushes the plunger back in, which then opens the vent valve. If the flapper door or plunger does not operate properly, the vent valve stays closed even after the fuel cap is closed. This may block the vapor passage and set the DTC P0450.

- (1) Remove the fuel cap.
- (2) Push the flapper in to operate the valve.

NOTE: When the flapper is pushed in, the plunger of the valve should move towards the top.

- (3) Reinstall and tighten the fuel cap until three clicks are heard.
- (4) Remove the cap again and check the protrusion of the plunger to verify if it is pushed back.
- (5) The distance between the tip of vent valve plunger and that of fuel tank filler tube should be 28 mm (1.1 inches) or more.
  - If the plunger does not return, replace the fuel tank filler tube and securely tighten the cap.
  - If the operation is OK, install and securely tighten the fuel cap, Go to Step 3.

# STEP 3. Evaporative Emission System Leak Monitor Test using scan tool MB991502.

NOTE: This monitor is carried out at an engine speed of 1,600 r/min or more, transmission is in "N" or "R" position. The engine speed has to be automatically adjusted.


- (1) Erase the DTCs using scan tool MB991502. Ensure that the fuel cap is securely tightened.
- (2) Select "System Test" and press "YES" key.
- (3) Select "Evap Leak Mon" and press "YES" key.
- (4) If "Evap Leak Mon" is selected before starting the engine, "Engine must be running." is displayed. In this case, start the engine and then select "Evap Leak Mon" again.
- (5) If "Keep the TPS in idle position. during the test." is displayed, the ECM or PCM adjusts engine speed automatically. A manual adjustment for engine speed is not needed.
- (6) Keep the idling position during the monitor.


NOTE: If the engine speed does not reach 2,000 r/min during the monitor test, adjustment of the Speed Adjusting Screw may be needed. Refer to P.13B-143 for the adjustment procedure.

(7) Item "In Progress" is displayed during the monitor. Keep the engine speed and load within the defined range. Scan tool MB991502 shows these items on the screen. Item "In Progress" will be change from "NO" to "YES" by keeping engine conditions.

- (8) Message "Evap Leak Mon. Completed. Test Passed." is displayed when the test has been completed without malfunction. Evaporative emission system is working property at the moment. Please explain to customer that improperly tightened fuel cap can cause to turn MIL on. No further steps are needed.
- (9) Message "Evap Leak Mon. Completed. Test Failed & DTCs Set." is displayed when a malfunction has been detected during the test. Go to Step 4.
- (10)Message "Evap Leak Mon. discontinued. Retest again from the first" is displayed when the monitor was discontinued by a certain reason (input vehicle speed, engine speed and engine load was put of the specified range). Turn the ignition switch off once and start the monitor from the beginning.

NOTE: The monitor will not start unless turning off the ignition switch once and restart the engine.

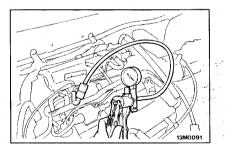

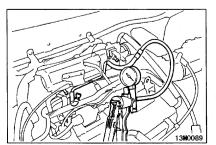

# STEP 4. Check the purge solenoid-to-air intake plenum hose for blockage.

- (1) Disconnect the purge solenoid-to-air intake plenum hose at the purge solenoid side.
- (2) Connect a hand vacuum pump to the disconnected hose end.
- (3) Apply vacuum, and check if the vacuum is not maintained.
  - If not maintained, go to STEP 5.
  - If maintained, replace the hose or intake plenum. Then go to STEP 6.

# STEP 5. Check the purge solenoid-to-air intake plenum hose for vacuum leakage.

- (1) Plug the purge solenoid-to-air intake plenum hose at the purge solenoid side.
- (2) Disconnect the purge solenoid-to-air intake plenum hose at the air intake plenum side.
- (3) Connect a hand vacuum pump to disconnected hose end.
- (4) Apply vacuum, and check if the vacuum is maintained.
   If maintained, go to STEP 6.
  - If not maintained, replace the hose. Then go to STEP

#### STEP 6. Performance test.


NOTE: Fuel temperature should be lower than 40°C (104°F) during the performance test.

In this step, verify if the EVAP system works properly, or determine which area of the evaporative emission system has a failure.

#### Caution


As a 0 - 6.2 kPa (0 - 0.90 psi) range vacuum gauge is used, the gauge may be broken if excessive vacuum pressure is applied. Do not apply a vacuum of more than 2.9 kPa (0.42 psi).

To achieve the performance test efficiently, a mechanical vacuum gauge [0 - 6.2 kPa (0 - 0.90 psi) range] and scan tool MB991502 should be used, and the engine to generate vacuum.

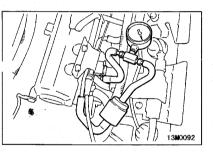

Compliture


- Install a mechanical vacuum gauge [0 6.2 kPa (0 0.90 psi) range] between the EVAP purge solenoid valve and the purge hose that comes from the evaporative emission canister.
- (2) Before starting the performance test, set the vehicle in the following condition.
  - Engine coolant temperature: 80 90°C (176 203°F)
  - Lights and all accessories: OFF
  - Transmission: "N" or "P" position
- (3) Select the item TANK PRS SNSR (data list 73) on scan tool MB991502 to see the fuel tank differential pressure sensor output.
- (4) Run the engine at idle.

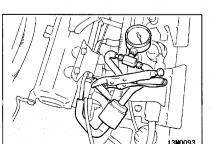

(5) Using locking pliers, pinch the hose between the purge solenoid and the intake plenum to close the purge flow, as a preparation of the performance test.

### 13**B-6**4

### MFI <1.8L Engine> - Troubleshooting

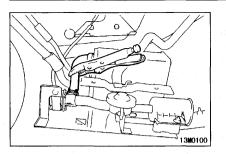

- (6) Using another locking pliers, pinch the vent hose between the evaporative emission canister and the vent solenoid. Momentary, remove the locking pliers at the purge hose; this will cause the vacuum build up in the EVAP system.
- (7) The engine vacuum comes from the purge port through the purge solenoid.

NOTE: During this operation, the purge solenoid may turn off but will resume in operation in about 20 seconds. Operation of the purge solenoid can be checked by needle fluctuation of the mechanical vacuum gauge.

- (8) Watch the vacuum reading on the mechanical vacuum gauge and scan tool MB991502.
- (9) When the vacuum reading reaches 2.9 kPa (0.42 psi) on the mechanical vacuum gauge and -2.9 kPa (-0.42 psi) on scan tool MB991502, pinch the hose between the purge solenoid and the intake manifold plenum using another locking pliers; this stops the application of vacuum and seals the EVAP system for the leak test.

NOTE: If there is a system failure, either of both vacuum readings may not reach to the above specifications. In this case, it is not necessary to pinch off the purge hose as shown. Refer to the performance test results table below for further steps.

- (10) After an elapsed time of 20 seconds, check the fuel tank differential pressure reading on scan tool MB991502.
  - OK: Change in pressure reading is 0.4 kPa (0.06 psi) or less [holding -2.5 kPa (-0.36 psi) or more vacuum].

MECHANICAL VACUUM GAUGE READING	SCAN TOOL MB991502 READING	RESULT	GO TO
Reaches 2.9 kPa (0.42 psi).	Reaches -2.9 kPa (-0.42 psi) and vacuum drops not more than 0.4 kPa (0.06 psi) in 20 seconds.	Satisfactory. No leak nor blockage detected.	Step 7
Reaches 2.9 kPa (0.42 psi).	Does not reach -2.9 kPa (-0.42 psi).*	Blockage in the system or bad differential pressure sensor.	Step 8
Does not reach 2.9 kPa (0.42 psi).	Does not reach -2.9 kPa (-0.42 psi).	Large leak in EVAP system.	Step 11
Reaches 2.9 kPa (0.42 psi).	Reaches -2.9 kPa (-0.42 psi) but vacuum drops more than 0.4 kPa (0.06 psi) in 20 seconds.	Small leak in EVAP system.	Step 12

### Performance test result table:

### NOTE


\*: If there is a blockage, scan tool MB991502 reading can be positive value (positive pressure) due to heat of return fuel from the engine.

STEP 7. Vacuum reading on both the mechanical gauge and scan tool MB991502 reaches the specifications and satisfy the specifications after 20 seconds:

EVAP system is properly working at the moment. The cause is an intermittent electrical wiring problem. Refer to GROUP 00, How to Use Troubleshooting/Inspection Service Points.

# STEP 8. Vacuum reading on the mechanical gauge reaches 2.9 kPa (0.42 psi) but scan tool MB991502 does not reach -2.9 kPa (-0.42 psi) :

- If the vacuum reading on the gauge reaches 2.9 kPa (0.42 psi) but the reading on scan tool MB991502 does not reach -2.9 kPa (-0.42 psi), either a system blockage or a bad differential pressure sensor may be the cause.
- (2) To determine if there is a blockage in the system, remove the fuel cap.
  - If the vacuum reading on the vacuum gauge [at this point 2.9 kPa (0.42 psi)] remain the same, there is a blockage in the system, and go to Step 8.
  - If the reading drops to about 0 kPa (0 psi), there is no blockage in the EVAP system. Then the fuel tank differential pressure sensor need to be tested. Go to Step 9.

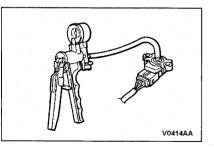

# STEP 9. Check the fuel tank differential pressure sensor.

- (1) Remove the floor carpet and floor cover.
- (2) Remove the fuel tank differential pressure sensor. Do not disconnect the connector at this point.
- (3) Connect the fuel tank differential pressure sensor to a hand vacuum pump and mechanical vacuum gauge [0 - 6.2 kPa (0 - 0.90 psi) range].
- (4) Turn the ignition switch "ON."
- (5) Using the scan tool, check MFI data list item 73: TANK PRS SNSR while applying vacuum.


Applying vacuum (at the gauge)	Scan tool reading	Output voltage (V)
5.0 kPa (0.72 psi)	–5 kPa	1 ± 0.1
No vacuum applied	0 kPa	2.5 ± 0.1

If not correct, go to Step 13.

If correct, it can be assumed that this malfunction is caused by an intermittent electrical wiring problem. Refer to GROUP 00. How to Use Troubleshooting/Inspection Service Points.

### 13**B-66**

### MFI <1.8L Engine> – Troubleshooting

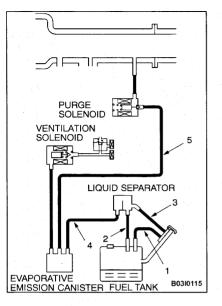


### STEP 10. System blockage inspection.

- (1) Disconnect the number 1 and 2 hoses shown in the illustration, check the mechanical vacuum gauge reading. If the vacuum reading does not drop, then the blockage is not in the fuel tank.
- (2) Disconnect one portion of the EVAP system at a time working towards the front of the vehicle until blockage is found (number 1 to 5 hoses in the illustration).
- (3) Repair the location of the blockage and go to Step 12.

STEP 11. Vacuum readings on both the mechanical gauge and scan tool MB991502 do not reach the specifications [2.9 kPa (0.42 psi) and -2.9 kPa (-0.42 psi)]:


This condition shows that there is a significant leakage in the system. The inspection procedure for the large system leakage is the same as the small leakage test in Step 12.

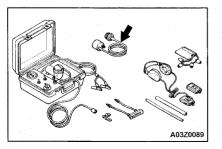


STEP 12. Vacuum readings on both the mechanical gauge and scan tool MB991502 do not reach the specification [2.9 kPa (0.42 psi) and -2.9 kPa (-0.42 psi)] but do not maintain the vacuum.

This condition shows that there is a slight leakage in the system. Follow the procedure below to locate the source of the leak.

- (1) The fuel cap relief valve inspection.
  - a. Remove the fuel cap and install the fuel tank filler tube adapter in the emission system tester kit in place of the fuel cap.
  - b. Plug the nipple on the fuel tank filler tube adapter.
  - c. Repeat the performance test. If the EVAP system holds the vacuum, then the fuel cap is faulty. Replace the fuel cap, and go to Step 18.

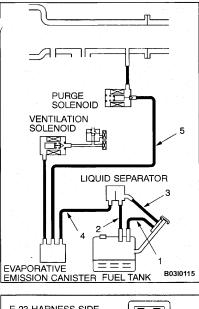

E-23 HARNESS SIDE CONNECTOR

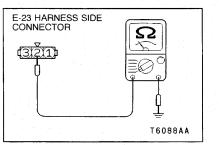

(2) To find the vacuum leakage in the system, clamp the number 1 and 2 hoses shown in the illustration. Repeat the performance test. This will determine if the vacuum leak is either in the fuel tank area or in the rest of the system.

NOTE: In this case, as we clamped off the vacuum hose connecting to the fuel tank, scan tool MB991502 reading will not change. Please use the mechanical gauge reading.

- If the EVAP system hold the vacuum leak is in the fuel tank area. To locate the leakage, pressurize the EVAP system to 3.4 kPa (0.49 psi) and look for leaky area using the ultrasonic leak detector in the Evaporative Emission System Tester. After repairing the leakage, go to Step 18.
- If the vacuum leak still exists, the leak is at other than fuel tank area.
- (3) Clamp off the vacuum hose one component at a time working towards the front of the vehicle until leakage is found (number 1 to 5 hoses shown in the illustration).
- (4) Repair the location of the leakage and go to Step 18.

# STEP 13. Check the circuits at fuel tank differential pressure sensor connector E-23.


- (1) Disconnect connector E-23 and measure at the harness side.
- (2) Turn the ignition switch "ON."
- (3) Measure voltage between terminal 3 and ground.
  - Voltage should be between 4.8 and 5.2 volts.
- (4) Turn the ignition switch "OFF."


(5) Check for continuity between terminal 2 and ground.
 There should be continuity (0 Ω).


If all checks above meet the specifications, go to Step 14.


If any check above do not meet the specifications, go to Step 16.


### 13**B-6**8

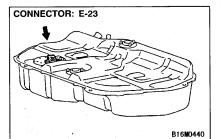

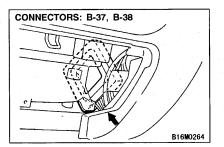

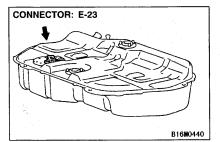

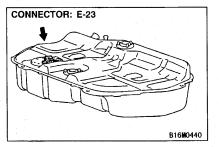

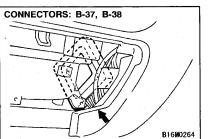

# STEP 14. Check the harness wire between fuel tank differential pressure sensor connector E-23 (terminal 1) and ECM connector B-38 (terminal 61).

NOTE: Check the wire after checking intermediate connectors B-36 and E-22. If intermediate connectors B-36 and E-22 are faulty, repair or replace them. Refer to GROUP 00E, Harness Connector Inspection. Then go to Step 18.

If the wire between fuel tank differential pressure sensor connector E-23 (terminal 1) and ECM connector B-38 (terminal 61) is not damaged, go to Step 15.

If the wire between fuel tank differential pressure sensor connector E-23 (terminal 1) and ECM connector B-38 (terminal 61) is damaged, repair it. Then go to Step 18.

### STEP 15. Check harness connector E-23 at the fuel tank differential pressure sensor for damage.

If harness connector E-23 is damaged, repair or replace it. Refer to GROUP 00E, Harness Connector Inspection.

If harness connector E-23 is not damaged, check ECM connectors B-37 and B-38, and repair or replace as required. Refer to GROUP 00E, Harness Connector Inspection. If ECM connectors B-37 and B-38 are in good condition, replace the ECM. Then go to Step 18.


# STEP 16. Check the harness wire between fuel tank differential pressure sensor connector E-23 and ECM connectors B-37 and B-38.

NOTE: Check the wire after checking the intermediate connectors B-36 and E-22. If the intermediate connectors B-36 and E-22 are faulty, repair or replace them. Refer to GROUP 00E. Harness Connector Inspection. Then go to Step 18.

If the wire between fuel tank differential pressure sensor connector E-23 and ECM connectors B-37 and B-38 are not damaged, go to Step 17.

If the wire between fuel tank differential pressure sensor connector E-23 and ECM connectors B-37 and B-38 are damaged, repair it. Then go to Step 18.

MFI <1.8L Engine> - Troubleshooting

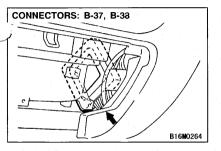

# STEP 17. Check harness connectors B-37 and B-38 at the ECM.


If harness connectors B-37 and B-38 are damaged, repair or replace it. Refer to GROUP 00E, Harness Connector Inspection.

13B-69

If harness connectors B-37 and B-38 are not damaged, replace the ECM. Then go to Step 18.

#### STEP 18. Confirmation test.

After system failures are repaired, repeat the Evaporative Emission System Leak Monitor test (Step 3) to check that the EVAP system operates correctly.

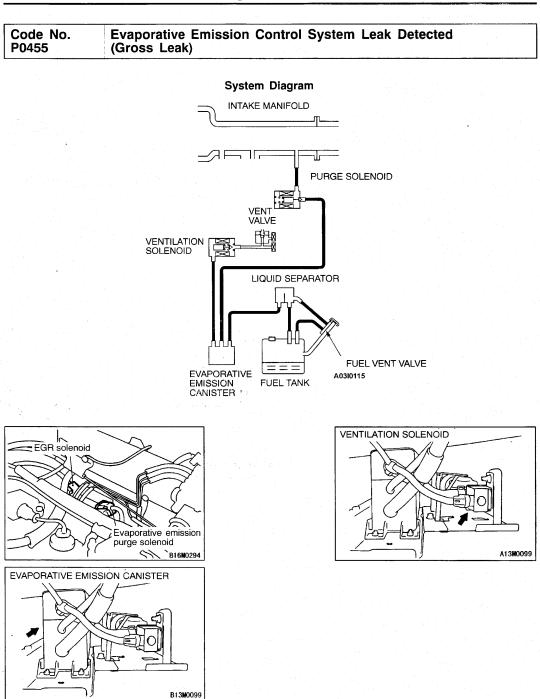

### TECHNICAL DESCRIPTION

The ECM turns on the evaporative emission ventilation solenoid which shuts off the evaporative emission canister outlet port. Then the evaporative emission purge solenoid is driven. As a result, the fuel system will be set into a negative pressure.

When the fuel system reaches negative pressure, the evaporative emission purge solenoid is turned "off," and the fuel system are sealed. As the fuel pressure inside the fuel tank changes, the ECM judges if there is a leak in the fuel system.

### DTC SET CONDITIONS

### **Check Area**

- At least sixteen minutes have passed since the starting sequence was completed.
- Engine coolant temperature higher than 60°C (140°F).
- Engine speed is 1,600 r/min or more.
- Power steering pressure switch: "OFF."
- Barometric pressure is higher than 76 kPa (11 psi).
- Volumetric efficiency is at between 20 and 80 percent.
- The engine coolant temperature is 30°C (86°F) or less when the engine is started.
- Intake air temperature is higher than 5°C
   (41°F).
- The pressure rise when the evaporative emission purge solenoid and evaporative emission ventilation solenoid are closed is less than 451 Pa (0.065 psi).

OVERVIEW OF TROUBLESHOOTING

# • The pressure fluctuation width is less than 647 Pa (0.094 psi).

- At least twenty seconds have passed since pressure fluctuation detection commenced.
- Fuel tank differential pressure sensor output voltage is 1 4 volts.
- Intake air temperature is 30°C (86°F) or less when the engine started.
- Vehicle speed is 30 km/h (18.7 mph) or more.
- Monitoring time: 75 125 seconds


### Judgment Criteria

 Internal pressure of the fuel tank has changed more than 843 Pa (0.122 psi) in 20 seconds after the tank and vapor line were closed.

### TROUBLESHOOTING HINTS

The most likely causes for this code to be set are:

- Loose fuel cap.
- Fuel cap relief pressure is incorrect.
- Evaporative emission canister seal is faulty.
- Evaporative emission canister is clogged.
- Fuel vent valve failed.
- Purge line or vapor line is clogged.
- Fuel tank, purge line or vapor line seal failed.
- Evaporative emission purge solenoid failed.
- Evaporative emission ventilation solenoid failed.
- Fuel tank differential pressure sensor failed.
- Engine coolant temperature sensor failed.
- Intake air temperature sensor failed.
- Power steering pressure switch failed.
- Use of incorrect fuel.
- To determine the cause of DTC P0442, a performance test is needed. The performance test uses a mechanical vacuum gauge and scan tool MB991502 set on the fuel tank differential pressure sensor (TANK PRS SNSR 73). The mechanical gauge reading is used to verify scan tool MB991502 reading. A comparison of the mechanical gauge to scan tool MB991502 determines the problem in the system.
- Prior to doing the performance test, several simple inspections are needed to exclude some possibilities
  of the symptom.

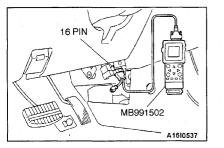

### DIAGNOSIS

Required Special Tool: MB991502: Scan Tool (MUT-II)

#### Caution

To prevent damage to scan tool MB991502, turn the ignition switch off before connecting or disconnecting scan tool MB991502.

In this procedure, scan tool MB991502 should be used in the metric mode (showing the value in kPa). If not, set scan tool MB991502 by selecting the "System Setup" at the main menu.

#### STEP 1. Check for other DTCs.

If any other DTCs are set, please check those DTCs first then follow the steps below.

### STEP 2. Evaporative Emission System Leak Monitor Test using scan tool MB991502.

NOTE: This monitor is carried out at an engine speed of 1,600 r/min or more, transmission is in "N" or "R" position. The engine speed has to be automatically adjusted.

- (1) Erase the DTCs using scan tool MB991502. Ensure that the fuel cap is securely tightened.
- (2) Select "System Test" and press "YES" key.
- (3) Select "Evap Leak Mon" and press "YES" key.
- (4) If "Evap Leak Mon" is selected before starting the engine, "Engine must be running." is displayed. In this case, start the engine and then select "Evap Leak Mon" again.
- (5) If "Keep the TPS in idle position. during the test." is displayed, the ECM adjusts engine speed automatically. A manual adjustment for engine speed is not needed.
  (6) Keep the idling position during the monitor.

NOTE: If the engine speed does not reach 2,000 r/min during the monitor test, adjustment of the Speed Adjusting Screw may be needed. Refer to P.13B-143 for the adjustment procedure.

- (7) Item "In Progress" is displayed during the monitor. Keep the engine speed and load within the defined range. Scan tool MB991502 shows these items on the screen. Item "In Progress" will be change from "NO" to "YES" by keeping engine conditions.
- (8) Message "Evap Leak Mon. Completed. Test Passed." is displayed when the test has been completed without malfunction. Evaporative emission system is working property at this time. Please explain to customer that improperly tightened fuel cap can cause to MIL turn on. No further steps are needed.
- (9) Message "Evap Leak Mon. Completed. Test Failed & DTCs Set." is displayed when a malfunction has been detected during the test. Go to Step 3.

(10)Message "Evap Leak Mon. discontinued. Retest again from the first" is displayed when the monitor was discontinued by a certain reason (input vehicle speed, engine speed and engine load was put of the specified range). Turn the ignition switch off once and start monitoring from the beginning.

NOTE: Monitoring will not start unless turning off the ignition switch is turned off once and the engine restarted.

# STEP 3. Using scan tool MB991502, check "Fuel tank differential pressure sensor (date list 73)" output.

In this step, the fuel tank differential pressure sensor reading is checked to determine if the fuel tank differential pressure sensor output is within the normal range.

- (1) Check the MFI data list item: TANK PRS SNSR 73
- (2) Watch the sensor reading. This value varies depending on pressure inside the fuel tank.
- (3) Remove the fuel cap.

NOTE: If the fuel cap is not securely tightened, it might have the cause of a leak in the EVAP system and set the DTC P0442.

- (4) After the fuel cap has been removed, the pressure sensor reading should be between -0.5 kPa (-0.07 psi) and 0.5 kPa (0.07 psi).
  - If the reading is between -0.5 kPa (-0.07 psi) and 0.5 kPa (0.07 psi), the fuel tank differential pressure sensor circuit is OK. Therefore, go to Step 4.
  - If the reading is not between -0.5 kPa (-0.07 psi) and 0.5 kPa (0.07 psi), the fuel tank differential pressure sensor is not working properly. Replace the fuel tank differential pressure sensor.


# STEP 4. Check the fuel vent valve plunger and flapper door operation.

NOTE: When a fuel nozzle is inserted to the fuel tank filler tube and the flapper door is opened, the fuel vent valve is closed (plunger moves towards the top of the neck). When the fuel cap is closed, the fuel cap pushes the plunger back in, which then opens the vent valve. If the flapper door or plunger does not operate properly, the vent valve stays closed even after the fuel cap is closed. This may block the vapor passage. A faulty vent valve plunger may also cause the fuel cap not to seat properly. Either of these conditions can set DTC P0442.


- (1) Remove the fuel cap.
- (2) Push the flapper in to operate the valve.

NOTE: When the flapper is pushed in, the plunger of the valve should move towards the top.

- (3) Reinstall and tighten the fuel cap until three clicks are heard.
- (4) Remove the cap again and check the protrusion of the plunger to verify if it is pushed back.

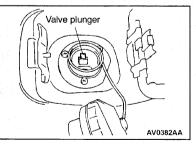


⇒.¥

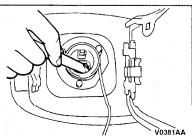

## 13B-74


### MFI <1.8L Engine> - Troubleshooting

- (5) Distance between the tip of vent valve plunger and that of fuel tank filler tube should be 28 mm (1.1 inches) or more.
  - If the plunger does not return, replace the fuel tank filler tube and securely tighten the cap.
  - If the operation is OK, install and securely tighten the fuel cap.

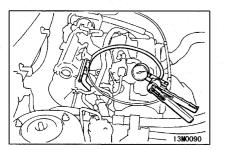


# STEP 5. Using scan tool MB991502, actuator test item 08 : Evaporative Emission Purge Solenoid.


- (1) Disconnect the hose connected to the evaporative emission canister from the purge solenoid.
- (2) Connect a hand vacuum pump to the nipple where the hose is disconnected at the previous step.
- (3) The vacuum should be maintained when vacuum is applied and vacuum should leak when the purge solenoid is activated by the actuator test of scan tool MB991502.
  - If correct, go to Step 6.
  - If not, refer to DTC P0443 (Evaporative Emission Control System Purge Control Valve Circuit Malfunction) on P.13B-56.

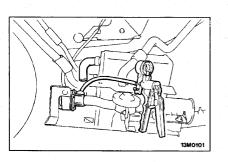

# STEP 6. Using scan tool MB991502, actuator test item 29 : evaporative Emission Ventilation Solenoid.

- (1) Disconnect the hose connected to the vent solenoid valve from the vent solenoid valve.
- (2) Connect a hand vacuum pump to the nipple that is disconnected in the previous step.
- (3) The vacuum should leak when vacuum is applied, and the vacuum should be maintained when the purge solenoid is activated by the actuator test of scan tool MB991502.
  - If correct, go to Step 7.
  - If not, refer to DTC P0446 (Evaporative Emission Control System Vent Control Malfunction) on P.13B-57.

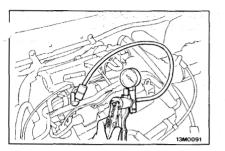

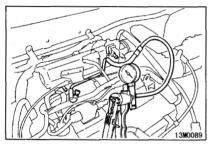

# STEP 7. Check the purge solenoid-to-air intake plenum hose for blockage.

- (1) Disconnect the purge solenoid-to-air intake plenum hose at the purge solenoid side.
- (2) Connect a hand vacuum pump to the disconnected hose end.
- (3) Apply vacuum, and check if the vacuum is not maintained.
  - If not maintained, go to STEP 8.
  - If maintained, replace the hose or intake plenum. Then go to STEP 9.

# STBP 8. Check the purge solenoid-to-air intake plenum hose for vacuum leakage.

- (1) Plug the purge solenoid-to-air intake plenum hose at the purge solenoid side.
- (2) Disconnect the purge solenoid-to-air intake plenum hose at the air intake plenum side.
- (3) Connect a hand vacuum pump to disconnected hose end.
- (4) Apply vacuum, and check if the vacuum is maintained.
   If maintained, go to STEP 9.
  - If not maintained, replace the hose. Then go to STEP 9.

#### STEP 9. Performance test.

NOTE: Fuel temperature should be lower than  $40^{\circ}C$  (104°F) during the performance test.

In this step, verify if the EVAP system works properly, or determine which area of the evaporative emission system has a failure.


#### Caution

As a 0 - 6.2 kPa (0 - 0.90 psi) range vacuum gauge is used, the gauge may be broken if excessive vacuum pressure is applied. Do not apply a vacuum of more than 2.9 kPa (0.42 psi).


To achieve the performance test efficiently, a mechanical vacuum gauge [0 - 6.2 kPa (0 - 0.90 psi) range] and scan tool MB991502 should be used, and the engine to generate vacuum.

## 13B-76


### MFI <1.8L Engine> - Troubleshooting

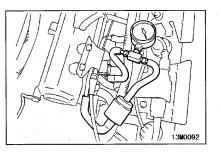

- Install a mechanical vacuum gauge [0 6.2 kPa (0 -0.90 psi) range] between the EVAP purge solenoid valve and the purge hose that comes from the evaporative emission canister.
- (2) Before starting the performance test, set the vehicle in the following condition.
  - Engine coolant temperature: 80 90°C (176 203°F)
  - Lights and all accessories: OFF
  - Transmission: "N" or "P" position
- (3) Select the item TANK PRS SNSR (data list 73) on scan tool MB991502 to see the differential pressure sensor output.
- (4) Run the engine at idle.

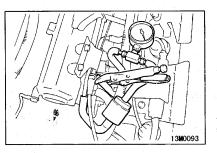

(5) Using locking pliers, pinch the hose between the purge solenoid and the intake plenum to close the purge flow, as a preparation of the performance test.

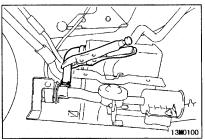

- (6) Using another locking pliers, pinch the vent hose between the evaporative emission canister and the vent solenoid. Momentary, remove the locking pliers at the purge hose; this will cause the vacuum build up in the EVAP system.
   (7) The engine vacuum comes from the purge port through
- (7) The engine vacuum comes from the purge port through the purge solenoid.

NOTE: During this operation, the purge solenoid may turn off but will resume operation in about 20 seconds. Operation of the purge solenoid can be checked by needle fluctuation of the mechanical vacuum gauge.

(8) Watch the vacuum reading on the mechanical vacuum gauge and scan tool MB991502.

(9) When the vacuum reading reaches 2.9 kPa (0.42 psi) on the mechanical vacuum gauge and -2.9 kPa (-0.42 psi) on scan tool MB991502, pinch the hose between the purge solenoid and the intake manifold plenum using another locking pliers; this stops the application of vacuum and seals the EVAP system for the leak test.

NOTE: If there is a system failure, either of both vacuum readings may not reach to the above specifications. In this case, it is not necessary to pinch off the purge hose as shown. Refer to the performance test results table below for further steps.

- (10) After an elapsed time of 20 seconds, check the fuel tank differential pressure reading on scan tool MB991502.
  - OK: Change in pressure reading is 0.4 kPa (0.06 psi) or less [holding -2.5 kPa (-0.36 psi) or more vacuum].

#### Performance test result table:

MECHANICAL VACUUM GAUGE READING	SCAN TOOL MB991502 READING	RESULT	GO TO
/ Reaches 2.9 kPa (0.42 psi).	Reaches -2.9 kPa (-0.42 psi) and vacuum drops not more than 0.4 kPa (0.06 psi) in 20 seconds.	Satisfactory. No leak nor blockage detected.	Step 10
Reaches 2.9 kPa (0.42 psi).	Does not reach -2.9 kPa (-0.42 psi).*	Blockage in the system or bad differential sensor.	Step 11
Does not reach 2.9 kPa (0.42 psi).	Does not reach -2.9 kPa (-0.42 psi).	Large leak in EVAP system.	Step 13
Reaches 2.9 kPa (0.42 psi).	Reaches –2.9 kPa (–0.42 psi) but vacuum drops more than 0.4 kPa (0.06 psi) in 20 seconds.	Small leak in EVAP system.	Step 14


#### NOTE

\*: If there is a blockage, scan tool MB991502 reading can be a positive value (positive pressure) due to the heat of return fuel from the engine.

STEP 10. Vacuum reading on both the mechanical gauge and scan tool MB991502 reaches the specifications and satisfy the specifications after 20 seconds:

EVAP system is properly working at the moment. The cause of DTC might have been a loose fuel cap and the customer may have already tightened fuel cap causing the MIL to turn on. No further steps are needed. STEP 11. Vacuum reading on the mechanical gauge reaches 2.9 kPa (0.42 psi) but scan tool MB991502 does not reach -2.9 kPa (-0.42 psi) :

- (1) If the vacuum reading on the gauge reaches 2.9 kPa (0.42 psi) but the reading on scan tool MB991502 does not reach -2.9 kPa (-0.42 psi), either a system blockage or a bad differential pressure sensor may be the cause.
- (2) To determine if there is a blockage in the system, remove the fuel cap.
  - If the vacuum reading on the vacuum gauge [at this point 2.9 kPa (0.42 psi)] remains the same, there is a blockage in the system. Go to Step 12.
  - If the reading drops to about 0 kPa (0 psi), there is no blockage in the EVAP system. The fuel tank differential pressure sensor needs to be replaced. After replacing the differential pressure sensor, go to Step 15.

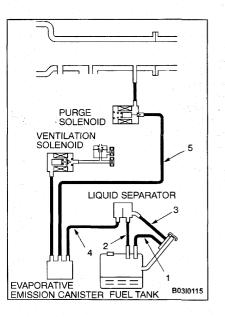


#### STEP 12. System blockage inspection.

- (1) Disconnect the number 1 hose shown in the illustration, check the mechanical vacuum gauge reading. If the vacuum reading does not drop, then the blockage is not in the fuel tank.
- (2) Disconnect one portion of the EVAP system at a time working towards the front of the vehicle until blockage is found (number 1 to 3 hoses in the illustration).
- (3) Repair the location of the blockage and go to Step 15.

STEP 13. Vacuum readings on both the mechanical gauge and scan tool MB991502 do not reach the specifications [2.9 kPa (0.42 psi) and -2.9 kPa (-0.42 psi)]:

This condition shows that there is a significant leakage in the system. The inspection procedure for the large system leakage is the same as the small leakage test in Step 14.

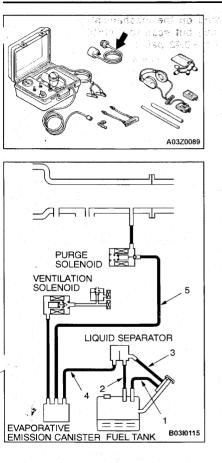

STEP 14. Vacuum readings on both the mechanical gauge and scan tool MB991502 do not reach the specification [2.9 kPa (0.42 psi) and -2.9 kPa (-0.42 psi)] but do not maintain the vacuum.

This condition shows that there is a slight leakage in the system. Follow the procedure below to locate the source of the leak.


- (1) The fuel cap relief valve inspection.
  - a. Remove the fuel cap and install the fuel tank filler tube adapter in the emission system tester kit in place of the fuel cap.
  - b. Plug the nipple on the fuel tank filler tube adapter.
  - c. Repeat the performance test. If the EVAP system holds the vacuum, then the fuel cap is faulty. Replace the fuel cap, and go to Step 15.
- (2) To find the vacuum leakage in the system, clamp the number 1 hose shown in the illustration. Repeat the performance test. This will determine if the vacuum leak is either in the fuel tank area or in the rest of the system.

NOTE: In this case, as we clamped off the vacuum hose connecting to the fuel tank, scan tool MB991502 reading will not change. Please use the mechanical gauge reading.


- If the EVAP system hold the vacuum leak is in the fuel tank area. To locate the leakage, pressurize the EVAP system to 3.4 kPa (0.49 psi) and look for leaky area using the ultrasonic leak detector in the Evaporative Emission System Tester. After repairing the leakage, go to Step 15.
- If the vacuum leak still exists, the leak is at other than fuel tank area.
- (3) Clamp off the vacuum hose one component at a time working towards the front of the vehicle until leakage is found (number 1 to 3 hoses shown in the illustration).
- (4) Repair the leakage at that location and go to Step 15.

#### STEP 15. Confirmation test.

After system failures are repaired, repeat the Evaporative Emission System Leak Monitor test (Step 2) to check that the EVAP system operates correctly.

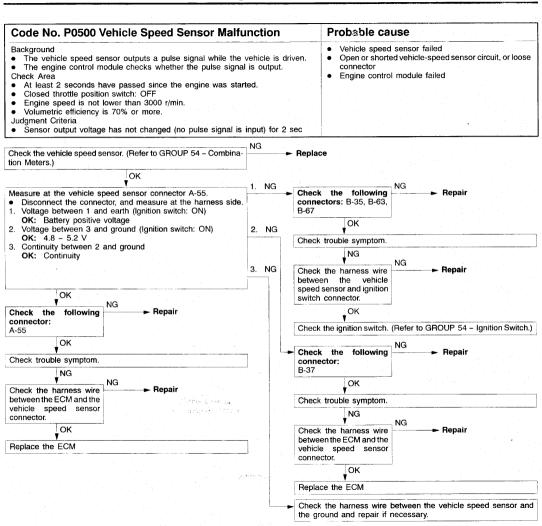

Code No. P0505 Idle Control System Malfunction	Probable cause
<ul> <li>Background</li> <li>If there is a malfunction of the IAC system, the actual engine speed will r identical to the target engine speed.</li> <li>The engine control module checks the difference between the actual engine and the target engine speed.</li> </ul>	connector.
<ul> <li>Check Area</li> <li>Vehicle speed has reached 1.5 km/h (0.93 mph) or higher at least once.</li> <li>Under the closed loop idle speed control.</li> <li>Judgment Criteria</li> <li>Actual idle speed has continued to be higher than the target idle speed b r/min or more for 10 sec.</li> </ul>	y 300
Check Area Vehicle speed has reached 1.5 km/h (0.93 mph) or higher at least once. During idle speed closed loop control The higher thereafter a the last drive in 45% (112%) or loop	
<ul> <li>The highest temperature at the last drive is 45°C (113°F) or less.</li> <li>Engine coolant temperature is approx. 80°C (176°F) or more.</li> <li>Battery voltage is 10 V or more.</li> <li>Atmospheric pressure is 76 kPa (11 psi) or more.</li> </ul>	
<ul> <li>Intake air temperature is -10°C (14°F) or more.</li> <li>Judgment Criteria</li> <li>Actual idle speed has been minimum 200 r/min higher than the target idle for ten seconds.</li> </ul>	speed
<ul> <li>Check Area</li> <li>During idle speed closed loop control</li> <li>Engine coolant temperature is about 80°C (176°F) or higher.</li> </ul>	
<ul> <li>Battery positive voltage is 10V or higher.</li> <li>Power steering switch is off.</li> <li>Volumetric efficiency is 40% or less.</li> <li>Atmospheric pressure is 76 kPa (11 psi) or more.</li> </ul>	
<ul> <li>Intake air temperature is -10°C (14°F) or more.</li> <li>Judgment Criteria</li> <li>Actual idle speed has been minimum 100 r/min higher than the target idle</li> </ul>	speed
for ten seconds.	
Check the idle air control motor. (Refer to P.13B-152.)	Replace
OK NG	
Measure at the idle air control motor connector A-51. • Disconnect the connector and measure at the harness side. • Voltage between 2 and ground, and 5 and ground (Ignition switch: ON)	Check the harness wire between MFI relay and idle air control motor connector. Repair, if necessary.
OK: Battery positive voltage	

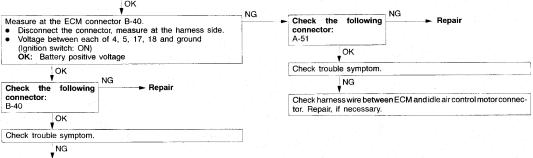


Replace the ECM.

13B-82

Replace the ECM.

Code No. P0510 Closed Throttle Malfunction	Position	Switch	Probable cause
<ul> <li>Background</li> <li>While the engine is idling without depressing the acc can be input from the closed throttle position switch to</li> <li>The engine control module is used for checking the ir is idling.</li> <li>Check Area</li> <li>Throttle position sensor output voltage is 2.0 V or module throttle position switch has been turned on.</li> <li>Closed throttle position switch has been turned on.</li> <li>Check Area</li> <li>Repeat the *1 drive and *2 stop 15 times.</li> <li>*1 drive: Engine speed is 1500 r/min or more, air flow see Hz or less for two seconds or more.</li> <li>*2 stop: Vehicle speed is more than 1.5 km/h (0.93 mph Judgment Criteria</li> <li>Closed throttle position switch remains off.</li> </ul>	<ul> <li>the engine cor sput signal while</li> <li>ore.</li> <li>nsor output free</li> </ul>	ntrol module. e the engine	<ul> <li>Closed throttle position switch failed.</li> <li>Open or shorted closed throttle position switch circuit, or loose connector.</li> <li>Engine control module failed.</li> </ul>
Check the closed throttle position switch. (Refer to P.13B-149.)	NG	Replace th	e throttle position sensor (TPS).
OK Measure at the throttle position sensor connector A-52.     Disconnect the connector, and measure at the harness side.     Voltage between 3 and ground (Ignition switch: ON)     OK: 4 ∨ or higher     Continuity between 4 and ground     OK: Continuity     OK     OK     OK     OK     NG     Poly     NG     Poly     Poly     NG     Poly     Poly	NG		CK Jble symptom. NG harness wire between ECM and throttle position sensor
A-52		Replace t	OK V V he ECM. Repair
Check trouble symptom.	]		

Code No.P0551 Power Steering Pressure Sensor Circuit Range/Performance	Probable cause
Background • The steering wheel will be set to the straight-ahead position for a while during driving. At that time the power steering pressure switch will be turned off. • The engine control module checks whether the power steering pressure switch	<ul> <li>Power steering pressure switch failed.</li> <li>Open or shorted power steering pressure switch circuit, or loose connector</li> <li>Engine control module failed.</li> </ul>
<ul> <li>is turned off during drive.</li> <li>Check Area</li> <li>Intake air temperature is -10°C (14°F) or higher.</li> <li>Barometric pressure is 76 kPa (11 psi) or higher.</li> <li>Engine coolant temperature is 10°C (50°F) or more.</li> <li>Repeat *1 drive and *2 stop ten times or more.</li> <li>*1: Engine speed is 2,500 r/min or higher, volumetric efficiency is 55% or higher and vehicle speed is 5 km/h (3.1 mph) or higher for 2 seconds or more.</li> <li>*2: Vehicle speed is 15 km/h (0.93 mph) or lower.</li> <li>Judgment Criteria</li> <li>Power steering pressure switch remains on.</li> </ul>	

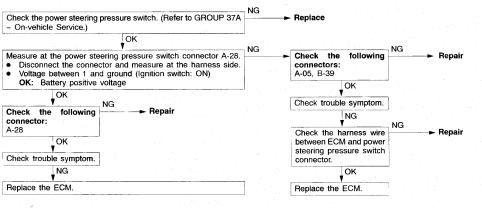

#### 19<sup>4</sup>

Code No. P0705 Transmission Range Sensor Circuit Malfunction (RPNDL Input)	Probable cause
<ul> <li>Background</li> <li>When a malfunction of the park/neutral position switch is detected, the transaxle control module outputs a malfunction signal to the engine control module.</li> <li>Range of Check, Set Conditions</li> <li>A park/neutral position switch malfunction signal is input to the engine control module from the transaxle control module.</li> </ul>	loose connector. • Engine control module failed.

Check the automatic transaxle diagnostic trouble codes. (Refer to GROUP 23A - Troubleshooting)

Code No. P0710 Transmission Fluid Temperature Sensor Circuit Malfunction	Probable cause
<ul> <li>Background</li> <li>When a malfunction of the fluid temperature sensor is detected, the transaxle control module outputs a malfunction signal to the engine control module.</li> <li>Check Area Judgment Criteria</li> <li>The signal which indicates the failure of the oil temperature sensor is input from the transaxle control module to the engine control module.</li> </ul>	<ul> <li>connector</li> <li>Engine control module failed.</li> </ul>

Check the automatic transaxle diagnostic trouble codes. (Refer to GROUP 23A - Troubleshooting.)

Code No. P0715 Input/Turbine Speed Sensor Circuit Malfunction	Probable cause
<ul> <li>Background</li> <li>When a malfunction of the input shaft speed sensor is detected, the transaxle control module outputs a malfunction signal to the engine control module.</li> <li>Check Area, Judgment Criteria</li> <li>Input shaft speed sensor failure signal is input to the engine control module from the transaxle control module.</li> </ul>	<ul> <li>Input shaft speed sensor filed.</li> <li>Open or shorted input shaft speed sensor circuit, or loose connector</li> <li>Engine control module failed.</li> </ul>

Check the automatic transaxle diagnostic trouble codes. (Refer to GROUP 23A - Troubleshootin)

Code No. P0720 Output Speed Sensor Circuit Malfunction	Probable cause
<ul> <li>Background</li> <li>When a malfunction of the output shaft speed sensor is detected, the transaxle control module outputs a malfunction signal to the engine control module.</li> <li>Check Area, Judgment Criteria</li> <li>Output shaft speed sensor failure signal is input to the engine control module from the transaxle control module.</li> </ul>	<ul> <li>Output shaft speed sensor failed.</li> <li>Open or shorted output shaft speed sensor circuit, or loose connector</li> <li>Engine control module failed.</li> </ul>

Check the automatic transaxle diagnostic trouble codes. (Refer to GROUP 23A - Troubleshooting)

Code No. P0725 Engine Speed Input Circuit Malfunction	Probable cause
<ul> <li>Background</li> <li>When a malfunction of the crankshaft position sensor is detected, the transaxle control module outputs a malfunction signal to the engine control module.</li> <li>Check Area, Judgment Criteria</li> <li>Crankshaft position sensor failure signal is input to the engine control module from the transaxle control module.</li> </ul>	<ul> <li>Crankshaft position sensor failed.</li> <li>Open or shorted input shaft speed sensor circuit, or loose connector</li> <li>Engine control module failed.</li> </ul>

Check the automatic transaxle diagnostic trouble codes. (Refer to GROUP 23A - Troubleshooting)

Code No. P0740 Torque Converter Clutch System Malfunction	Probable cause
<ul> <li>When a malfunction of the torque converter clutch or its related system is detected, the transaxle control module outputs a malfunction signal to the engine control module.</li> </ul>	<ul> <li>Torque converter clutch or its related system failed.</li> <li>Open or shorted torque converter clutch or its related system circuit, or loose connector</li> <li>Engine control module failed.</li> </ul>
<ul> <li>Check Area, Judgment Criteria</li> <li>Failure signal of the torque converter clutch or its related system is input to the engine control module form the transaxle control module.</li> </ul>	

Check the automatic transaxle diagnostic trouble codes. (Refer to GROUP 23A - Troubleshooting)

Code No. P0750 Shift Solenoid A Malfunction	Probable cause
<ul> <li>Background</li> <li>When a malfunction of the shift solenoid A (Low-reverse solenoid) is detected, the transaxle control module outputs a malfunction signal to the engine control module.</li> <li>Check Area, Judgment Criteria</li> <li>Low-reverse solenoid failure signal is input to the engine control module from the transaxle control module.</li> </ul>	<ul> <li>Low-reverse solenoid failed.</li> <li>Open or shorted low-reverse solenoid circuit, or loose connector.</li> <li>Engine control module failed.</li> </ul>

Check the automatic transaxle diagnostic trouble codes. (Refer to GROUP 23A – Troubleshooting)

Code No. P0755 Shift Solenoid B Malfunction	Probable cause
<ul> <li>Background</li> <li>When a malfunction of the shift solenoid B (Underdrive solenoid) is detected, the transaxle control module outputs a malfunction signal to the engine control module.</li> <li>Check Area, Judgment Criteria</li> <li>Underdrive solenoid failure signal is input to the engine control module from the transaxle control module.</li> </ul>	<ul> <li>Underdrive solenoid failed.</li> <li>Open or shorted underdrive solenoid circuit, or loose connector.</li> <li>Engine control module failed.</li> </ul>

Check the automatic transaxle diagnostic trouble codes. (Refer to GROUP 23A - Troubleshooting)

Code No. P0760 Shift Solenoid C Malfunction	Probable cause
<ul> <li>Background</li> <li>When a malfunction of the shift solenoid C (Second solenoid) is detected, the transaxle control module outputs a malfunction signal to the engine control module. Check Area, Judgment Criteria</li> <li>Second solenoid failure signal is input to the engine control module form the transaxle control module.</li> </ul>	<ul> <li>Second solenoid failed.</li> <li>Open or shorted second solenoid circuit, or loose connector</li> <li>Engine control module failed.</li> </ul>

Check the automatic transaxle diagnostic trouble codes. (Refer to GROUP 23A - Troubleshooting)


<ul> <li>Probable cause</li> <li>Overdrive solenoid failed.</li> <li>Open or shorted overdrive solenoid circuit, or loose connector</li> <li>Engine control module failed.</li> </ul>	

Check the automatic transaxle diagnostic trouble codes. (Refer to GROUP 23A - Troubleshooting)

Code No. P1400 Manifold Differential Pressure Sensor Circuit Malfunction	Probable cause		
<ul> <li>Background</li> <li>The manifold differential pressure sensor outputs a voltage which corresponds to the negative pressure in the intake manifold.</li> <li>The engine control module checks whether the voltage output by the manifold differential pressure sensor is within a specified range.</li> </ul>	circuit, or loose connector		
<ul> <li>Check Area</li> <li>8 min or more have passed after the engine was started. However, only when the engine coolant temperature is 0°C (32°F) or less.</li> <li>Engine coolant temperature is not lower than 45°C (113°F).</li> </ul>			
<ul> <li>Intake air temperature is not lower than 5°C (41°F)</li> <li>Volumetric efficiency is 30% – 55%.</li> <li>Judgment Criteria</li> <li>Sensor output voltage has continued to be 4.6V [corresponding to an absolute</li> </ul>			
<ul> <li>Sensor output voltage has communed to be 2.5% [corresponding to an absolute pressure of 118 kPa (17 psi)] or higher for 2 sec.</li> <li>Sensor output voltage has continued to be 0.1V [corresponding to an absolute pressure of 2.4 kPa (0.3 psi)] or lower for 2 sec.</li> </ul>			
<ul> <li>Check Area</li> <li>Eight minutes have passed after the engine started. However, only when the engine coolant temperature when starting the engine is 0°C (32°F) or less.</li> <li>Engine coolant temperature is 45°C (113°F) or more.</li> </ul>			
<ul> <li>Intake air temperature is 5°C (41°F) or more.</li> <li>Volumetric efficiency is not lower than 30%.</li> <li>Judgment Criteria</li> </ul>			
<ul> <li>Sensor output voltage is 4.2 V or more for 2 seconds. (Absolute pressure is approx. 807 mmHg or more)</li> <li>Check Area</li> <li>Eight minutes have passed after the engine started. However, only when the engine</li> </ul>			
<ul> <li>Eight minutes have passed after the engine stated. However, only when the engine coolant temperature when starting the engine is 0°C (32°F) or less.</li> <li>Engine coolant temperature is 45°C (113°F) or more.</li> <li>Intake air temperature is 5°C (41°F) or more.</li> </ul>			
<ul> <li>Volumetric efficiency is 70% or more.</li> <li>Judgment Criteria</li> <li>Sensor output voltage is 1.8 V or less for 2 seconds. (Absolute pressure is approx.</li> </ul>			

#### MFI <1.8L Engine> - Troubleshooting

# 13B-87

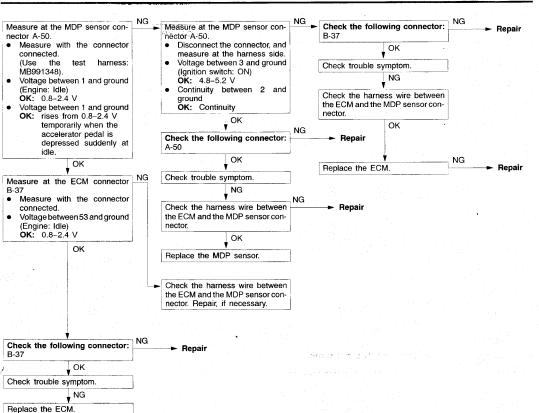

## 13B-88

٠

Code No. P1500 Generator FR Terminal Circuit Malfunction	Probable cause
<ul> <li>Background</li> <li>When the generator field coils is controlled, the generator FR te signal to the engine control module.</li> <li>The engine control module detects the generator output with the ir controls the idle air control motor according to the generator output with the ir controls the idle air control motor according to the generator output check Area</li> <li>Engine speed is higher than 50 r/min.</li> <li>Judgment Criteria</li> <li>Input voltage from the generator FR terminal has been equal to voltage for 20 seconds.</li> </ul>	nput signal, and tput.
Ок	
Measure at the generator connector A-27. • Measure with the connector connected. • Voltage between 4 and ground Engine: Idle Radiator fan: stopped Headlight: off → on Rear defogger switch: Off→On Stop light: Off→On OK: Voltage falls	► Replace the ECM.
NG	
NG Measure at the generator connector A-02.     Disconnect the connector, and measure at the harness side.     Voltage between 4 and ground (Ignition switch: ON)     OK: Battery positive voltage	Check the following NG ► Repair connectors: A-24, A-26, B-39 OK
OK	Check trouble symptom.
Check the following Repair	NG
A-02	Check the harness wire NG
OK	between the ECM and the generator connector.
Check trouble symptom.	OK
NG ▼NG	Replace the ECM.
Check the harness wire between the ECM and the generator connector.	
OK Ţ	
Replace the generator.	

Code No. P1600 Serial Communication Link Malfunction	Probable cause
<ul> <li>Background</li> <li>The engine control module receives various messages from the transaxle control module via communication line.</li> <li>The engine control module monitors an abnormal message signal due to open circuit in communication line and transaxle control module failure.</li> <li>Check Area</li> <li>Two seconds or more have passed immediately after the engine started.</li> <li>Judgment Criteria</li> <li>Abnormal communication line (TCM to ECM) with the transaxle control module (TCM)</li> <li>Transaxle control module (TCM) failed.</li> </ul>	<ul> <li>Automatic transaxle control system failed.</li> <li>Open or short circuit, or loose connector in communication line between engine control module and transaxle control module</li> <li>Transaxle control module failed.</li> <li>Engine control module failed.</li> </ul>
Check the following connectors:	

Check the following connectors: B-38, B-40	► Repai
ОК Т	
Check trouble symptom.	
<b>V</b> G	NG
Check the harness wire between the ECM and the transaxle control module connector.	► Repai
↓ОК	
Automatic transaxle control system may be defective. Follow the automatic transaxle troubleshooting. (Refer to GROUP 23A – Troubleshooting.)	
ОК	
Replace the ECM.	

Code No. P1720 Vehicle Speed Sensor Signal Line	Probable cause
<ul> <li>Background</li> <li>When a malfunction of the vehicle speed sensor is detected, the transaxle control module outputs a malfunction signal to the engine control module.</li> <li>Check Area, Judgment Criteria</li> <li>Vehicle speed sensor failure signal is input to the engine control module from the transaxle control module.</li> </ul>	<ul> <li>Vehicle speed sensor failed.</li> <li>Open or shorted output vehicle speed sensor circuit or loose connector</li> <li>Engine control module failed.</li> </ul>

Check the automatic transaxle diagnostic trouble codes. (Refer to GROUP 23A - Troubleshooting)

Code No. P1751 A/T Control Relay Malfunction	Probable cause
<ul> <li>Background</li> <li>When a malfunction of the A/T control relay is detected, the transaxle control module outputs a malfunction signal to the engine control module.</li> <li>Check Area, Judgment Criteria</li> <li>A/T control relay failure signal is input to the engine control module from the transaxle control module.</li> </ul>	<ul> <li>A/T control relay failed.</li> <li>Open or shorted output A/T control relay circuit, or loose connector</li> <li>Engine control module failed.</li> </ul>

Check the automatic transaxle diagnostic trouble codes. (Refer to GROUP 23A - Troubleshooting)

Code No. P1795 Throttle Position Input Circuit Malfunc- tion	Probable cause
<ul> <li>Background</li> <li>When a malfunction of the throttle position sensor is detected, the transaxle control module outputs a malfunction signal to the engine control module. Check Area, Judgment Criteria</li> <li>Throttle position sensor failure signal is input to the engine control module from the transaxle control module.</li> </ul>	<ul> <li>Throttle position sensor failed.</li> <li>Open or shorted input shaft speed sensor circuit, or loose connector</li> <li>Engine control module failed.</li> </ul>

Check the automatic transaxle diagnostic trouble codes. (Refer to GROUP 23A - Troubleshooting)

# INSPECTION CHART FOR TROUBLE SYMPTOMS

13100880651


111

.

Trouble symptom		Inspection procedure No.	Reference Page
Communication	Communication with all systems is not possible.	1	13B-92
with scan tool is mpossible. Communication with ECM only is not possible.		2	13B-92
Service Engine Soon/	The Service Engine Soon/Malfunction Indicator Lamp does not illuminate right after the ignition switch is turned to the ON position.	3	13B-93
Malfunction Indicator Lamp and related parts	The Service Engine Soon/Malfunction Indicator Lamp remains illuminated and never goes out.	4	13B-94
Starting	Cranks, won't start	5	13B-94
	Fires up and dies	6	13B-95
	Hard starting	7	13B-96
Idling stability	Unstable idle. (Rough idle, hunting)	8	13B-97
(Improper idling)	Idle speed is high. (Improper idle speed)	9	13B-98
	Idle speed is low. (Improper idle speed)	10	13B-99
Idling stability	When the engine is cold, it stalls at idle (Die out)	11	13B-100
(Engine stalls)	When the engine becomes hot, it stalls at idle. (Die out)	12	13B-101
The engine stalls when accelerating. (Pass out)		13	13B-102
	The engine stalls when decelerating.	14	13B-102
Driving	Hesitation, sag or stumble	15	13B-103
	Acceleration shock	16	13B-103
	Deceleration shock	17	13B-104
	Poor acceleration	18	13B-104
	Surge	19	13B-105
	Knocking	20	13B-105
Dieseling		21	13B-105
Too high CO and H	HC concentration when idling	22	13B-106
Generator output	voltage is low (approx. 12.3V)	23	13B-107
Fans (radiator fan,	A/C condenser fan) are inoperative	24	13B-107
IM240 test fail-	Transient, mass emission tailpipe test	25	13B-108
ure	Purge flow test of the evaporative canister	26	13B-109
	Pressure test of the evaporative system	27	13B-109

## PROBLEM SYMPTOMS TABLE (FOR YOUR INFORMATION)


- Items		Symptom
Starting	Won't start	The starter is used to crank the engine, but there is no combustion within the cylinders, and the engine won't start.
	Fires up and dies	There is combustion within the cylinders, but then the engine soon stalls.
	Hard starting	Engine starts after cranking a while.
Idling stability	Hunting	Engine speed doesn't remain constant; changes at idle.
	Rough idle	Usually, a judgement can be based upon the movement of the tachometer pointer, and the vibration transmitted to the steering wheel, shift lever, body, etc. This is called rough idle.
	Incorrect idle speed	The engine doesn't idle at the usual correct speed.
	Engine stall (Die out)	The engine stalls when the foot is taken from the accelerator pedal, regardless of whether the vehicle is moving or not.
	Engine stall (Pass out)	The engine stalls when the accelerator pedal is depressed or while it is being used.
Driving	Hesitation Sag	"Hesitation" is the delay in response of the vehicle speed (engine speed) that occurs when the accelerator is depressed in order to accelerate from the speed at which the vehicle is now traveling, or a temporary drop in vehicle speed (engine speed) during such acceleration. Serious hesitation is called "sag". (Refer to Fig. 1)
	Poor acceleration	Poor acceleration is inability to obtain an acceleration corresponding to the degree of throttle opening, even though acceleration is smooth, or the inability to reach maximum speed.
	Stumble	Engine speed increase is delayed when the accelerator pedal is initially depressed for acceleration. (Refer to Fig. 2)
	Shock	The feeling of a comparatively large impact or vibration when the engine is accelerated or decelerated.
	Surge	This is slight acceleration and deceleration feel usually felt during steady, light throttle cruise. Most notable under light loads.
	Knocking	A sharp sound like a hammer striking the cylinder walls during driving and which adversely affects driving.
Stopping	Run on ("Dieseling")	The condition in which the engine continues to run after the ignition switch is turned to OFF. Also called "Dieseling".

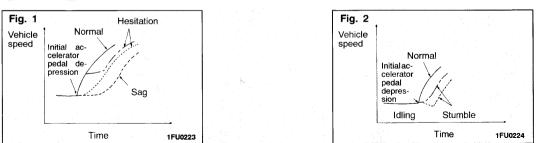

## INSPECTION PROCEDURE FOR TROUBLE SYMPTOMS


#### **INSPECTION PROCEDURE 1**

Communication with scan tool is not possible. (Communication with all systems is not possible.) The cause is probably a defect in the power supply system (including ground) for the on-board diagnostic test mode line.		Probable cause     Malfunction of the connector     Malfunction of the harness wire	
	Check the following connectors: B-24, B-60, B-66		

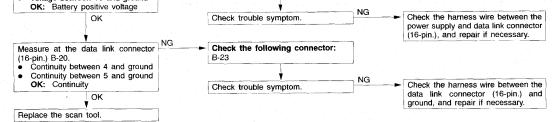


Scan tool communication with ECM is not possible.	Probable cause
One of the following causes may be suspected.   No power supply to ECM  Defective ground circuit of ECM  Defective ECM  Improper communication line between ECM and scan tool	<ul> <li>Malfunction of ECM power supply circuit</li> <li>Malfunction of the ECM</li> <li>Open circuit between ECM and data link connector</li> </ul>


		NG
Check the following B-36, B-38 and B-41		► Repair
· · · · · · · · · · · · · · · · · · ·	ок	
Check trouble sympt	om.	
	NG	
Check the harness v	wire between ECM and data link con	nnector.
	ок	
Check the power su (Refer to P.13B-109,	IPPIV system. INSPECTION PROCEDURE 28.)	NG ► Repair

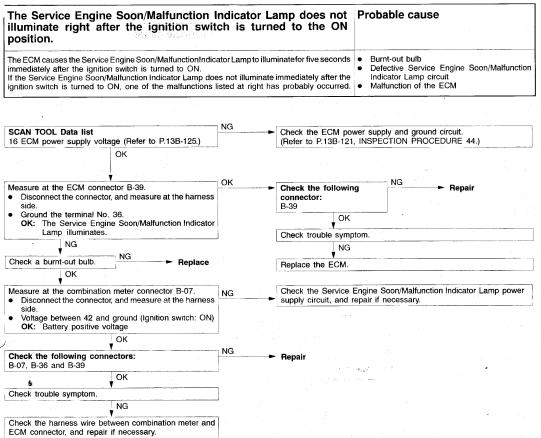

The Service Engine Soon/Malfunction Indicator Lamp remains illuminated and never goes out.	Probable cause
In cases such as the above, the cause is probably that the ECM is detecting a problem in a sensor or actuator, or that one of the malfunctions listed at right has occurred.	<ul> <li>Short-circuit between the Service Engine Soon/Malfunction Indicator Lamp and ECM</li> <li>Malfunction of the ECM</li> </ul>

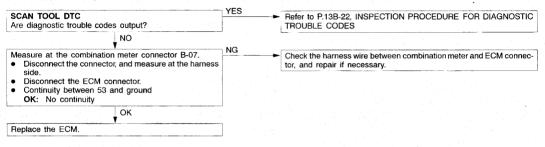

Cranks, won't start	Probable cause
In cases such as the above, the cause is probably no spark, or fuel delivery or fuel quality problems. In addition, foreign materials (water, kerosene, etc.) may be mixed with the fuel.	Malfunction of the ignition system     Malfunction of the fuel pump system     Malfunction of the injectors     Malfunction of the ECM     Foreign materials in fuel

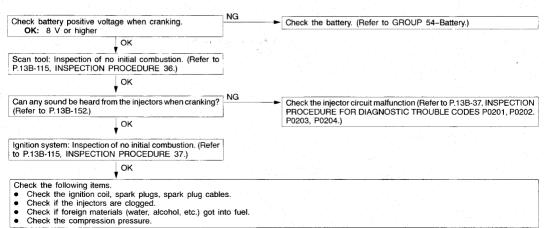

Fires up and dies.	perior algoria			Probable ca	ause
	the cause is usually improper ugs are generating sparks bu		re weak.		ession
		⊐NG			
Check battery positive voltage OK: 8 V or higher	ge when cranking.	NG	Check the battery. (F	lefer to GROUP	54-Battery.)
	ОК				
Scan tool: Check if incomple o P.13B-116, INSPECTION	ete combustion occurs. (Refer PROCEDURE 38.)				
	ок				
Can any sound be heard from Refer to P.13B-152.)	n the injectors when cranking?	NG	PROCEDURE FOR D		Refer to P.13B-37, INSPECTIO OUBLE CODES P0201, P020
	ок		P0203, P0204.)		
s starting good if the engine is bedal slightly depressed?	s cranked with the accelerator	YES	Check idle air contro for operation sound. (Refer to P.13B-152.)		Check the idle control system malfunction. (Refer to P.13B-81. INSPECTION
	NO		V OK	<b></b>	PROCEDURE FOR DIAG- NOSTIC TROUBLE CODE
			<ul> <li>Clean the throttl area. (Refer to P.13)</li> <li>Check and adjust SAS. (Refer to P.13)</li> </ul>	3B-142.) the fixed	P0505.)
Check the ignition timing who ok: 5° BTDC ± 3°	nen cranking.	NG	Check that the crank installed properly.	shaft position se	ensor and timing belt cover a
	ОК	-			

Check if foreign materials (water, alcohol, etc.) got into fuel.


.

Hard starting				Probable cause
	, the cause is probably that the g is not appropriate, or sufficie			Malfunction of the ignition system     Malfunction of the injector system     Inappropriate fuel quality     Poor compression
	and the second	·		
an Marine ya				
Check battery positive volta OK: 8 V or higher	age when cranking	NG	Check the battery. (	Refer to GROUP 54-Battery.)
	ок			
Scan tool: Check if incompl to P.13B-116, INSPECTION	ete combustion occurs. (Refer N PROCEDURE 38.)			
	OK ▼	-		
Can any sound be heard from the injectors when cranking? (Refer to P.13B-152.)		NG	PROCEDURE FOR	cuit malfunction. (Refer to P.13B-37, INSPECTION DIAGNOSTIC TROUBLE CODE P0201, P0202
an da san an an An ann an Anna Anna Anna	OK		P0203, P0204.)	Baran Antonio de la composición de la composi Antonio de la composición de la composic
Check the ignition timing w OK: 5° BTDC ± 3°	hen cranking.	NG	Check that the cran installed properly.	kshaft position sensor and timing belt cover are
	ОК	J		
<ul> <li>Check if the injectors a</li> <li>Check the compression</li> </ul>	spark plugs, spark plug cable are clogged.			

Unstable idle (Rough idle, hunting)			Probable cause
In cases such as the above, the cause is probably that idle air control motor or compression pressure is defectiv Because the range of possible causes is broad, inspection	/e.		<ul> <li>Malfunction of the ignition system</li> <li>Malfunction of air-fuel ratio control system</li> <li>Malfunction of the IAC system</li> <li>Malfunction of the evaporative emission purge solenoid system</li> <li>Poor compression</li> <li>Vacuum leak</li> <li>Malfunction of the EGR solenoid system</li> </ul>
	YES		
Were the battery terminals disconnected ?		After warming-up, le	t the engine idle for 10 minutes.
NO			
SCAN TOOL DTC Are diagnostic trouble codes output ?	YES	Refer to P.13B-22 TROUBLE CODES.	, INSPECTION CHART FOR DIAGNOSTIC
NO			
Does idle speed fluctuate excessively ?	YES		urs. (Refer to P.13B-116, INSPECTION PROCE-
NO		DURE 39.)	
Check the idle air control motor for operation sound. (Refer to P.13B-152.)	NG		Isystem malfunction. (Refer to P.13B-81, INSPEC- FOR DIAGNOSTIC TROUBLE CODE P0505.)
ок Т			
Check the injector for operation sound. (Refer to P.13B-152.)	J►	Check the injector cir PROCEDURE FOR P0203, P0204.)	cuit malfunction. (Refer to P.13B-37, INSPECTION DIAGNOSTIC TROUBLE CODES P0201, P0202,
Scan tool: Check if idle speed is unstable. (Refer to P.13B-117, INSPECTION PROCEDURE 40.)			
ο ο ο ο ο ο ο ο ο ο ο ο ο ο ο ο ο ο ο			
Check the ignition timing. (Refer to GROUP 11C – On-vehicle Service.)	NG	Check that the cran installed properly.	kshaft position sensor and timing belt cover are
<b>О</b> К		· · · · · · · · · · · · · · · · · · ·	
SCAN TOOL Actuator test 10 EGR solenoid. (Refer to P.13B-130.)	NG		gas recirculation solenoid malfunction. (Refer to ON PROCEDURE FOR DIAGNOSTIC TROUBLE
OK		000210400.)	
Check the following items. • Check the ignition coil, spark plugs, spark plug cable • Check the purge control system. • Check the compression pressure. • Check if foreign materials (water, alcohol, etc.) got in			

かわ んけいかた ひかつり さっぷ

Idle speed is high. (Improper idle speed)	Probable cause
In such cases as the above, the cause is probably that the intake air volume during idle is too great.	<ul> <li>Malfunction of the idle air control motor system</li> <li>Malfunction of the throttle body</li> </ul>

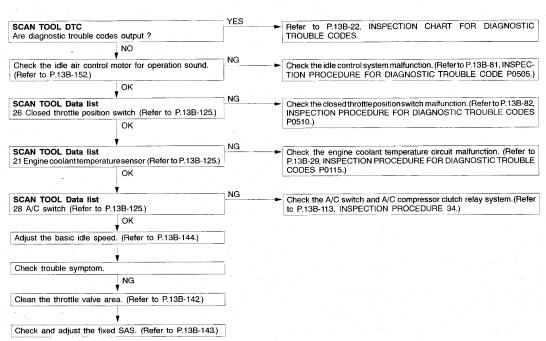


Idle speed is low. (Improper idle speed	d)	Probable cause
In cases such as the above, the cause is probably th too small.	at the intake air volume during idling is	<ul> <li>Malfunction of the idle air control motor system</li> <li>Malfunction of the throttle body</li> </ul>
SCAN TOOL DTC Are diagnostic trouble codes output ?	YES Refer to P.13B-22 TROUBLE CODES	
NO	· · · · · · · · · · · · · · · · · · ·	
Check the idle air control motor for operation sound. (Refer to P.13B-152.)		ol system malfunction. (Refer to P.13B-81, INSPEC- E FOR DIAGNOSTIC TROUBLE CODE P0505.)
ОК		
SCAN TOOL Data list 26 Closed throttle position switch (Refer to P.13B-125 OK		ottlepositionswitch malfunction. (Refer to P. 13B-82, CEDURE FOR DIAGNOSTIC TROUBLE CODES
and a second second As a second se		The second s
SCAN TOOL Data list 21 Engine coolant temperature sensor (Refer to P.13B-12)	5.) P.13B-29, INSPECT	coolant temperature circuit malfunction. (Refer to ION PROCEDURE FOR DIAGNOSTIC TROUBLE
ок	CODES P0115.)	
SCAN TOOL Data list 29 Park/neutral position switch (Refer to P.13B-125.)		witch-ST and park/neutral position switch system. 2, INSPECTION PROCEDURE 32.)
OK		
Adjust the basic idle speed. (Refer to P.13B-144.)		
Check trouble symptom.		
NG		

Clean the throttle valve area. (Refer to P.13B-142.)


巖

Check and adjust the fixed SAS. (Refer to P.13B-143.)

When the engine is cold, it stalls at idle. (Die out) In such cases as the above, the cause is probably that the air/fuel mixture is inappropriate when the engine is cold, or that the intake air volume is insufficient.			Probable cause	
			<ul> <li>Malfunction of the idle air control motor system</li> <li>Malfunction of the throttle body</li> <li>Malfunction of the injector system</li> <li>Malfunction of the ignition system</li> </ul>	
Were the battery terminals disconnected ?	YES	After warming-up, le	et the engine idle for 10 minutes.	
NO	VER			

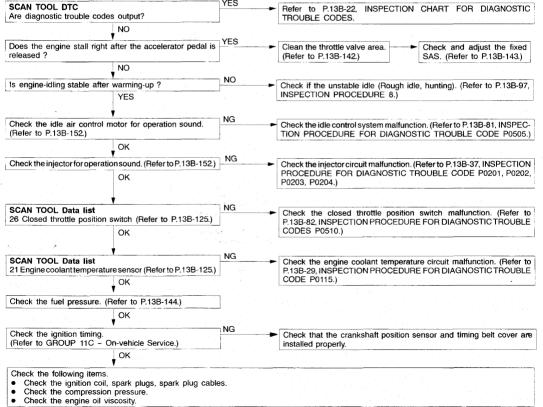

When the engine is hot, it stalls at idle! (Die out)	Probable cause
In cases such as the above, the cause is probably that ignition system, air/fuel mixture, idle air control motor or compression pressure is defective. In addition, if the engine suddenly stalls, the cause may also be a defective connector contact.	<ul> <li>Malfunction of air-fuel ratio control system</li> </ul>

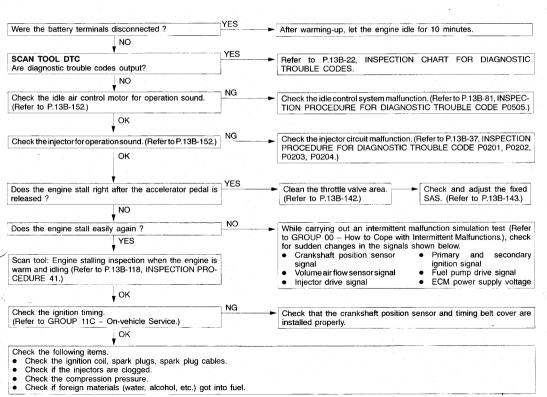

医机械精神的 计正示字件

The engine stalls when accelerating. (P	Probable cause		
In cases such as the above, the cause is probably misfiring due to a weak spark, or an inappropriate air/fuel mixture when the accelerator pedal is depressed.			<ul><li>Vacuum leak</li><li>Malfunction of the ignition system</li></ul>
SCAN TOOL DTC Are diagnostic trouble codes output ?	YES	Refer to P.13B-22 TROUBLE CODES.	INSPECTION CHART FOR DIAGNOSTIC
NO		the second second	
SCAN TOOL Actuator test 10 EGR solenoid (Refer to p.13B-130.)	.13B-130.) SPECTION		ation solenoid malfunction (Refer to P.13B-43, IN- DURE FOR DIAGNOSTIC TROUBLE CODE
ОК		10403.)	
<ul> <li>Check the following items.</li> <li>Check the ignition coil, spark plugs, spark plug cab</li> <li>Check if air was drawn into the intake system. Broken intake manifold gasket</li> <li>Broken or disconnected vacuum hose Improper operation of the PCV valve Broken air intake hose</li> </ul>	les.		

The engine stalls when decelerating.	Probable cause
In cases such as the above, the cause is probably that the intake air volume is insufficient due to a defective idle air control motor system.	Malfunction of the IAC system

Were the battery terminals disconnected ?	YES	After warming-up, let the engine idle for 10 minutes.	
NO	- -		
SCAN TOOL DTC Are diagnostic trouble codes output?	YES	Refer to P.13B-22, INSPECTION CHART FOR DIAGNOSTIC TROUBLE CODES.	
NO			
SCAN TOOL Data list 26 Closed throttle position switch (Refer to P.13B-125.)	NG	Check the closed throttle position switch malfunction. (Refer to P. 13B-82, INSPECTION PROCEDURE FOR DIAGNOSTIC TROUBLE CODES	
ОК		P0510.)	
SCAN TOOL Data list 14 Throttle position sensor (Refer to P.13B-125.)	NG	Check the throttle position circuit malfunction. (Refer to P.13B-30, IN     SPECTION PROCEDURE FOR DIAGNOSTIC TROUBLE CODE	
ок станата и стана		P0120.)	
SCAN TOOL Data list 55 Idle air control valve position sensor • Is the idle speed control motor position dropped to 0-2		Check the vehicle speed sensor malfunction (Refer to P.13B-80, IN- SPECTION PROCEDURE FOR DIAGNOSTIC TROUBLE CODE P0500.)	
steps when decelerating (engine rpm more than 1,000)?			
SCAN TOOL Actuator test 10 EGR solenoid (Refer to p.13B-130.)		Exhaust gas recirculation solenoid malfunction (Refer to P.13B-43, IN- SPECTION PROCEDURE FOR DIAGNOSTIC TROUBLE CODE P0403.)	
OK			
Check the following items. • Check the ignition coil, spark plugs, spark plug cable • Clean the throttle valve area. • Check and adjust the fixed SAS.	es.		

Hesitation, sag or stumbleset. Masson 9			Probable cause
In cases such as the above, the cause is probably the compression pressure is defective.	at ignition system	n, air/fuel mixture or	<ul> <li>Malfunction of the ignition system</li> <li>Malfunction of air-fuel ratio control system</li> <li>Malfunction of the fuel supply system</li> <li>Malfunction of the EGR solenoid system</li> <li>Poor compression</li> </ul>
SCAN TOOL DTC Are diagnostic trouble codes output ?	YES	Refer to P.13B-22 TROUBLE CODES	
NO	-		
Check the injectors for operation sound. (Refer to P.13B-152.)	NG		cuit malfunction. (Refer to P.13B-37, INSPECTION DIAGNOSTIC TROUBLE CODE P0201, P0202,
OK		F0203, F0204.)	
Check the ignition timing. (Refer to GROUP 11C - On-vehicle Service.)	NG	Check that the crar installed properly.	kshaft position sensor and timing belt cover are
↓ ОК			
Scan Tool: Check if hesitation, sag, stumble or poor accel- eration occur. (Refer to P.13B-119, INSPECTION PROCE- DURE 42.)			
ок	ni Ali		
Check the fuel pressure. (Refer to P.13B-144.)			
OK	-		


- Check the ignition coil, spark plugs, spark plug cables. Check the EGR system.
- ٠
- Check the compression pressure. Check the fuel filter or fuel line for clogging. ٠

Acceleration shock		al a sector			Probable cause	
In cases such as the above, the increase in the spark plug			nition leak	accompanying	• Malfunction of the ignition system	


SCAN TOOL DTC Are diagnostic trouble cod	es output ?	YES	, <b>-</b>	Refer to TROUBLE	INSPECTION	CHART	FOR	DIAGNOSTIC
	NO							
Check the following items. Check the ignition coil, Check for occurrence	spark plugs, spark plug cable	es.	3.					•


i av an himer i t

Deceleration shock	Probable cause		
Malfunction of the IAC system is suspected.	Malfunction of the IAC system		

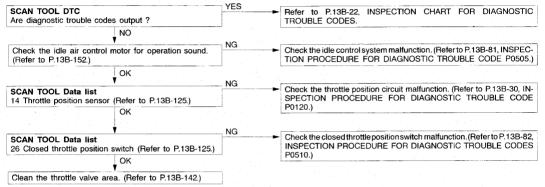

Poor acceleration	Probable cause
Defective ignition system, abnormal air-fuel ratio, poor compression pressure, etc. are suspected.	<ul> <li>Malfunction of the ignition system</li> <li>Malfunction of air-fuel ratio control system</li> <li>Malfunction of the fuel supply system</li> <li>Poor compression</li> <li>Clogged exhaust system</li> </ul>

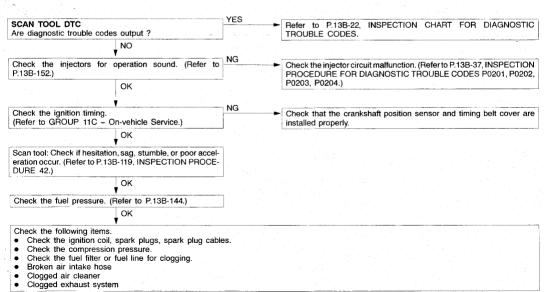

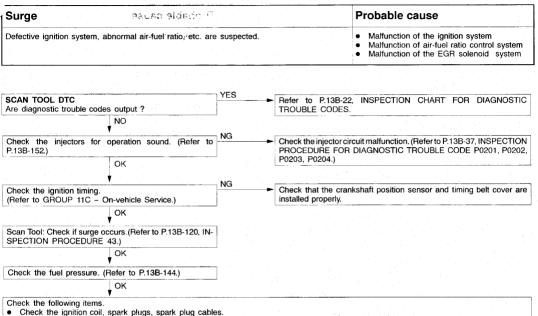

Check the EGR system.

#### **INSPECTION PROCEDURE 20**

Knocking	Probable cause
In cases such as the above, the cause is probably that the heat value of the spark plug is inappropriate or low fuel quality.	<ul> <li>Inappropriate heat value of the spark plug</li> </ul>

Check the following items.

Spark plugs

Fuel quality, octane level

Check if foreign materials (water, alcohol, etc.) got into fuel.

Dieseling	Probable cause
Fuel leakage from injectors is suspected, or carbon build up.	Fuel leakage from injectors

Check t	he inje	ctors for	fuel	leakage
---------	---------	-----------	------	---------

# 13B-106

# MFI <1.8L Engine> - Troubleshooting

### **INSPECTION PROCEDURE 22**


SE ERÚCALO


 $(\vec{a}_{ij})_{j \in I}$ 

•


Too high CO and HC concentration whe	en idling		Probable cause
Abnormal air-fuel ratio is suspected.			<ul> <li>Malfunction of the air-fuel ratio control system.</li> <li>Deteriorated catalyst</li> </ul>
	YES		
SCAN TOOL DTC Are diagnostic trouble codes output ?	•	Refer to P.13B-22, TROUBLE CODES.	INSPECTION CHART FOR DIAGNOSTIC
NO			
Check the ignition timing. (Refer to GROUP 11C - On-vehicle Service.)	NG	Check that the cran installed properly.	kshaft position sensor and timing belt cover are
ок		L	
SCAN TOOL Data list 21 Engine coolant temperature sensor. (Refer to P.13B-125.)	NG	Check the engine c P.13B-29, INSPECTI CODE P0115.)	oolant temperature circuit malfunction. (Refer to ON PROCEDURE FOR DIAGNOSTIC TROUBLE
ОК		· · · · · ·	
SCAN TOOL Data list 13 Intake air temperature sensor (Refer to P.13B-125.)	NG	INSPECTION PROC	emperature circuit malfunction. (Refer to P.13B-28, EDURE FOR DIAGNOSTIC TROUBLE CODE
OK		P0110.)	
SCAN TOOL Data list 25 Barometric pressure sensor (Refer to P.13B-125.)	NG	INSPECTION PROC	pressure circuit malfunction. (Refer to P.13B-27, EDURE FOR DIAGNOSTIC TROUBLE CODE
ОК		P0105.)	
SCAN TOOL Data list 59 Heated oxygen sensor (rear) (Refer to P.13B-125.) • Transaxle : 2nd gear <m t="">, L range <a t=""></a></m>	NG		sensor circuit malfunction (sensor 2). (Refer to ON PROCEDURE FOR DIAGNOSTIC TROUBLE
Driving with the throttle wide open OK: 600-1,000 mV			
OK	1. 1. 1. 1. 1. 1. 1. 1. 1. 1. 1. 1. 1. 1		
SCAN TOOL Data list 11 Heated oxygen sensor (front) (Refer to P.13B-125.) OK: 600-1,000 mV when racing suddenly	NG		ensor circuit malfunction (sensor 1). NSPECTION PROCEDURE FOR DIAGNOSTIC 0130.)
OK			
SCAN TOOL Data list 11 Heated oxygen sensor (front) (Refer to P.13B-125.)	<u>ок</u>	Replace the heated	oxygen sensor (front).
OK: Repeat 0-400 mV and 600-1,000 mV alternately when idling.		· · · · · · · · · · · · · · · · · · ·	
		Check trouble symp	· · · · · · · · · · · · · · · · · · ·
Check the fuel pressure. (Refer to P.13B-144.)			NG
↓ OK			
Check the following items. Check the injectors for operation sound. Check the injectors for fuel leakage. Check the ignition coil, spark plugs, spark plug cabl Check the compression pressure. Check the positive crankcase ventilation system. Check the evaporative emission control system. Check the EGR system.	es.		
Check trouble symptom.			

Replace the three-way catalytic converter.

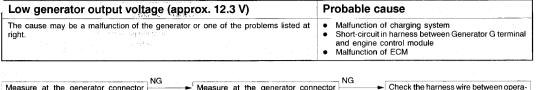

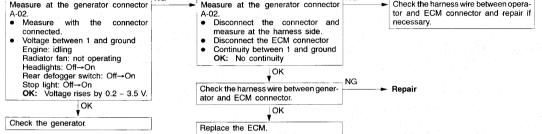

Fans (radiator fan, A/C condenser fan) are inoperative	Probable cause			
[Comment] The fan motor relay is controlled by the power transistor inside the PCM turning ON and OFF.	Malfunction of fan motor relay     Malfunction of fan motor     Malfunction of thermostat			
	<ul> <li>Improper connector contact, open circuit or short-circuited harness wire</li> <li>Malfunction of the PCM</li> </ul>			

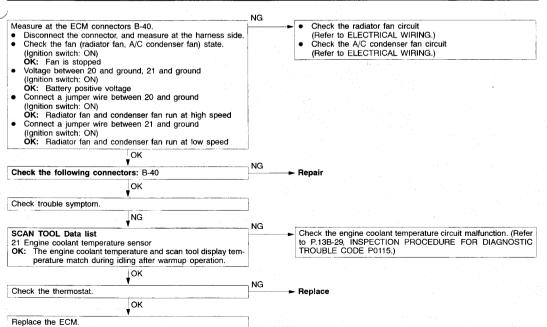

1 **2** . .

-47 Q

Transient, mass emission tailpipe test failure	•	Probable cause
The test is failed when the air-fuel ratio is not controlled to the due to the feedback control by O2 sensor signals, or when the insufficient, or the catalyst has deteriorated		Malfunction of the air-fuel ratio control system     Malfunction of the EGR system     Deteriorated catalyst
Has the engine been warmed up sufficiently before checking the	Suffici	ently warm up the engine, and then check the exhaust
<ul> <li>Check all vacuum hoses and connectors.</li> <li>Check electrical wires and connectors for obvious problems.</li> <li>Check the exhaust system for missing or damaged parts</li> </ul>	-► Repai	ir
SCAN TOOL DTC	Befor	to P.13B-22, INSPECTION CHART FOR DIAGNOSTIC
Are diagnostic trouble code output?		JBLE CODE.
NO Check the ignition timing. (Refer to GROUP 11C - On-vehicle Service.)		k that the crankshaft position sensor and timing belt cover stalled properly.
ок	NG	
SCAN TOOL Data list 21 Engine coolant temperature sensor (Refer to P.13B-125.) OK	► Checl (Refe TIC T	k the engine coolant temperature sensor circuit malfunction. r to P.13B-29, INSPECTION PROCEDURE FOR DIAGNOS- ROUBLE CODE P0115)
SCAN TOOL Data list 13 Intake air temperature sensor (Refer to P.13B-125.)	to P.1	k the intake air temperature sensor circuit malfunction. (Refer 13B-28, INSPECTION PROCEDURE FOR DIAGNOSTIC JBLE CODE P0110)
VOK SCAN TOOL Data list		k the barometric pressure sensor circuit malfunction. (Refer
25 Barometric pressure sensor (Refer to P.13B-125.)	TROL	13B-27, INSPECTION PROCEDURE FOR DIAGNOSTIC JBLE CODE P0105)
SCAN TOOL Data list 59 Heated oxygen sensor (rear) • Transaxle: 2nd gear <m t="">, L range <a t=""> • Drive with wide open throttle OK: 600 - 1000 mV</a></m>	to P.	k the oxygen sensor circuit malfunction (sensor 2). (Refer 13B-34, INSPECTION PROCEDURE FOR DIAGNOSTIC JBLE CODE P0136)
ОК		
SCAN TOOL Data list 11 Heated oxygen sensor (front) OK: 600 - 1000 mV when racing suddenly	to P.	k the oxygen sensor circuit malfunction (sensor 1). (Refer 13B-32, INSPECTION PROCEDURE FOR DIAGNOSTIC JBLE CODE P0130)
SCAN TOOL Data list 11 Heated oxygen sensor (front) OK: 0 - 400 mV ↔ 600 - 1000 mV alternately when idling and	Chec Syste	k the EGR system (Refer to GROUP 17 - Emission Control m.)
2500 r/min		OKNG
	. centra	ure the CO con- ation during idling. 0.5% or less
OK	-	
Check the following items.	OK Chec	k trouble symptom.
<ul> <li>Check the injectors for operation sound.</li> <li>Check the injectors for fuel leakage.</li> </ul>	1	NG
<ul> <li>Check the ignition coil, spark plugs, spark plug cables.</li> <li>Check the compression pressure.</li> </ul>	Repla	ace the three-way catalytic converter.
<ul> <li>Check the positive crankcase ventilation system.</li> <li>Check the evaporative emission control system.</li> </ul>		

Evaporative canister purge flow test failure	Probable cause
The test fails when the purge line or purge port is clogged or if the evaporative emission purge solenoid fails.	<ul> <li>Purge line or purge port is clogged</li> <li>Malfunction of evaporative emission purge solenoid</li> <li>Evaporative emission canister is clogged</li> </ul>

	YES				-
SCAN TOOL DTC Are diagnostic trouble code output?		Refer to P.13B-22, TROUBLE CODE.	INSPECTION	CHART FOR	DIAGNOSTIC
NO	-		1.00	•	
Check the evaporative emission purge system. (Refer to GROUP 17 – Emission Control System.)					

# **INSPECTION PROCEDURE 27**

Evaporative system pressure test failure				Probable cause			
The test fails if there is a leak from the fuel tank or vapor line	<b>3.</b>		<ul> <li>Improper tightening of fuel ta</li> <li>Broken seal in fuel tank, emission canister</li> </ul>				
Check the evaporative emission purge solenoid	NG	Replac	e				
(Refer to GROUP 17 - Emission Control System.)	· · · ·						
ок	NG						
Check the evaporative emission ventilation solenoid (Refer to GROUP 17 – Emission Control System.)		- Replac	ce				
OK							
<ul> <li>Check the following items.</li> <li>Check for leaks from the vapor line or evaporative emission canister.</li> <li>Check for leaks from the fuel tank.</li> </ul>							
Check for leaks from the fuel tank.				a da anti-tagan da sa			

# **INSPECTION PROCEDURE 28**

Power supply system			Probable cause
While the ignition switch is ON, battery power is supplied sensor, etc. through MFI relay.	to ECM, inject	tors, volume air flow	Malfunction of the MFI relay     Improper connector contact, open circuit or short-circuited harness wire     Disconnected ECM ground wire     Malfunction of the ECM
Check the MFI relay. (Refer to P.13B-148.)	NG	Replace	
Measure at the MFI relay connector B-32. • Disconnect the connector, and measure at the harness side. 1. Voltage between 4 and ground	1. NG	and repair if necess Check the followin	NG -
OK: Battery positive voltage		A-05	
Check the ECM power supply and ground circuit. (Refer to P.13B-121, INSPECTION PROCEDURE 44.)		Check trouble symp	tom.
		NG Check the harness tween ignition switch relay connector.	
		Y	witch (Refer to GROUP 54 - Ignition Switch.)

•

波 法转行的计

# **INSPECTION PROCEDURE 29**

Fuel pump system				Probable cause
The ECM turns the fuel pump relay ON when the engine is power to drive the fuel pump.	<ul> <li>Malfunction of the fuel pump relay</li> <li>Malfunction of the fuel pump</li> <li>Improper connector contact, open circuit short-circuited harness wire</li> <li>Malfunction of the ECM</li> </ul>			
	NO			
Check the fuel pump operation. (Refer to P.13B-142.)	NG			mp circuit. (Refer to P.13B-121, INSPECTIO
ОК			PROCEDURE 45.)	
Check the fuel pump relay. (Refer to P.13B-148.)	NG	•	Replace	
ок				
<ul> <li>Measure at the fuel pump relay connector C-123.</li> <li>Measure with the connector connected.</li> </ul>	NG	-	Check the fuel pu INSPECTION PROC	mp drive control circuit. (Refer to P.13B-12 DEDURE 46.)
<ul> <li>Voltage between 1 and ground</li> <li>SCAN TOOL Actuator test: Fuel pump drive OK Battery positive voltage</li> </ul>				
OK				
Check the harness wire between fuel pump relay connector and fuel pump connector, and repair if necessary.				

# **INSPECTION PROCEDURE 30**

Closed throttle position switch system			Probable cause
The closed throttle position switch inputs the condition of it is depressed or released (HIGH/LOW), to the ECM. The ECM controls the idle air control motor based on th		r pedal, i.e. whether	<ul> <li>Misadjustment of the accelerator pedal</li> <li>Misadjustment of the fixed SAS</li> <li>Misadjustment of the closed throttle position switch and throttle position sensor</li> <li>Improper connector contact, open circuit or short-circuited harness wire</li> <li>Malfunction of the ECM</li> </ul>
	NO		
Check the closed throttle position switch. (Refer to P.13B-149.)	NG ►	Replace the throttle	e position sensor (TPS).
OK			
<ul> <li>Measure at the throttle position sensor connector A-52.</li> <li>Disconnect the connector, and measure at the harness side.</li> <li>Voltage between 3 and ground (Ignition switch: ON)</li> </ul>	NG	Check the followin connector: B-37 OK	ng NG Repair
<ul><li>OK: 4 V or higher</li><li>Continuity between 4 and ground</li></ul>		Check trouble symp	ptom.
OK: Continuity		NG	
♦ NG ► Repair		Check the harness connector.	wire between ECM and throttle position sensor
connector: A-52		ок	NG
↓ OK		Replace the ECM.	Repair
Check trouble symptom.	]		
na <sup>*</sup> NG			
Replace the ECM.			


Ignition switch-ST systemase elosated	Probable cause
The ignition switch - ST inputs a HIGH signal to the ECM while the en The ECM controls fuel injection, etc. during starting based on this input	ngine is cranking. • Malfunction of ignition switch • Improper connector contact, open circuit or short-circuited harness wire • Malfunction of the ECM
Measure at the ECM connector B-37.  Disconnect the connector, and measure at the harness side.  NG	Check the following NG ► Repair connectors: A-05, A-16X, B-52
Voltage between 71 and ground (Ignitionswitch: START) OK: 8V or more     Continuity between 91 and ground     OK: Continuity	OK Check trouble symptom.
OK NG Repair connector:	VNG Check harness wire between the ECM and ignition switch connector.
B-37 OK Check trouble symptom.	OK Check the ignition switch. (Refer to GROUP 54 – Ignition Switch.)
	Check the harness wire between ECM connector (terminal No.91) and


ground, and repair if necesssary.

Replace the ECM.


- A4- 18- 18 - 3 - 19 - 19 - 19

# **INSPECTION PROCEDURE 32**

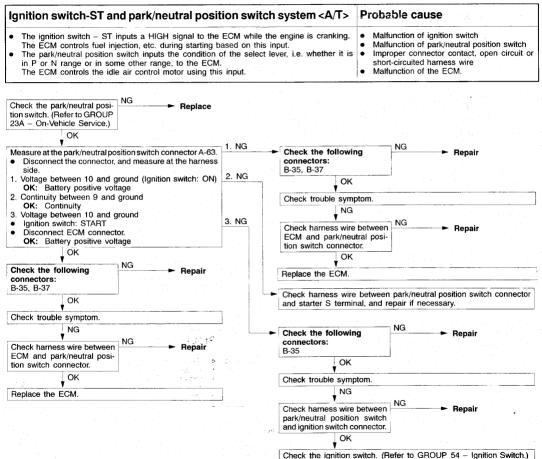


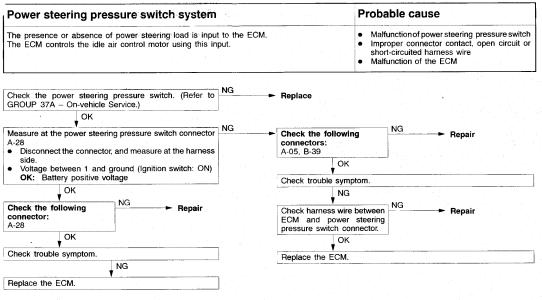


# **INSPECTION PROCEDURE 34**

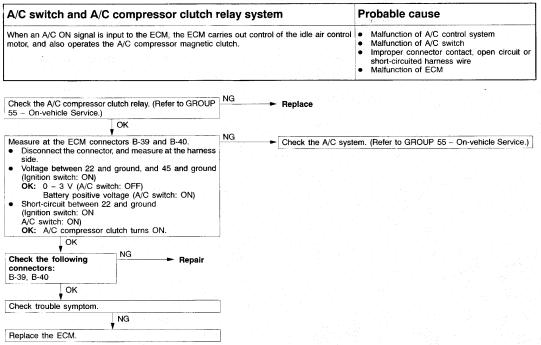


#### OF ERGEBONES

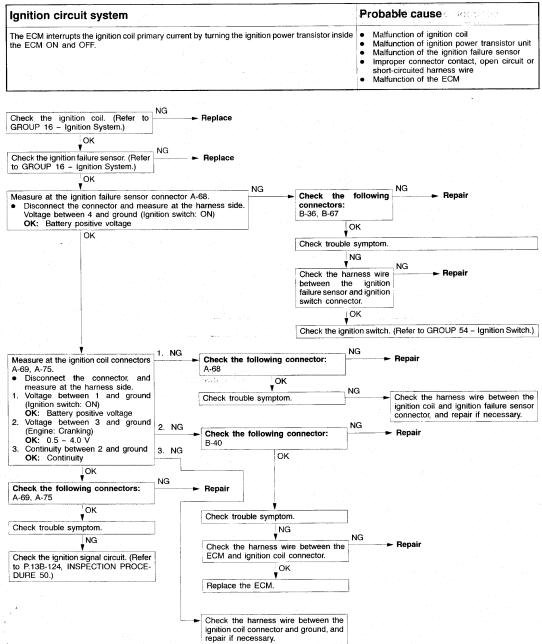

# Scan tool: Inspection of no initial combustion

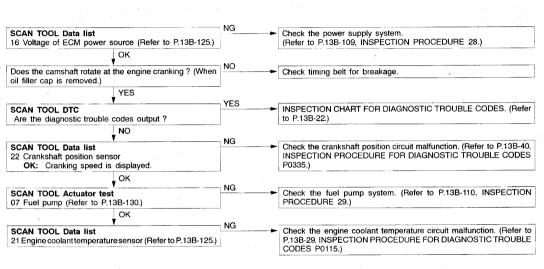


# **INSPECTION PROCEDURE 37**

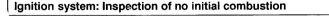


	NO	At the second
Measure at the ignition coil connectors A-69, A-75 • Measure with the connector connected. (Use test	NG	Check the ignition circuit system (Refer to P.13B-114, INSPECTION PROCEDURE 35.)
<ul> <li>harness: MB991348)</li> <li>Connect a primary voltage detection - type tachometer to terminal (1) of each connector in turn.</li> <li>OK: Each terminal displays a speed on the engine tachometer that is 1/2 of the cranking speed.</li> </ul>		
ОК		
Check the ignition timing when cranking. OK: 5° BTDC ±3°	NG	Check for the correct installation condition of crankshaft position sensor and timing belt cover.

#### Scan tool: Check if incomplete combustion occurs.

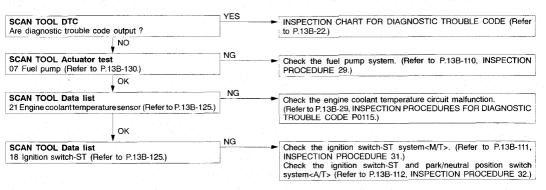


# **INSPECTION PROCEDURE 39**

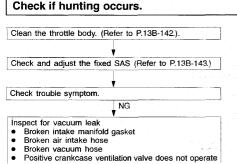

13B-117

# **INSPECTION PROCEDURE 40**

Scan tool: Check if idle speed is unstable.

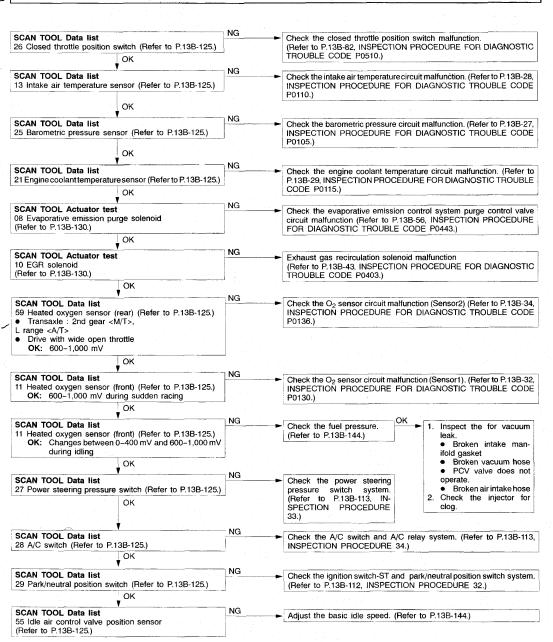


Scan tool: Engine stalling inspection when the engine is warm and idling.

# **INSPECTION PROCEDURE 41**

1 BAC

#### NG SCAN TOOL Data list Check the closed throttle position switch malfunction 26 Closed throttle position switch (Refer to P.13B-125.) (Refer to P.13B-82, INSPECTION PROCEDURE FOR DIAGNOSTIC TROUBLE CODE P0510.) OK NG SCAN TOOL Data list Check the intake air temperature circuit malfunction. (Refer to P.13B-28, 13 Intake air temperature sensor (Refer to P.13B-125.) INSPECTION PROCEDURE FOR DIAGNOSTIC TROUBLE CODE P0110.) OK NG SCAN TOOL Data list Check the barometric pressure circuit malfunction. (Refer to P.13B-27, 25 Barometric pressure sensor (Refer to P.13B-125.) INSPECTION PROCEDURE FOR DIAGNOSTIC TROUBLE CODE P0105.) OK NG SCAN TOOL Data list Check the engine coolant temperature circuit malfunction. (Refer to 21 Engine coolant temperature sensor (Refer to P.13B-125.) P.13B-29, INSPECTION PROCEDURE FOR DIAGNOSTIC CODE P0115.) OK NG SCAN TOOL Actuator test Exhaust gas recirculation solenoid malfunction 10 EGR solenoid (Refer to P.13B-43, INSPECTION PROCEDURE FOR DIAGNOSTIC (Refer to P.13B-130.) TROUBLE CODE P0403.) ↓ок NG SCAN TOOL Data list Check the O<sub>2</sub> sensor circuit malfunction (Sensor2) (Refer to P.13B-34, 59 Heated oxygen sensor (rear) (Refer to P.13B-125.) INSPECTION PROCEDURE FOR DIAGNOSTIC TROUBLE CODE Transaxle : 2nd gear <M/T>, P0136.) L range <A/T> Drive with wide open throttle OK: 600-1,000 mV OK NG SCAN TOOL Data list Check the O<sub>2</sub> sensor circuit malfunction (Sensor1), (Refer to P.13B-32, 11 Heated oxygen sensor (front) (Refer to P.13B-125.) INSPECTION PROCEDURE FOR DIAGNOSTIC TROUBLE CODE OK: Changes between 600-1,000 mV during sudden P0130.) racing OK NG OK SCAN TOOL Data list Check the fuel pressure. 1. Inspect for vacuum leak (Refer to P.13B-144.) 11 Heated oxygen sensor (front) (Refer to P.13B-125.) Broken intake man-OK: Changes between 0-400 mV and ifold gasket Broken vacuum hose 600-1.000 mV during idling PCV valve does not OK operate. NG Broken air intake hose SCAN TOOL Data list Check the power steering 2. Check the injector for pressure system. 27 Power steering pressure switch (Refer to P.13B-125.) switch cloa. (Refer to P.13B-113, IN-OK SPECTION PROCEDURE 33.) NG SCAN TOOL Data list Check the A/C switch and A/C compressor clutch relay system. (Refer 28 A/C switch (Refer to P.13B-125.) to P.13B-113, INSPECTION PROCEDURE 34.) OK NG SCAN TOOL Data list Check the ignition switch-ST and park/neutral position switch system. 29 Park/neutral position switch (Refer to P.13B-125.) (Refer to P.13B-112, INSPECTION PROCEDURE 32.) OK NG SCAN TOOL Data list Check the volume air flow circuit malfunction. (Refer to P.13B-26, 34 Volume air flow sensor reset signal (Refer to P.13B-125.) INSPECTION PROCEDURE FOR DIAGNOSTIC TROUBLE CODE P0100.) OK NG SCAN TOOL Data list Adjust the basic idle speed. (Refer to P.13B-144.) 55 Idle air control valve position sensor (Refer to P.13B-125.)


# Scan tool: Check if hesitation, sag. stumble, or poor acceleration occurs.

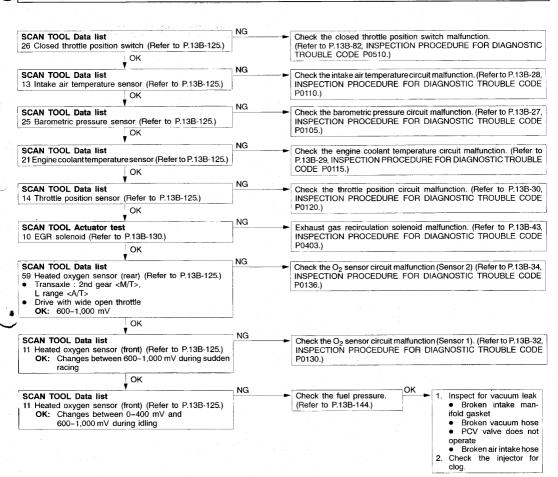


SN BRYCELOCCO V

Scan tool: Check if surge occurs.


in one besitive statistic and enough

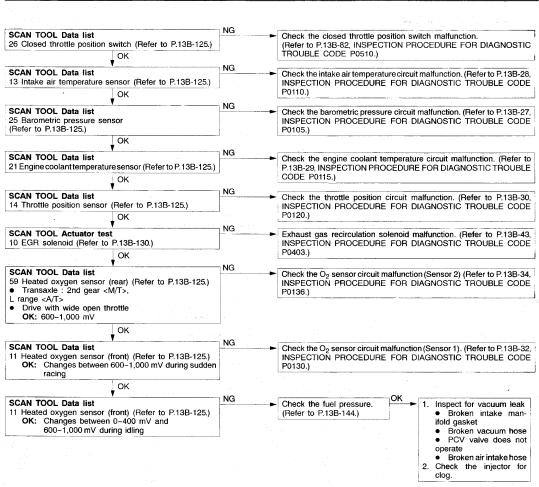

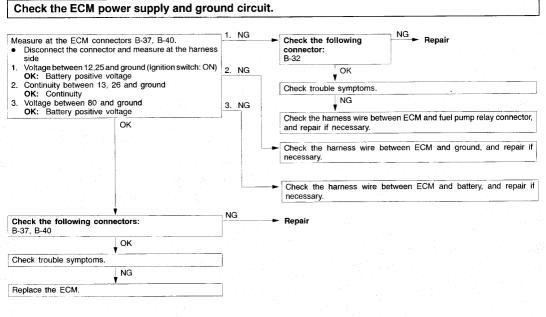

# **INSPECTION PROCEDURE 45**


Check fuel pump circuit.

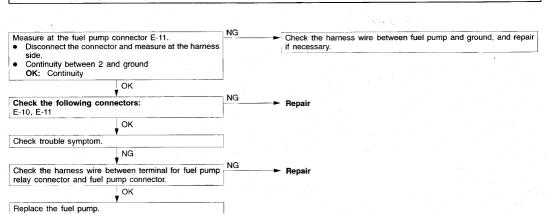


#### TA BRUCEDORG MONT


### Check the fuel pump drive control circuit.

allere ar Colvesses social en alle

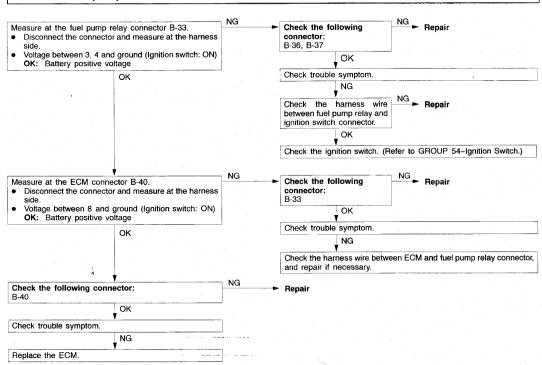

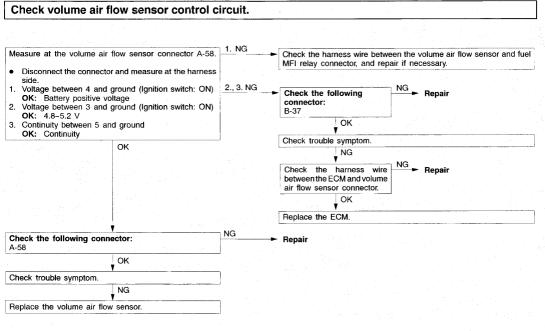


# **INSPECTION PROCEDURE 48**

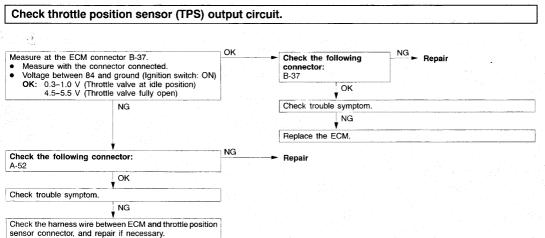

- A MAR BOMBRONSE FR

# Check injector control circuit

- Period and the State (

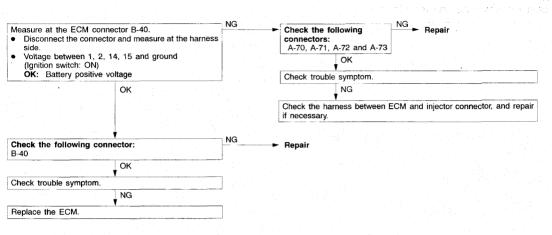

# **INSPECTION PROCEDURE 50**

# Check ignition signal circuit.

			· · · · · · · · · · · · · · · · · · ·	1. NG					
<ul> <li>Disconne</li> </ul>	Measure at the ignition failure sensor connector A-68. <ul> <li>Disconnect the connector and measure at the harness side</li> <li>Voltage between 2 and ground (Ignition switch: ON)</li> <li>OK: 4V or more</li> </ul> 2. Continuity between 1 and ground		e at the harness side		There is an open or short-circuit the ig of the ignition failure sensor, so check				
<b>OK</b> : 4V			2. NG						
<b>ОК</b> : Со						arness wire bet repair if necess		e ignition fai	lure sensor and
	OK V			NG			NG	i a c	
<ul> <li>Measure</li> <li>Voltage</li> <li>(Engine:</li> </ul>	with the between 5	connector B-38. connector connected 8 and ground or 3,000 r/min)			<ul> <li>Check the f connectors: A-68, B-38</li> </ul>	ollowing OK	•	Repair	
	ОК				Check troub	e symptom.	-		
Replace the	ECM.			]		NG			
						harness wire ECM and the re sensor con-	NG	Repair	
						ок			
					Replace the	ignition failure s	ensor.		

# DATA LIST REFERENCE TABLE

mode.

The scan tool (MUT-II) has two operation modes: the general scan mode and the scan tool (MUT-II)

The data list which can be read in either mode is shown in the table below.

Item No.	Inspection item	General scan tool	Scan tool (MUT-II)
		model	mode
11	Heated oxygen sensor (Front)	×	×
12	Volume air flow sensor	×	× .
13	Intake air temperature sensor	n X san	×
14	Throttle position sensor	×	×
16	Power supply voltage	-	×
18	Cranking signal (Ignition switch-ST)		×
21	Engine coolant temperature sensor	×	×
22	Crankshaft position sensor	×	×
24	Vehicle speed sensor	×	-
25	Barometric pressure sensor	-	×
26	Closed throttle position switch	-	×
27	Power steering pressure switch	<b>-</b>	×
28	A/C switch	-	×
29	Park/Neutral position switch <a t=""></a>	-	×
41	Injectors	-	×
44	Ignition coils and ignition power transistor	-	×
45	Idle air control position	-	×
49	A/C compressor clutch relay		×
59	Heated oxygen sensor (Rear)	×	×
73	Fuel tank differential pressure sensor	×	×
81	Long-term fuel compensation	×	-
82	Short-term fuel compensation	×	
87	Calculation load	×	-
88	Fuel control condition	×	
95	Manifold differential pressure sensor	×	×

Caution

1. When shifting the select lever to D range, the brakes should be applied so that the vehicle does not move forward.

2. Driving tests always require another person. 13100890555

# 13B-126

# MFI <1.8L Engine> - Troubleshooting> 1934

# NOTES FOR DATA LIST ITEM BELOW

21:14:1 2000.230 \*1: In a new vehicle [driven approximately 500 km (300 mile) or less], the volume air flow sensor output frequency is sometimes 10% higher than the standard frequency.

\*2: When idling to warm up from an engine coolant temperature of approx. -20°C (-4°F), if the idling speed is lower than the standard value even when the IAC motor is fully opened, the air volume limiter built in the throttle body could be defective.

\*3: The closed throttle position switch normally turns off when the voltage of the throttle position sensor is 50 -100mV higher than the voltage at the idle position. If the closed throttle position switch turns back on after the throttle position sensor voltage has risen by 100mV and the throttle valve has opened, the closed throttle position switch and the throttle position sensor need to be adjusted.

- \*4: The injector drive time represents the time when the cranking speed is at 250 r/min or below when the power supply voltage is 11 V.
- **\***5. In a new vehicle [driven approximately 500 km (300 mile) or less], the injector drive time is sometimes 10% longer than the standard time.
- **\***6. In a new vehicle [driven approximately 500 km (300 mile) or less], the servo valve position is sometimes 20 steps greater than the standard value.

ltem No.	Inspection item	Inspection contents		Normal condition	Inspection procedure No.	Reference page
11	Heated oxygen sensor (front)	Engine: Warm (Air/fuel mixture is made leaner when decelerating, and is	When at 4,000 r/min, engine is suddenly decelerated	200 mV or less	Code No. P0130	P.13B-32
	(ironiy	made richer when racing.)	When engine is sud- denly raced	600–1,000 mV		
		Engine: Warm (The heated oxygen sensor signal is used to check the air/fuel	Engine is idling	400 mV or less ↔ 600–1,000 mV (Changes)		
		mixture ratio, and control condition is and also checked by the ECM.)	<b>2,500 r/min</b> O			
12	Volume air flow sensor (Mass air	<ul> <li>Engine coolant () temperature: 80–95°C</li> <li>(170–202°E)</li> </ul>	Engine is idling	18 – 44 Hz (1.5 – 3.7 g/s)	-	-
	flow rate)*1	<ul> <li>(176-203°F)</li> <li>Lights, electric cooling fan and all accessories:</li> </ul>	2,500 r/min	68 – 108 Hz (5.8 – 9.4 g/s)		
		<ul> <li>OFF</li> <li>Transaxle: Neu- tral (A/T: P range)</li> </ul>	Engine is raced	Frequency in- creases in re- sponse to racing		
13	Intake air tempera- ture sensor	Ignition switch: ON or with engine run- ning	When intake air tem- perature is -20°C (-4°F)	–20°C (−4°F)	Code No. P0110	P.13B-28
			When intake air tem- perature is 0°C(32°F)	0°C(32°F)		
			When intake air tem- perature is 20°C(68°F)	20°C (68°F)		
			When intake air tem- perature is 40°C (104°F)	40°C(104°F)		
			When intake air tem- perature is 80°C(176°F)	80°C(176°F)		

# MFI <1.8L Engine> - Troubleshooting

13B-127

r		· ·				
Item No.	Inspection item	Inspection contents		Normal condition	Inspection procedure No.	Reference page
14	Throttle position	Ignition switch: ON	Set to idle position	300–1,000 mV (6–20%)	Code No.	P.13B-30
	sensor		Gradually open	Increases in pro- portion to throttle opening angle	P0120	
÷			Open fully	4,500-5,500 mV (80-100%)		na da serie Antonio da serie Antonio da serie da se
16	Power supply voltage	Ignition switch: ON		Battery positive voltage	Proce- dure No. 28	P.13B-109
18	Cranking signal (ignition	Ignition switch: ON	Engine: Stopped	OFF	Proce- dure No. 31 <m t=""></m>	P.13B-111 <m t=""> P.13B-112</m>
	switch-ST)		Engine: Cranking	ON	Proce- dure No. 32 <a t=""></a>	<a t=""></a>
21	Engine coolant tempera-	Ignition switch: ON or with engine run- ning	When engine coolant temperature is -20°C (-4°F)	–20°C (–4°F)	Code No. 0115	P.13B-29
	ture sensor		When engine coolant temperature is 0°C (32°F)	0°C (32°F)		
			When engine coolant temperature is 20°C (68°F)	20°C (68°F)		
			When engine coolant temperature is 40°C (104°F)	40°C (104°F)		
14.85 <sup>-1</sup> 14 14			When engine coolant temperature is 80°C (176°F)	80°C (176°F)		
22	Crankshaft position sensor* <sup>2</sup>	<ul> <li>Engine: Crank- ing</li> <li>Tachometer: Connected</li> </ul>	Compare the rpm of the tachometer with the one of the scan tool.	Identical	Code N0. P0335	P.13B-40
		<ul> <li>Engine: Idling</li> <li>Closed throttle position switch: ON</li> </ul>	When engine coolant temperature is -20°C (-4°F)	1400 – 1600 r/min		
			When engine coolant temperature is 0°C (32°F)	1300 – 1500 r/min		
			When engine coolant temperature is 20°C (68°F)	1250 – 1450 r/min		
			When engine coolant temperature is 40°C (104°F)	1000 – 1200 r/min		
			When engine coolant temperature is 80°C (176°F)	600 – 800 r/min		
24	Vehicle speed sen-	Drive at 40 km/h (25 m	iles/h)	Approx. 40 km/h	Code No. P0500	P.13B-80

13B-128

MFI <1.8L Engine> - Troubleshooting> 1344

•

ltem No.	Inspection item	Inspection contents		Normal condition	Inspection procedure	Reference page
					No.	·
25	Barometic pressure	Ignition switch: ON	At altitude of 0 m (0 ft.)	101 kPa 11660 543 	Code N0.	P.13B-27
	sensor		At altitude of 600m (1,969 ft.)	95 kPa	P0105	
			At altitude of 1,200 m(3,937ft.)	88 kPa	•	
			At altitude of 1,800 m (5,906 ft.)	81 kPa		
26	Closed throttle	Ignition switch: ON Check by operating	Throttle valve: Set to idle position	ON	Code N0. P0510	P.13B-82
	position switch	accelerator pedal re- peatedly	Throttle valve: Slightly open	OFF* <sup>3</sup>		
27	Power steering	Engine: Idling	Steering wheel stationary	OFF	Code N0. P0551	P.13B-83
	pressure switch		Steering wheel turning	ON		
28	A/C switch	Engine: Idling (When A/C switch is	A/C switch: OFF	OFF	Proce- dure No.	P.13B-113
		ON, A/C compressor should be operating.)	A/C switch: ON	ON	34	
29	Park/Neu- tral positon	Ignition switch: ON	P or N	P or N	Proce- dure No.	P.13B-112
	switch <a t=""></a>	an a	D, 2, L or R	D, 2, L or R	32	
41	Injectors *4	Engine: Cranking	When engine coolant temperature is 0°C (32°F) (injection is carried out for all cylin- ders simultaneously)	15 – 22 ms	-	-
			When engine coolant temperature is 20°C (68°F)	31 – 46 ms		
			When engine coolant temperature is 80°C (176°F)	7.2 – 10.8 ms		
	Injectors *5	<ul> <li>Engine coolant temperature: 80–95°C</li> </ul>	Engine is idling	2.0 – 3.2 ms		
		<ul> <li>(176-203°F)</li> <li>Lights, electric cooling fan and all accessories;</li> </ul>	2,500 r/min	1.7 – 2.9 ms		
		<ul> <li>OFF</li> <li>Transaxle: Neu- tral (A/T : P range)</li> </ul>	When engine is sud- denly raced	Increases		
44	Ignition coils and ignition power	<ul> <li>Engine: After having warmed up</li> <li>Timing light is set.</li> </ul>	Engine is idling	0 – 13 °BTDC	-	-
	transistors	(The timing light is set in order to check actual ignition timing.)	2,500 r/min	22 – 42 °BTDC		

# MFI <1.8L Engine> - Troubleshooting

13B-129

r						
Item No.	Inspection item	Inspection contents		Normal condition	Inspection procedure No.	Reference page
49	A/C com- pressor clutch relay	Engine: After warm up /Engine is idling	A/C switch: OFF	OFF (Compres- sor clutch is not operating)	Proce- dure No. 34	P.13B-113
			A/C switch: ON	ON (Compressor clutch is operat- ing)		
45	Idle air control (stepper) position <sup>*6</sup>	<ul> <li>Engine coolant temperature: 80 – 95°C (176–203°F)</li> <li>Lights, electric cooling fan and</li> </ul>	A/C switch: OFF	Increases by 2-25 steps	-	
		all accessories: OFF Transaxle: Neu- tral (A/T : P range) Closed throttle position switch:	A/C switch: OFF → ON	Increases by 10-70 steps		
		ON Engine: Idling (When A/C switch is ON, A/C compressor should be oper- ating)	<ul> <li>A/C switch: OFF</li> <li>Select lever: N range → D range</li> </ul>	Increases by 5–50 steps		
59	Heated oxygen sensor (rear)	<ul> <li>Transaxle: 2nd gear <m t=""> L range <a t=""></a></m></li> <li>Drive with wide open throttle</li> </ul>	3,500 r/min	600–1,000 mV	Code No. P0136	P.13B-34
73	Fuel tank differential pressure sensor	<ul> <li>Ignition switch: Of</li> <li>Fuel tank filler tub</li> </ul>		-3.3 - 3.3 kPa	-	
81	Long-term fuel com- pensation	Engine: Warm, 2,500 r/ (during closed loop)	min without any load	-12.5 - +12.5 %	Code No. P0170	P.13B-36
82	Short-term fuel com- pensation	Engine: Warm, 2,500 r/ (during closed loop)	min without any load	-17-+17 %	Code No. P0170	P.13B-36
87	Calculation load value	Engine: Warm	Engine is idling 2,500 r/min	12 – 30 % 13 – 21 %	-	-
88	Fuel control condition	Engine: Warm	2,500 r/min When engine is sud- denly raced	Closed loop Open loop – drive condition	Code No. P0125	P.13B-31
95	Manifold dif- ferential pressure sensor	Engine: Warm, idle		28 – 42 kPa	Code No. P1400	P.13B-86

# ACTUATOR TEST REFERENCE TABLE

JOHTHOD RULEAR BAT 13100900630

Item No.	Drive con- tents	Inspection item	Inspection con	tents	Normal condition	Inspec-	Reference page
110.	101115		n n h de			cedure No.	hage
01	Injectors	Cut fuel to No. 1 injector	Engine: Warn (Cut the fuel si	upply to	Idle speed drops equally for each	Code No. P0201,	P.13B-37
02		Cut fuel to No. 2 injector	each injector in check cylinder don't affect idli	s which	injector	P0202, P0203,	
03		Cut fuel to No. 3 injector				P0204,	
04		Cut fuel to No. 4 injector					
07	Fuel pump	Fuel pump op- erates and fuel is recirculated.	<ul> <li>Engine: Cranking</li> <li>Fuel pump: Acti- vated</li> <li>Inspect accord-</li> </ul>	Pinch the return hose with fingers to feel the pulse of the fuel being recir- culated.	Pulse is felt.	Proce- dure No. 29	P.13B-110
			ing to both the above condi- tions.	Listen near the fuel tank for the sound of fuel pump op- eration.	Typical electric fuel pump whine.		
08	Evaporative emission purge solenoid	Solenoid valve turns from OFF to ON.	Ignition switch	: ON	Clicks when solenoid valve is driven.	Code No. P0443	P.13B-56
10	EGR solenoid	Solenoid valve turns from OFF to ON.	Ignition switch	: ON	Clicks when solenoid valve is driven.	Code No. P0403	P.13B-43
17	Basic ignition timing	Set to ignition timing adjust- ment mode	Engine: Idle Timing light is	set	5°BTDC	_	
20	Radiator fan (Hi) Condenser fan (Hi)	Drive the fan motors (radiator and condens- er).	Ignition switch A/C switch: Ol		Fan motor oper- ates at high speed.	Proce- dure No. 24	P.13B-107
21	Radiator fan (Hi) Condenser fan (Low)	Drive the fan motors (radiator and condens- er).	Ignition switch A/C switch: O		Fan motor oper- ates at low speed.	Proce- dure No. 24	P.13B-107
29	Evaporative emission ventilation solenoid	Solenoid valve turns from OFF to ON.	Ignition switch	: ON	Clicks when sole- noid valve is driv- en.	Code No. P0446	P.13B-57

# CHECK AT THE ENGINE CONTROL MODULE (ECM) TERMINAL VOLTAGE CHECK CHART

Engine Control Module (ECM) Connector Terminal Arrangement

	4 81
യംതത്തത്തത്തെ രരെസസ പ്രക്ഷക്ഷക്ഷ ഗഗഗ പ്രാത്തത്തത്തെ തന്നും പ്രക്യം ഗപ്രം പ്രാത്തം ഗപ്രാത്തം നിന്നും	92



Terminal No.	Check item	Check condition (Engine condition)	Normal condition
1	No. 1 injector	While engine is idling after having warmed up, suddenly depress the drops slightly	
14	No. 2 injector	accelerator pedal.	urops siignity
2	No. 3 injector		
15	No. 4 injector		
4	Stepper motor coil <a1></a1>	Engine: Soon after the warmed up	$B \leftrightarrow 0 V$
17	Stepper motor coil <a2></a2>	engine is started	(Changes repeatedly)
5	Stepper motor coil <b1></b1>		
18	Stepper motor coil <b2></b2>		
6	EGR solenoid	Ignition switch: ON	B +
		While engine is idling, suddenly depress the accelerator pedal.	From B +, momentarily drops
8	Fuel pump relay	Ignition switch: ON	B +
		Engine: Idle speed	0 – 3 V
9	Evaporative emission	Ignition switch: ON	B +
	purge solenoid	Running at 3,000 r/min while engine is warming up after having been started.	0 – 3 V
10	Ignition coil – No. 1, No. 4 (Ignition power transistor)	Engine r/min: 3,000 r/min	0.3 – 3.0 V
23	Ignition coil – No. 2,		
	No. 3 (Ignition power transistor)		
12	Power supply	Ignition switch: ON	B +
25			

13B-131

13100920568

13B-132

MFI <1.8L Engine> - Troubleshooting> 1344

٠

Terminal No.	Check item	Check condition (En	gine condition) ြ	Normal condition (492) (492) 5
19	Volume air flow sensor	Engine: Idle speed	i se solitagi	0eshVe evisoese
	reset signal	Engine r/min: 3,000	r/min an electronic a	6 – 9 V
20	Condenser fan motor relay	Condenser fan is not [Engine coolant temp (194°F) or less]		B+
		Condenser fan is op [Engine coolant tem (221°F) or more]		0 – 3 V
21	Radiator fan motor relay	Radiator fan is not o [Engine coolant temp (194°F) or less]		B+
		Radiator fan is opera [Engine coolant tem] 105°C (194 - 221°F	perature is 90 -	0 – 3 V
22	A/C relay	<ul> <li>Engine: Idle speed</li> <li>A/C switch: OFF → ON (A/C compressor is operating)</li> </ul>		B + or momentarily 6 V or more → 0 - 3 V
33	Generator G terminal	<ul> <li>Engine: Warm, idle (radiator fan: OFF)</li> <li>Headlamp: OFF to ON</li> <li>Rear defogger switch: OFF to ON</li> <li>Stop light: OFF to ON</li> </ul>		Voltage rises.
41	Generator FR terminal	<ul> <li>Engine: Warm, idle (radiator fan: OFF)</li> <li>Headlamp: OFF to ON</li> <li>Rear defogger switch: OFF to ON</li> <li>Stop light: OFF to ON</li> </ul>		Voltage falls.
36	Service Engine Soon/Malfunction Indicator Lamp	Ignition switch: OFF	→ ON	$0 - 3 V \rightarrow 9 - 13 V$ (After several seconds have elapsed)
37	Power steering pressure switch	Engine: Idling after warming up	When steering wheel is stationary	B+
			When steering wheel is turned	0 – 3 V
38	MFI relay (Power supply)	Ignition switch: OFF		B+
	(, ower suppry)	Ignition switch: ON		0 – 3 V
45	A/C switch	Engine: Idle speed	Turn the A/C switch OFF	0 - 3 V
		Turn the A/C switch ON (A/C compressor is operating)		B +
54	Heated oxygen sensor heater ( Rear)	Engine: Idling after v	varming up	0 – 3 V
	nouter (near)	Engine r/min: 5,000	r/min	B+

# MFI <1.8L Engine> - Troubleshooting

13B-133

Terminal No.	Check item to the the state	Check condition (En	gine condition)	Normal condition
55	Evaporative emission ventilation solenoid	Ignition switch: ON	Ignition switch: ON	
		After the engine has warmed up, drive the vehicle at a constant speed 88 km/h (55 mph) (OBD-II monitoring conditions).		Momentarily 0 – 3 V
58	Engine ignition signal	Engine r/min: 3,000	r/min	0.3 – 3.0 V
60 .	Heated oxygen sensor	Engine: Idling after v	varming up	0 – 3 V
	heater (Front)	Engine r/min: 5,000r	/min.	B+
61	Fuel tank differential pressure sensor	Engine: Idle		1.2 – 3.8 V
71	Ignition switch - ST	Engine: Cranking		8 V or more
72	Intake air temperature sensor	Ignition switch: ON	When intake air temperature is 0°C (32°F)	3.2 - 3.8 V
			When intake air temperature is 20°C (68°F)	2.3 – 2.9 V
*			When intake air temperature is 40°C (104°F)	1.5 – 2.1 V
			When intake air temperature is 80°C (176°F) ,	0.4 – 1.0 V
73 ,	Manifold differential	Engine: Idle	p <b>t</b>	0.8 – 2.4 V
	pressure sensor	<ul> <li>Engine: Idle</li> <li>Suddenly depropedal</li> </ul>	ess the accelerator	rises from 0.8 – 2.4 V suddenly
75	Heated oxygen sensor (Rear)		M/T>, L range <a t=""> e throttle open wide r/min or more</a>	0.6 – 1.0 V
76	Heated oxygen sensor (Front)	Engine: Running at 2,500 r/min after warmed up (Check using a digital type voltmeter)		0 ↔ 0.8V (Changes repeatedly)
80	Backup power supply	Ignition switch: OFF		В+
81	Sensor impressed voltage	Ignition switch: ON		4.5 – 5.5 V
82	Ignition switch – IG	Ignition switch: ON		B+

13B-134

MFI <1.8L Engine> - Troubleshooting

•

Terminal No.	Check item	Check condition (En	gine condition)	Normal condition
83	Engine coolant temperature sensor	Ignition switch: ON	When engine coolant tempera- ture is 0°C (32°F)	3.2 - 3.8 V
			When engine coolant tempera- ture is 20°C (68°F)	2.3 – 2.9 V
			When engine coolant tempera- ture is 40°C (104°F)	1.3 – 1.9 V
			When engine coolant tempera- ture is 80°C (176°F)	0.3-0.9V
84	Throttle position sensor	Ignition switch: ON	Set throttle valve to idle position	0.3 – 1.0 V
			Fully open throttle valve	4.5 – 5.5 V
85	Barometric pressure sensor	Ignition switch: ON	When altitude is Om	3.7 – 4.3 V
			When altitude is 1,200m	3.2 – 3.8 V
86	Vehicle speed sensor	<ul><li>Ignition switch:</li><li>Move the vehic</li></ul>	ON le slowly forward	0 ↔ 5 V (Changes repeatedly)
87	Closed throttle position switch	Ignition switch: ON	Set throttle valve to idle position	0 – 1 V
			Slightly open throttle valve	4 V or more
88	Camshaft position	Engine: Cranking		0.4 – 3.0 V
	sensor	Engine: Idle speed		0.5 – 2.0 V
89	Crankshaft position	Engine: Cranking		0.4 – 4.0 V
	sensor	Engine: Idle speed	an a	1.5 – 2.5 V
90	Volume air flow sensor	Engine: Idle speed		2.2 – 3.2 V
		Engine r/min: 2,500r	/min	
91	Park/Neutral position switch <a t=""></a>	Ignition switch: ON	Set selector lever to P or N	0 – 3 V
á .			Set selector lever to R, D, 2, or L	8 – 14 V

# TERMINAL RESISTANCE AND CONTINUITY CHECK

- 1. Turn the ignition switch to OFF.
- 2. Disconnect the ECM connector.
- Measure the resistance and check for continuity between the terminals of the ECM harness-side connector while referring to the check chart.

# NOTE

- 1. When measuring resistance and checking continuity, use a harness for checking contact pin pressure instead of inserting a test probe.
- 2. Checks do not have to be carried out in the order given in this chart.

#### Caution

If resistance or continuity checks are performed on the wrong terminals, damage to the vehicle wiring, sensors, ECM, and/or ohmmeter may occur. Use care to prevent this!

- If the ohmmeter shows any deviation from the normal condition, check the corresponding sensor, actuator and related electrical wiring, and then repair or replace.
- After repair or replacement, recheck with the ohmmeter to confirm that the repair or replacement has corrected the problem.

ECM Harness Side Connector Terminal Arrangement

perchano historia

		nn n	
	ເວເວັນເປັນເປັນເປັນ	ເພຍແມ່ນເພ	البابية بالماسيات السامية
-0000-3000-000-		ON AWN-WOWC	
		<u>│                                    </u>	
<b>സ്ത്രം</b> പ്രത്രായ ന്ന്നത്ത് പ്രത്രം പ		alalalar. Jahar	المباجبا وباويا وباربا وطوطوط
N-000-1004WN	NHACKOM	AKUNHOKOMATIAK	NHORO CONTRACTOR

9FU0392


Terminal No.	Inspection item	Normal condition (Check condition)
1-12	No. 1 injector	13–16 Ω [At 20°C (68°F)]
14-12	No. 2 injector	
2-12	No. 3 injector	
15-12	No. 4 injector	
4-12	Stepper motor coil (A1)	28–33 Ω [At 20°C (68°F)]
17-12	Stepper motor coil (A2)	
5-12	Stepper motor coil (B1)	
18-12	Stepper motor coil (B2)	
6–12	EGR solenoid	36-44 Ω [At 20°C (68°F)]
9–12	Evaporative emission purge solenoid	36–44 Ω [At 20°C (68°F)]

13B-136

MFI <1.8L Engine> - Troubleshooting

•

Terminal No.	Inspection item	Normal condition (Check condition)
13-Body ground	ECM ground	Continuity (0Ω)
26-Body ground	ECM ground	
54 - 12	Heated oxygen sensor heater (Rear)	11 – 18 Ω [At 20°C (68°F)]
55 – 12	Evaporative emission ventilation solenoid	36 – 44 Ω [At 20°C (68°F)]
60-12	Heated oxygen sensor heater (Front)	11 – 18 $\Omega$ [At 20°C (68°F)] <vehicles federal="" for=""> 4.5 – 8.0 <math>\Omega</math> [At 20°C (68°F)] <vehicles california="" for=""></vehicles></vehicles>
72–92	Intake air temperature sensor	5.3–6.7 kΩ [When intake air temperature is 0°C (32°F)]
		2.3–3.0 k $\Omega$ [When intake air temperature is 20°C (68°F)]
		1.0–1.5 k $\Omega$ [When intake air temperature is 40°C (104°F)]
		0.30–0.42 k $\Omega$ [When intake air temperature is 80°C (176°F)]
83-92	Engine coolant temperature sensor	5.1–6.5 k $\Omega$ [When coolant temperature is 0°C (32°F)]
		2.1–2.7 k $\Omega$ [When coolant temperature is 20°C (68°F)]
	ित्र के प्रदेश के प्रमुख स्थान के स्थान स्थित के प्रमुख के प्	0.9–1.3 kΩ [When coolant temperature is 40°C (104°F)]
		0.26–0.36 k $\Omega$ [When coolant temperature is 80°C (176°F)]
87-92	Closed throttle position switch	Continuity (when throttle valve is at idle position)
		No continuity (when throttle valve is slightly open)
91-Body ground	Park/Neutral position switch <a t=""></a>	Continuity (when select lever is at P or N)
		No continuity (when select lever is at D, 2, L or R)

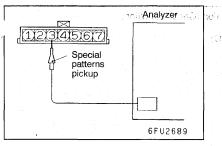

### INSPECTION PROCEDURE USING AN ANALYZER

13100930387

# VOLUME AIR FLOW SENSOR

# Measurement Method

- 1. Disconnect the volume air flow sensor connector, and connect the special tool (test harness: MB991709) in between. (All terminals should be connected.)
- 2. Connect the analyzer special patterns pickup to volume air flow sensor connector terminal 3.

# Alternate method (Test harness not available)


1. Connect the analyzer special patterns pickup to ECM terminal 90.

# Standard Wave Pattern


# **Observation conditions**

Function	Special patterns
Pattern height	Low
Pattern selector	Display
Engine r/min	Idle

# Standard wave pattern

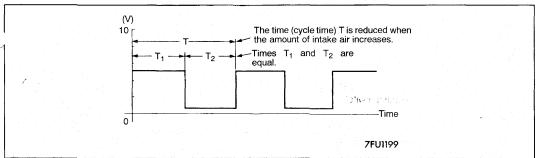




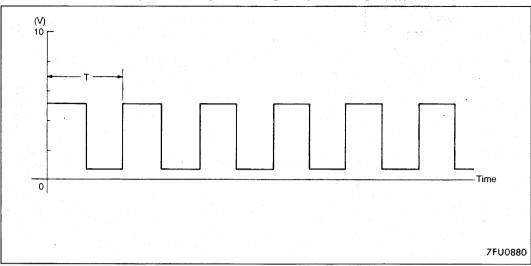

# Wave Pattern Observation Points

Check to be sure that cycle time T becomes shorter and the frequency increases when the engine speed is increased.

4

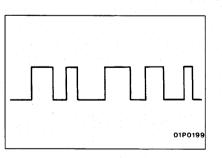

# **Examples of Abnormal Wave Patterns**

Example 1

CAUSE OF PROBLEM

Sensor interface malfunction

WAVE PATTERN CHARACTERISTICS

Rectangular wave pattern is output even when the engine is not started.


• Example 2

CAUSE OF PROBLEM

Damaged rectifier or vortex generation column

WAVE PATTERN CHARACTERISTICS

Unstable wave pattern with non-uniform frequency. However, when an ignition leak occurs during acceleration, the wave pattern will be distorted temporarily, even if the volume air flow sensor is normal.

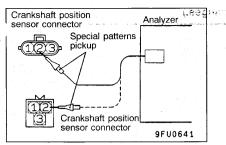

# CAMSHAFT POSITION SENSOR AND CRANKSHAFT POSITION SENSOR

# Measurement Method

- 1. Connect the analyzer special patterns pickup to camshaft position sensor connector terminal 2.
- Disconnect the crankshaft position sensor connector and connect the special tool (test harness: MD998478) in between.
- 3. Connect the analyzer special patterns pickup to crankshaft position sensor connector terminal 2.

# Alternate method (Test harness not available)


- 1. Connect the analyzer special patterns pickup to ECM terminal 88. (When checking the camshaft position sensor signal wave pattern)
- Connect the analyzer special patterns pickup to ECM terminal 89. (When checking the crankshaft position sensor signal wave pattern)

# Standard Wave Pattern

### **Observation conditions**

Function	Special patterns
Pattern height	Low
Pattern selector	Display
Engine r/min	Idle


# Standard wave pattern

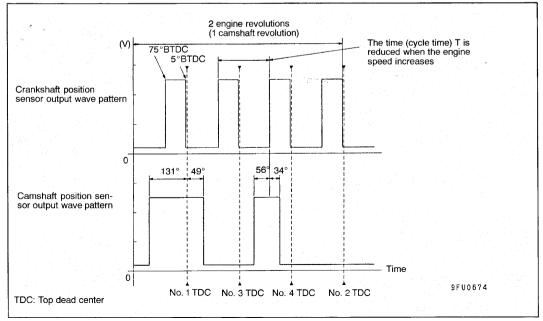

# Wave Pattern Observation Points

Check to be sure that cycle time T becomes shorter when the engine speed increases.

13B-140

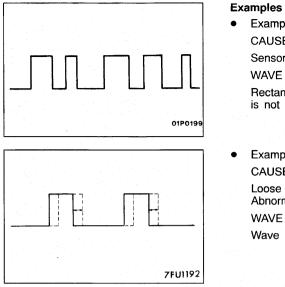

### **Examples of Abnormal Wave Patterns**


Example 1 CAUSE OF PROBLEM Sensor interface malfunction WAVE PATTERN CHARACTERISTICS Rectangular wave pattern is output even when the engine is not started.

Example 2 CAUSE OF PROBLEM Loose timing belt Abnormality in sensor disk WAVE PATTERN CHARACTERISTICS Wave pattern jumps to the left or right.

# INJECTOR

98360 9 0 4 0 1

Refer to GROUP 13A – On-vehicle Service. **IDLE AIR CONTROL (STEPPER) MOTOR** Refer to GROUP 13A – On-vehicle Service.

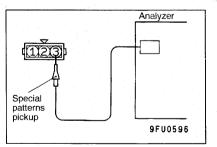

# IGNITION COIL AND IGNITION POWER TRANSISTOR

Ignition power transistor control signal

### Measurement Method

- Disconnect the ignition coil connector, and connect the special tool (test harness: MB991348) in between. (All terminals should be connected.)
- 2. Connect the analyzer special patterns pickup to ignition coil connector terminal 3.

# Alternate method (Test harness not available)

 Connect the analyzer special patterns pickup to ECM terminal 10(No.1 – No.4), terminal 23 (No.2 – No.3) respectively.


# Standard Wave Pattern

### **Observation conditions**

Function	Special patterns
Pattern height	Low
Pattern selector	Display
Engine r/min	Approx. 1,200 r/min

# MFI <1.8L Engine> - Troubleshooting


#### Standard wave pattern smalled event lear

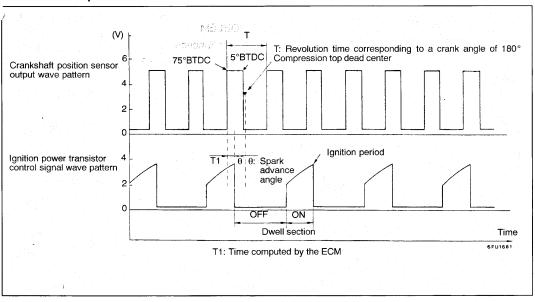


# Wave Pattern Observation Points

Point: Condition of wave pattern build-up section and maximum voltage (Refer to abnormal wave pattern examples 1 and 2.)

Condition of wave pattern build-up section and maximum voltage	Probable cause	
Rises from approx. 2V to approx. 4.5V at the top-right	Normal	
2V rectangular wave	Open-circuit in ignition primary circuit	
Rectangular wave at power voltage	Ignition power transistor malfunction	

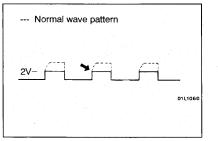

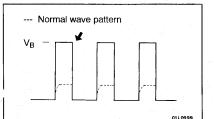

#### **Examples of Abnormal Wave Patterns**

• Example 1 Wave pattern during engine cranking CAUSE OF PROBLEM

Open-circuit in ignition primary circuit

WAVE PATTERN CHARACTERISTICS

Top-right part of the build-up section cannot be seen, and voltage value is too low, approximately 2V.

Example 2 Wave pattern during engine cranking CAUSE OF PROBLEM

Malfunction in ignition power transistor

WAVE PATTERN CHARACTERISTICS

Power voltage results when the ignition power transistor is ON.

# ON-VEHICLE SERVICE

13100100481

# THROTTLE BODY (THROTTLE VALVE AREA) CLEANING

Refer to GROUP 13A - On-vehicle Service.


CLOSED THROTTLE POSITION SWITCH AND THROTTLE POSITION SENSOR ADJUSTMENT <Vehicles without auto-cruise control system>

Refer to GROUP 13A - On-vehicle Service.

# CLOSED THROTTLE POSITION SWITCH AND THROTTLE POSITION SENSOR ADJUSTMENT <Vehicles with auto-cruise control system>


13100130213

- 1. Connect the scan tool to the data link connector. When not using the scan tool, proceed as follows.
  - (1) Disconnect the connector of the throttle position sensor.
  - (2) Connect an ohmmeter between terminal 3 (closed throttle position switch) and 4 (sensor ground) by using jumper wires.

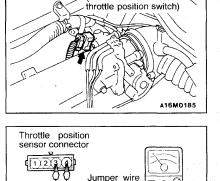


Throttle position sensor

(with built-in closed)

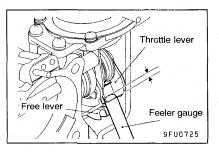

7FU0629

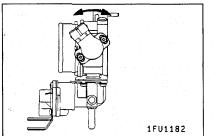


 Insert the tip of a 1.4mm (.055 in.) thick (including clearance amount compensation) feeler gauge approximately 3mm (.12 in.) between the levers shown in the left illustration.

### NOTE

The throttle lever opening will widen larger than the set opening if the feeler gauge is inserted more than 3mm (.12 in.), and adjustment will be impossible.

- 3. When using the scan tool, turn the ignition switch ON. (Do not start engine.) Observe operation of the closed throttle position switch.
- Loosen the throttle position sensor mounting bolt; then turn the throttle position sensor body fully counterclockwise.
- 5. In this condition, make sure that the closed throttle position switch is ON.
- Slowly turn the throttle position sensor clockwise until the point at which the idle switch is turned OFF is found. Tighten the throttle position sensor installation bolt at that position. Proceed to step 8.

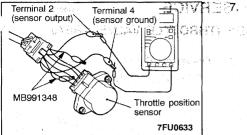


. When not using the scan tool, proceed as follows:

- Connect the special tool (test harness set) between the throttle position sensor connectors which have been disconnected. (Connect all terminals taking care not to mistake the terminal No.)
- (2) Connect a digital voltmeter between the throttle position sensor terminal 2 (sensor output) and terminal 4 (sensor ground.)
- (3) Turn the ignition switch ON (but do not start the engine).
- 8. Check the throttle position sensor output voltage.

#### Standard value: 400 - 1,000 mV

- 9. If there is a deviation from the standard value, check the throttle position sensor and the related harness.
- 10. Remove the feeler gauge.
- 11. Switch OFF the ignition switch.

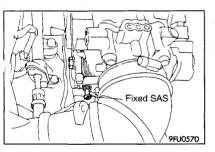

# FIXED SAS ADJUSTMENT

13100150448

# NOTE

- 1. The fixed SAS should not be moved unnecessarily; it has been precisely adjusted by the manufacturer.
- 2. If the adjustment is disturbed for any reason, readjust as follows.
- 1. Loosen the tension of the accelerator cable sufficiently.
- 2. Back out the fixed SAS lock nut.
- 3. Turn the fixed SAS counterclockwise until it is sufficiently backed out, and fully close the throttle valve.
- 4. Turn the fixed SAS clockwise until the throttle lever is touched (i.e., the point at which the throttle valve begins to open).
  - From that point, turn the fixed SAS clockwise another 1-1/4 turn.
- 5. While holding the fixed SAS so that it doesn't move, tighten the lock nut securely.
- 6. Adjust the tension of the accelerator cable.
- 7. Adjust the basic idle speed.
- 8. Adjust the closed throttle position switch and the throttle position sensor (Vehicles without auto-cruise control system: Refer to P.13B-142.) (Vehicles with auto-cruise control system: Refer to P.13B-142.)

# BASIC IDLE SPEED ADJUSTMENT

Refer to GROUP 13A - On-vehicle Service.

13100180546

FUEL PRESSURE TEST

13100190495

Refer to GROUP 13A - On-vehicle Service.

# FUEL PUMP CONNECTOR DISCONNECTION (HOW TO REDUCE PRESSURIZED FUEL LINES) 13100090177

Refer to GROUP 13A - On-vehicle Service.

FUEL PUMP OPERATION CHECK


13100200341


Refer to GROUP 13A - On-vehicle Service.


# COMPONENT LOCATION

13100210634

Name		Symbol	Name	Symbol
Air conditioning compressor clutch relay		Α	Idle air control motor	Е
Air conditioning switch		Ρ	Ignition coil (with built-in ignition power transistor)	К
Camshaft position sensor		F	Ignition failure sensor	F
Crankshaft position sensor		JŠ×	Injector	К
Data link connector		0	Manifold differential pressure sensor	D
EGR Solenoid		С	Multiport fuel injection (MFI) relay/Fuel pump relay	Q
Engine control module		R	Park/Neutral position switch	М
Engine coolant temperature sensor		G	Power steering pressure switch	В
Evaporative emission purge solenoid		С	Service Engine Soon/Malfunction Indicator Lamp	N
Fuel pump check connector		н	Throttle position sensor (with built-in closed throttle position switch)	E
Heated oxygen sensor <california></california>	Front	S	Vehicle speed sensor	L
	Rear	S	Volume air flow sensor (with built-in	I
Heated oxygen sensor <federal></federal>	Front	S	intake air temperature sensor and barometric pressure sensor)	
	Rear	S		· .

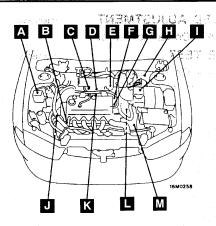

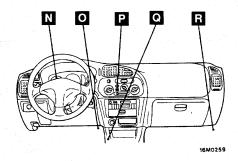


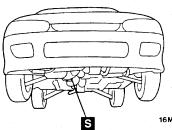


16M0345

9FU0726


ik.

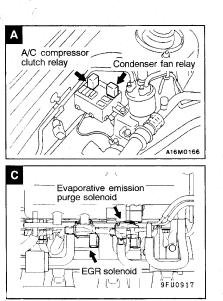


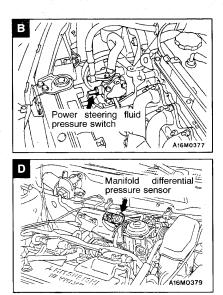


# 13B-146


# MFI <1.8L Engine> - On-vehicle Service

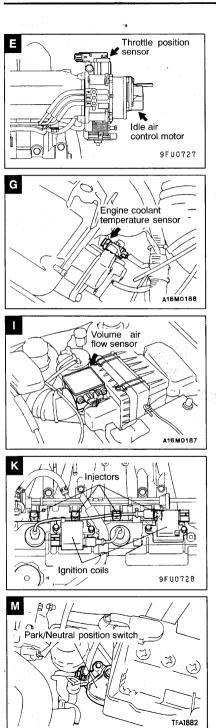

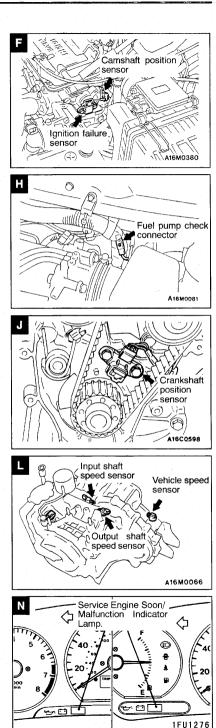

MFI <1.8L Engine> - On-vehicle Service

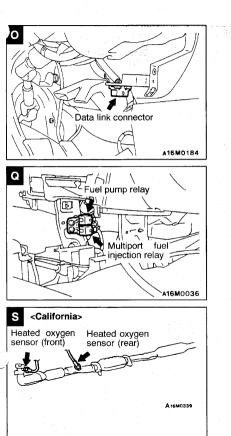


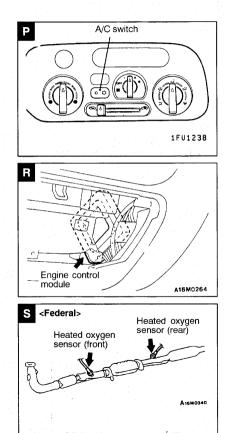

# MULTIPORT FUEL INJECTION (MFI) RELAY AND FUEL PUMP BELAY CONTINUITY CHECK

13100990255

Refer to GROUP 13A - On-vehicle Service.

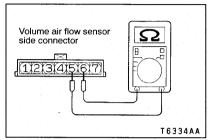

Intake air

temperature sensor

AT6335AA



13100280307

- 1. Disconnect the volume air flow sensor connectors.
- 2. Measure resistance between terminals 5 and 6.

Standard value: 2.3 - 3.0 kΩ [at 20°C (68°F)] 0.30 - 0.42 kΩ [at 80°C (176°F)]

З. Measure resistance while heating the sensor using a hair drver.


#### Normal condition:

Temperature	Resistance		
Higher	Smaller		

4. If resistance does not decrease as heat increases the resistance remains unchanged, replace the volume air flow sensor assembly.

#### ENGINE COOLANT TEMPERATURE SENSOR CHECK 13100310310

Refer to GROUP 13A - On-vehicle Service.

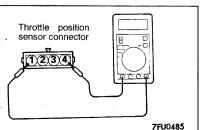


# THROTTLE POSITION SENSOR CHECK

13100320443

- 1. Disconnect the throttle position sensor connector.
- Measure the resistance between the throttle position 2. sensor side connector terminal 1 and terminal 4.

Standard value: 3.5 – 6.5 k $\Omega$ 

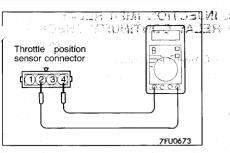

3.3 Measure the resistance between the throttle position 3.3 3.8 sensor side connector terminal 2 and terminal 4.


#### Normal condition:

Throttle valve slowly open until fully open from the idle position	
--	--

 If the resistance is outside the standard value, or if it doesn't change smoothly, replace the throttle position sensor.

#### NOTE

After replacement, the throttle position sensor should be adjusted. (Vehicles without auto-cruise control system: auto-cruise control system: Refer to P.13B-142.) (Vehicles with auto-cruise control system Refer to P.13B-142.)

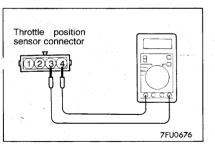

### CLOSED THROTTLE POSITION SWITCH CHECK 13100330422

le nesition concer connector


- 1. Disconnect the throttle position sensor connector.
- 2. Check the continuity between the throttle position sensor connector side terminal 3 and terminal 4.


#### Normal condition:

Accelerator pedal	Continuity
Depressed	Non-conductive
Released	Conductive

3. If out of specification, replace the throttle position sensor. NOTE

After replacement, the closed throttle position switch and throttle position sensor should be adjusted. (Vehicles without auto-cruise control system: Refer to P.13B-142.) (Vehicles with auto-cruise control system: Refer to P.13B-142.)

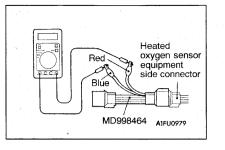

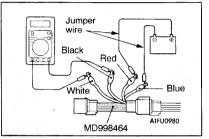

# HEATED OXYGEN SENSOR CHECK

#### <Heated oxygen sensor (front)>

When using Scan tool, observe HO<sub>2</sub>S reading. If values are unsatisfactory, or if Scan tool is not available, use the following procedure:

13100500311

- 1. Disconnect the heated oxygen sensor connector and connect the special tool (test harness) to the connector on the heated oxygen sensor side.
- 2. Make sure that there is continuity\* between terminal 1 (red clip of special tool) and terminal 3 (blue clip of special tool) on the heated oxygen sensor connector.

#### NOTE

- \*: 11 18  $\Omega$  at 20°C (68°F) <Vehicles for Federal>, 4.5 – 8.0  $\Omega$  at 20°C (68°F) <Vehicles for California>
- 3. If there is no continuity, replace the heated oxygen sensor.
- Warm up the engine until engine coolant is 80°C (176°F) or higher.
- 5. Use the jumper wires to connect terminal 1 (red clip) of the heated oxygen sensor connector to the battery (+) terminal and terminal 3 (blue clip) to the battery (-) terminal.

#### Caution

9 N N N N

ر این دی شورشین ( ۲۰۰

Be very careful when connecting the jumper wires; incorrect connection can damage the heated oxygen sensor.

6. Connect a digital voltage meter between terminal 2 (black clip) and terminal 4 (white clip).

7. While repeatedly racing the engine, measure the heated oxygen sensor output voltage.

#### Standard value:


Engine	Heated oxygen sensor output voltage	Remarks		
When racing engine	0.6–1.0V	If you make the air/fuel ratio rich by racing the engine repeatedly, a normal heated oxygen sensor will output a voltage of 0.6–1.0V.		

8. If the sensor is defective, replace the heated oxygen sensor.


#### NOTE

For removal and installation of the heated oxygen sensor, refer to GROUP 15 – Exhaust Pipe and Main Muffler.

4

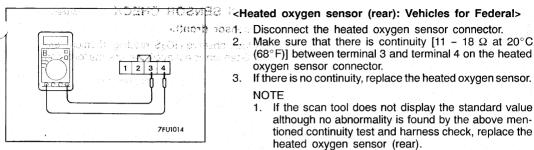

 For removal and installation of the oxygen sensor, refer to GROUP 15 – Exhaust Pipe and Main Muffler.

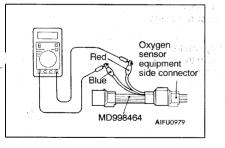

#### <Heated oxygen sensor (rear): Vehicles for California>

- 1. Disconnect the heated oxygen sensor connector and connect the special tool (test harness) to the connector on the heated oxygen sensor side.
- Make sure that there is continuity [11 18 Ω at 20°C (68°F)] between terminal 1 (red clip of special tool) and terminal 3 (blue clip of special tool) on the heated oxygen sensor connector.
- 3. If there is no continuity, replace the heated oxygen sensor.


#### NOTE

- 1. If the scan tool does not display the standard value although no abnormality is found by the above mentioned continuity test and harness check, replace the heated oxygen sensor (rear).
- For removal and installation of the oxygen sensor, refer to GROUP 15 – Exhaust Pipe and Main Muffler.

# INJECTOR CHECK

13100520416

Refer to GROUP 13A - On-vehicle Service.

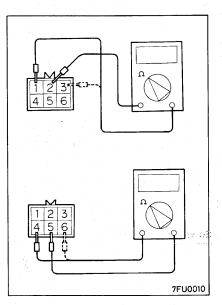

#### IDLE AIR CONTROL MOTOR (STEPPER MOTOR) CHECK

13100540399

#### Checking the Operation Sound

1. Check that the engine coolant temperature is  $20^{\circ}C$  (68°F) or below.

#### NOTE

Disconnecting the engine coolant temperature sensor connector and connecting the harness-side of the connector to another engine coolant temperature sensor that is at  $20^{\circ}$ C ( $68^{\circ}$ F) or below is okay for this test.

- 2. Check that the operation sound of the stepper motor can be heard after the ignition is switched ON. (but without starting the motor.)
- 3. If the operation sound cannot be heard, check the stepper motor's activation circuit.

If the circuit is normal, it is probable that there is a malfunction of the stepper motor or of the engine control module.

#### Checking the Coil Resistance

- 1. Disconnect the idle air control motor connector and connect the special tool (test harness).
- Measure the resistance between terminal 2 (white clip of the special tool) and either terminal 1 (red clip) or terminal 3 (blue clip) of the connector at the idle air control motor side.

#### Standard value: 28 – 33 Ω [at 20°C (68°F)]

 Measure the resistance between terminal 5 (green clip of the special tool) and either terminal 6 (yellow clip) or terminal 4 (black clip) of the connector at the idle air control motor side.

Standard value: 28 – 33  $\Omega$  [at 20°C (68°F)]

#### EVAPORATIVE EMISSION PURGE SOLENOID CHECK 13100560289

Refer to GROUP 17 - Emission Control System.

#### EGR SOLENOID CHECK

13100570145

Refer to GROUP 17 - Emission Control System.

# **INJECTOR**


#### . Oniveride Servic **REMOVAL AND INSTALLATION**

#### **Pre-removal Operation**

- (1) Fuel Discharge Prevention (Refer to P.13B-144.)(2) Air Cleaner Removal

# Post-installation Operation

- Air Cleaner Installation
   Fuel Leakage Checking

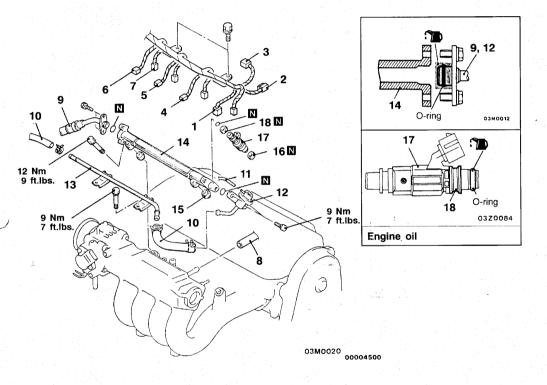

#### **Removal steps**

- 1. Heated oxygen sensor connector
- 2. Crank angle sensor connector
- 3. Ignition coil connector
- 4. Evaporative emission purge solenoid connector
- 5. EGR solenoid connector
- Manifold differential pressure sensor connector
- 7. Injector connector
- 8. PĆV hose connection

		Fuel press		
		Fuel return		
	14.	Fuel rail		
• •	15.	Insulators		
		Insulators		
		Injectors		
	18.	Grommets		

►A 9. Fuel high-pressure hose connection

10. Fuel return hose connection

13100710196


# REMOVAL SERVICE POINT


#### **A** FUEL RAIL/INJECTOR REMOVAL

Remove the fuel rail (with the injectors attached to it).

#### Caution

Care must be taken, when removing the fuel rail, not to drop the injector.

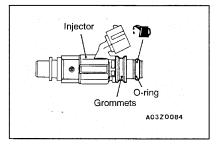

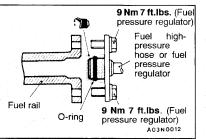

# INSTALLATION SERVICE POINT


#### ►A INJECTOR/FUEL PRESSURE REGULATOR/FUEL HIGH-PRESSURE HOSE INSTALLATION

1. Apply a drop of new engine oil to the O-ring.

#### Caution

Be sure not to let engine oil enter the fuel rail.

- While turning the injector, fuel high-pressure hose and fuel pressure regulator to the right and left, install the fuel rail. Be careful not to damage the O-ring. After installing, check that the hose turns smoothly.
- 3. If it does not turn smoothly, the O-ring may be trapped, remove the fuel pressure regulator and then re-insert it into the fuel rail and check once again.
- Tighten the fuel high-pressure hose to the standard torque, and tighten the fuel pressure regulator to the specified torque.

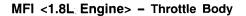


13B-155

THROTTLE BODY THOSE POINT 13100770385 **REMOVAL AND INSTALLATION** 그걸는 Post-Installation Operation Pre-removal Operation (1) Engine Coolant Draining (Refer to GROUP 00 -(1) Air Cleaner Installation (2) Engine Coolant Supplying (Refer to GROUP 00 – Maintenance Service.) Maintenance Service.) (2) Air Cleaner Removal (3) Accelerator Cable Adjustment (Refer to GROUP 17 - On-vehicle Service.) 5 Nm 4 ft.lbs. 19 Nm 14 ft.lbs. 5 8 N 3

#### **Removal steps**

- 1. Accelerator cable connection
- 2. Throttle position sensor connector
- 3. Idle speed control servo connector
- 4. Vacuum hose connection
- 5. Vacuum hose connection <Vehicles with auto-cruise control>
- 6. Water hose connection7. Throttle bodyA8. Throttle body gasket

A03M0059

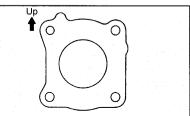


# INSTALLATION SERVICE POINT

Place the gasket so that the projecting part is positioned as shown in the illustration, and then install it between the intake manifold and the throttle body.

Towards front of vehicle

A03M0009

# DISASSEMBLY AND REASSEMBLY

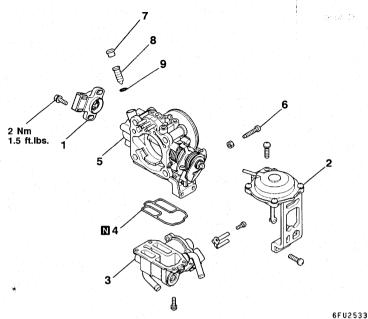


#### **Disassembly steps**

- A 1. Throttle position sensor
  - 2. Accelerator lever body assembly
  - 3. Idle speed control body assembly
  - 4. O-ring
  - 5. Throttle body
  - 6. Fixed SAS
  - 7. Cap
  - 8. Speed adjusting screw
  - 9. O-ring

#### NOTE

- The fixed SAS is correctly adjusted at the factory and 1. should not be removed.
- If the fixed SAS should happen to have been 2. removed, carry out fixed SAS adjustment. (Refer to page 13B-143.)
- If the speed adjusting screw should happen to have 3. been removed, carry out speed adjusting screw adjustment.

(Refer to page 13B-144.)

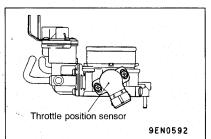


### REASSEMBLY SERVICE POINT

#### ►A THROTTLE POSITION SENSOR (TPS) INSTALLATION

- Install the TPS so that it faces as shown in the illustration, 1. and then tighten it with the screw.
- 2. Connect a multimeter between terminal (1) (TPS power supply) and terminal (2) (TPS output) of the TPS connector, and check that the resistance increases gradually as the throttle valve is opened slowly to the fully-open position.

13100970433

# MFI <1.8L Engine> – Throttle Body

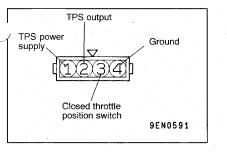

 Check the continuity between terminal (3) (closed throttle position switch) and terminal (4) (ground) of the TPS connector when the throttle valve is fully closed and fully open.

13B-157

#### Normal condition:

Throttle valve condition	Continuity	and the second
Fully closed	Continuity	
Fully open	No continuity	11 A.

If there is no continuity when the throttle valve is fully closed, turn the TPS body counter-clockwise and then check again.

4. If there is an abnormality, replace the TPS.