

insider info.

1995 Subaru Legacy - DTC P0325: Knock Sensor Circuit Malfunction

If you encounter a CHECK ENGINE light with a DTC P0325 on a 1995 Subaru Legacy, check to see if the knock sensor mounting bolt has been torqued too tightly upon installation. Also check the threads of the sensor mounting bolt and the thread surfaces of the block to see that they are clean and not corroded. Any corrosion should be removed before installing the bolt.

The correct torque for the mounting bolt is 15-19 ft. lbs. This information is not found in the service manual.