

SERVICE BULLETIN

APPLICABILITY

92MY SIA BUILT LEGACY STATION WAGON
WITH MANUAL TRANSMISSION

DATE

02-05-93

SUBJECT: COMBINATION METER WIRING

If you receive a manual transmission Legacy station wagon with the following condition:

- o Rear gate telltale light "on" all the time and will not turn-off with gate latch adjustments and no wiring problems are found at the rear gate harness.
- o Side door telltale lights are inoperative.

Examine the combination meter main harness connectors I-14 and I-15 using the 92MY Legacy Service Manual, Section 6-3 [0507], Pages 32, 33, 34 and 35.

The connectors may be incorrectly wired for an automatic transmission. Use the schematic in Figure 1 to relocate the pins in connectors I-14 and I-15 to convert the harness to a manual transmission configuration.



CAUTION

VEHICLE SERVICING PERFORMED BY UNTRAINED PERSONS COULD RESULT IN SERIOUS INJURY TO THOSE PERSONS OR TO OTHERS

Subaru Service Bulletins are intended for use by professional technicians ONLY. They are written to inform those technicians of conditions that may occur in some vehicles, or to provide information that could assist in the proper servicing of the vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do the job correctly and safely. If a condition is described, DO NOT assume that this Service Bulletin applies to your vehicle, or that your vehicle will have that condition. Impreza is a Trademark and Legacy, Justy, Loyale and Subaru SVX are Registered Trademarks.



Relocate the pins in connectors I-14 and I-15 as shown

Before
Pin
Location

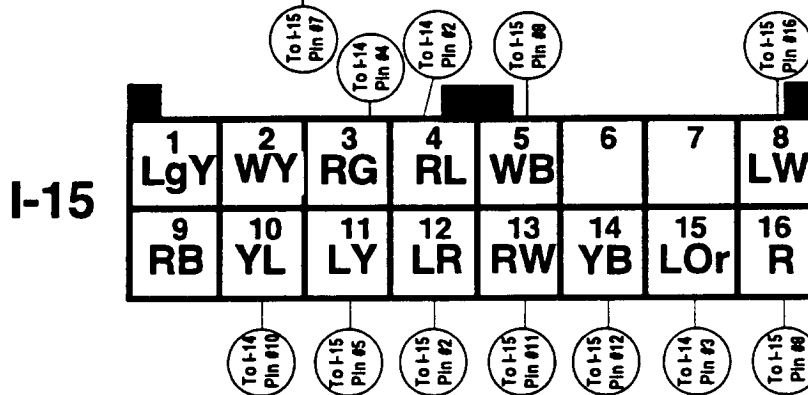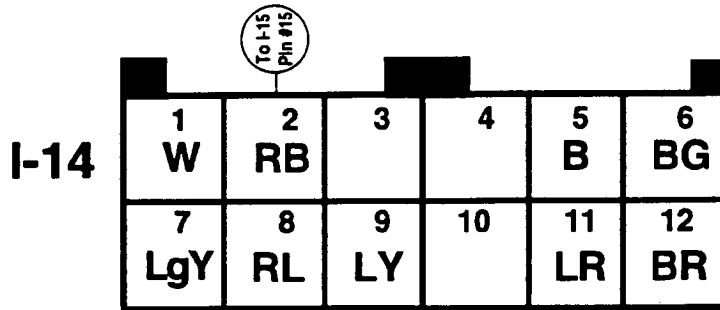

Color Code	Color
B	Black
Y	Yellow
G	Green
R	Red
W	White
Br	Brown
Lg	Light Green
Gr	Gray
P	Pink
Or	Orange
Lb	Light Blue

After
Pin
Location

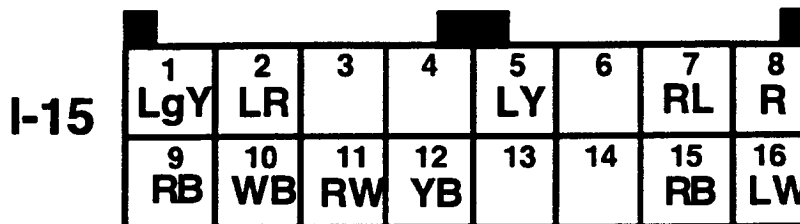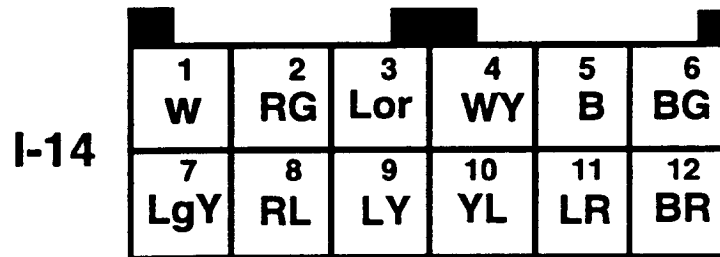

Note: I-14 is not used on manual transmission Models

Viewed from this direction

