


■ SYSTEM DIAGRAM

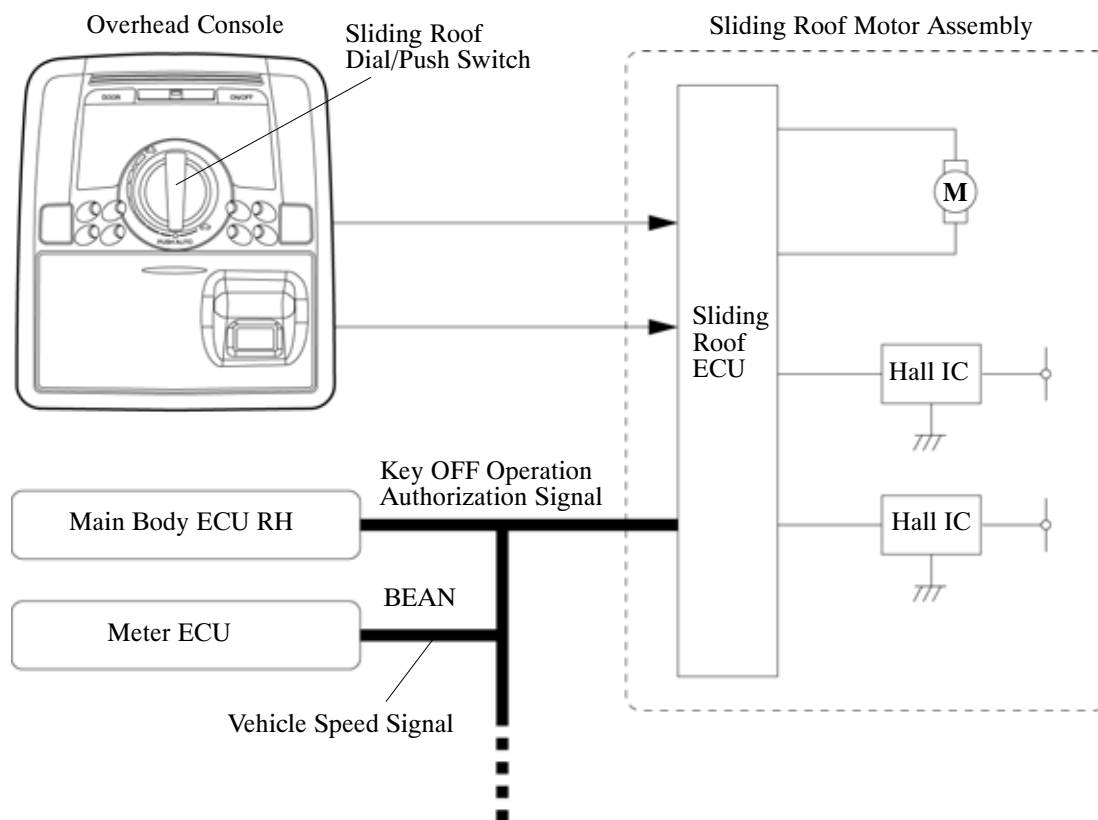

0140BE155C

Service Tip

Sliding Roof ECU memorizes the initial position of the sliding roof. This position may disappear from memory or a wrong position might be stored in memory due to reasons such as the disconnection of a battery terminal. If this occurs, the sliding roof will not operate correctly. In this case, the sliding roof position must be initialized as described below.

- (1) Change the power source to IG-ON.
- (2) If the sliding roof is open, move the sliding roof to a position close to the fully closed position.
- (3) Turn the rotary switch to the “over stroke position (manual open position)” and hold the switch in that position for 10 seconds.
- (4) Turn the rotary switch to the “full slide close position” and press and hold the rotary switch. The sliding roof tilts up and stops for approximately 1 second before it tilts down, slides open, and slides closed.
- (5) When the sliding roof stops at the fully closed position, initialization is completed.

NOTICE:

Continue pressing the rotary switch during initialization.

If releasing the switch during initialization, perform the procedure from (2) again.

- (6) Check that the sliding roof operates normally for AUTO operation.

For details, see the LEXUS IS250 Repair Manual (Pub. No. RM0150E).