

DTC	B2778	Interlock Cable Malfunction
------------	--------------	------------------------------------

CIRCUIT DESCRIPTION

The Steering Lock ECU prohibits the starter switch ON when it locks the steering.

The Steering Lock ECU monitors the interlock cable position. When this position does not change, the Steering Lock ECU judges it as the interlock cable cut and detects this DTC.

DTC No.	DTC Detecting Condition	Trouble Area
B2778	<ul style="list-style-type: none"> Installation failure of the interlock cable Interlock cable position sensor* failure 	Steering Lock ECU

*: This sensor is built in the Steering Lock ECU.

INSPECTION PROCEDURE

1	Check whether or not the interlock cable is properly installed.
---	---



Install it properly.



2	Check interlock cable position sensor using LEXUS hand-held tester.
---	---

PREPARATION:

Connect the LEXUS hand-held tester to the DLC3.

CHECK:

Check the interlock cable position sensor using DATA LIST.



Replace the steering lock ECU.
(See page IN-35).



No problem this time.
