


CIRCUIT DESCRIPTION


Connecting terminals Ts and E₁ of the DLC1 starts the check.

WIRING DIAGRAM

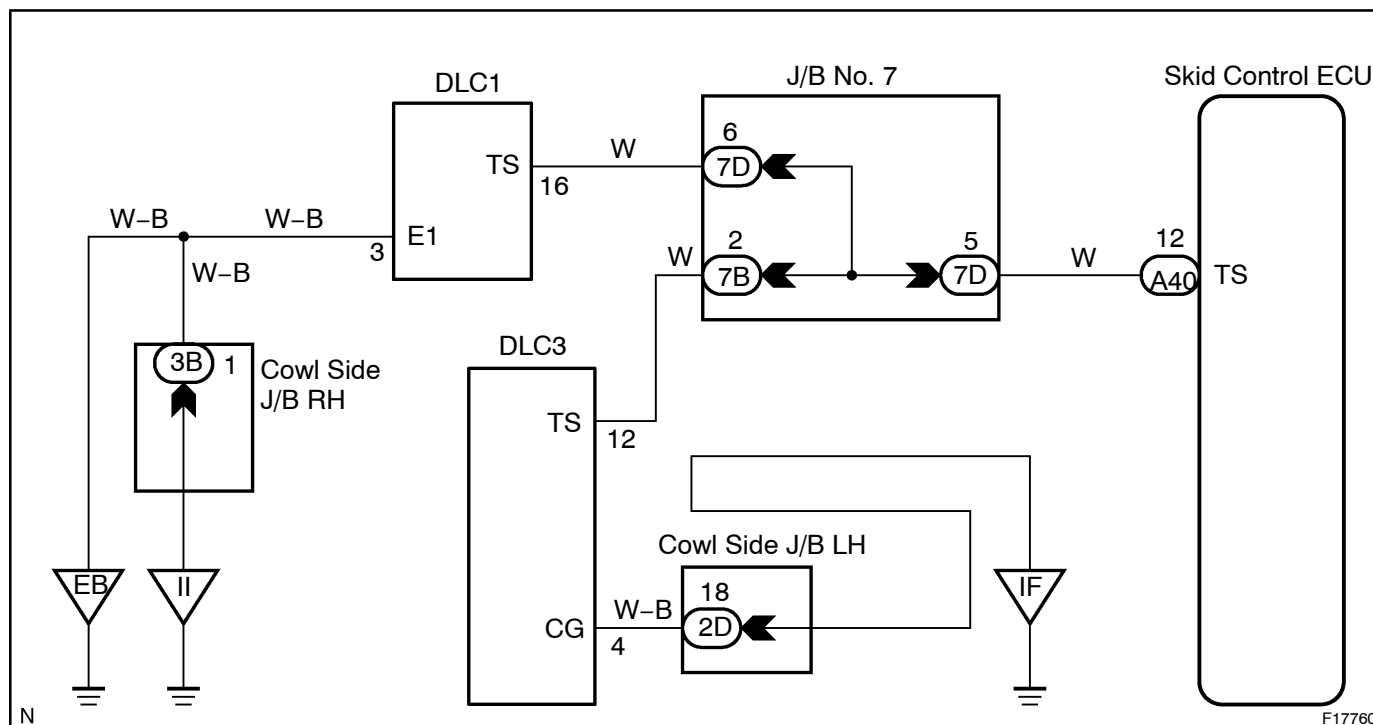

INSPECTION PROCEDURE

1	Check voltage between terminals Ts and E ₁ of DLC1.
---	--

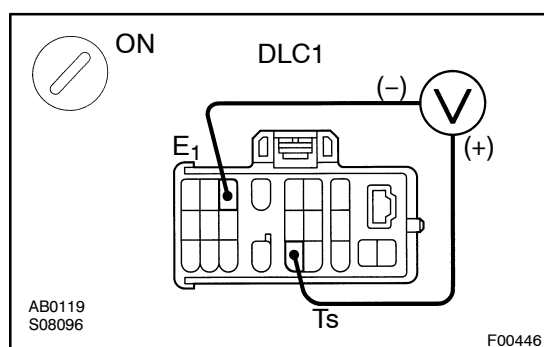

- Turn the ignition switch ON.
- Measure voltage between terminals Ts and E₁ of DLC1.

Voltage: 10 – 14 V

If ABS warning light does not blink even after Ts and E₁ have been connected, the ECU may be defective.

NG

2	IG switch OFF, and check for open and short circuit in harness and connector between skid control ECU and DLC1, DLC1 and body ground (See page IN-36).
---	---

NG**Repair or replace harness or connector.****OK****Check and replace skid control ECU.**