



SERVICE BULLETIN

QUALITY INFORMATION ANALYSIS

OVERSEAS SERVICE DEPT. MITSUBISHI MOTORS CORPORATION

SERVICE BULLETIN		No.: MSB-98E42-502	
		Date: 1999-06-30	<Model> <M/Y>
Subject:	CORRECTING MINIMUM ENTRAPMENT AMOUNT FOR POWER WINDOW WITH SAFETY MECHANISM		(EC,EXP)PAJERO 98-10 (V10,V20,V30,V40)
Group:	BODY	Draft No.: 98SY012115	
CORRECTION	OVERSEAS SERVICE DEPT	 T.NITTA - VICE GENERAL MANAGER QUALITY INFORMATION ANALYSIS	

1. Description:

Minimum entrapment amount detected for the power window with safety mechanism, has been corrected.

2. Applicable Manuals:

Manual	Pub. No.	Language	Page(s)
'98 PAJERO	PWJE9086-I	(English)	42-6
Workshop Manual chassis	PWJS9087-I	(Spanish)	
	PWJF9088-I	(French)	
	PWJG9089-I	(German)	
	PWJD9090-I	(Dutch)	
	PWJW9091-I	(Swedish)	

3. Details:

Inspection Procedure 6

The glass is not lowered when something is jammed in the window	Probable cause
The cause may be a malfunction of the revolution detection sensor in the power window motor-ECU.	<ul style="list-style-type: none"> • Malfunction of the power window motor-ECU

Replace the power window motor-ECU.

10 mm <Corrected>

Inspection Procedure 7

When the glass is fully raised, it then lowers automatically.	Probable cause
When the window is within 10 mm of being fully closed, the limit switch turns off to prevent the window from being lowered. However, the above problem can occur if there is a malfunction of the limit switch in the power window motor-ECU.	<ul style="list-style-type: none"> • Malfunction of the power window motor-ECU

Limit switch operation position adjustment (Refer to P.42-13.)



Check trouble symptoms.



Replace the power window motor-ECU