



SERVICE BULLETIN

Classification:	EC95-013	Reference:	NTB95-069	Date:	July 5, 1995
-----------------	----------	------------	-----------	-------	--------------

1990-95 PATHFINDER HARD/NO START AT HIGH ELEVATION AND LOW TEMPERATURE

APPLIED VEHICLE: 1990-95 Pathfinder (WD21)

SERVICE INFORMATION

If a 1990-95 Pathfinder experiences a hard or no start incident when at both high elevation (above 8,000 feet) and low ambient temperature (Below 32°F/ 0°C), the incident may be caused by an over rich mixture and can be corrected by installing a new Water Temperature Sensor Assembly.

NOTE: This part is intended for high elevation use only. If the incident occurs at lower elevations and the water temperature sensor is found to be the cause, please use the normal service part number.

PARTS INFORMATION

DESCRIPTION	PART #/PFP	QUANTITY
Water Temp. Sensor Assy.	22630-51E20	1

WARRANTY INFORMATION

OPERATION	OP CODE	PNC	SYMPTOM	DIAGNOSIS	FRT
RPL Water temp sensor	DE30AA	22630	AA	32	0.3hrs

* New Claims System Dealers: Submit a Primary Part line claim using P/N 22630-51E20.

.....
Index # **043520**
.....

NISSAN MOTOR CORPORATION, U.S.A.
Technical Communications Department