



SERVICE BULLETIN

Classification:	Reference:	Date:
RS99-005	NTB99-028	April 15, 1999

NISSAN FRONT SEAT BELT SLOW RETRACTION

APPLIED VEHICLES: All Nissan Vehicles

SERVICE INFORMATION

If a Nissan vehicle experiences slow retraction of the seat belt assembly (such as the latch plate hanging up on clothing, becoming stuck in the door, and/or not returning to the fully retracted position), it may be due to a residue build up on the seat belt D ring located on the B pillar. If residue build up causes seat belt slow retraction, use the service procedure in this bulletin to resolve the incident.

SERVICE PROCEDURE

1. Sitting in the seat, extend and buckle the seat belt in it's normal restraining position. Release the belt, allowing it to retract.
2. If the seat belt retracts slowly or does not return to the fully retracted position, inspect the D ring located on the B pillar for residue buildup on the underside of the belt.
 - A. If there is no residue buildup, this bulletin does not apply.
 - B. If there is residue buildup, continue with this service procedure.
3. Insert a piece of cheese cloth or a piece of cotton gauze (such as found in a First Aid Kit) under the seat belt, between the belt and the D ring, then slide it back and forth over the D ring where it contacts the seat belt (see Figure 1) until all residue is removed.

WARNING: DO NOT use solvents to clean seat belt assemblies, the seat belt material will be damaged.

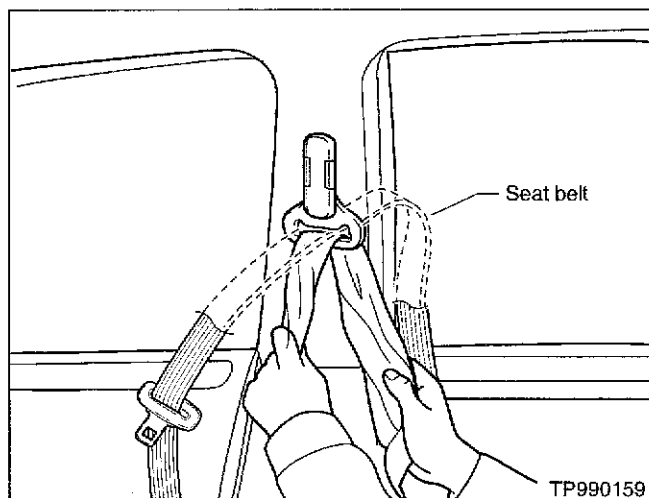


Figure 1.

058124

PARTS INFORMATION

There are no parts required.

CLAIMS INFORMATION

DESCRIPTION	PFP	OP CODE	SYM	DIA	FRT
Clean Seat Belt D-Ring	*	VK80AA	ZH	51	0.2 hrs

*Reference the Parts Catalog and use the indicated Seat Belt Assembly P/N as the PFP.
