



NISSAN MOTOR CORPORATION IN U.S.A.

Post Office Box 191
Gardena, California 90248
Telephone: (310) 532-3111

TECHNICAL DATABASE INFORMATION

Record ID: FC0009202	Source Reference Number: NMC	Classification: FEB '94
Subject: EXHAUST STUDS	Entered On: 02/03/94	
Model Line: NIS	Model Year: ALL	

Technical Information Abstract:

SYMPTOMS: ENGINE EXHIBITS AN EXHAUST NOISE FROM THE EXHAUST MANIFOLD. FOUND
ALL VG30E BROKEN MANIFOLD MOUNTING STUDS.
MODELS

INFORMATION: THE EXHAUST MANIFOLD STUD HAS BEEN CHANGED FOR IMPROVED DURABILITY. USE THE FOLLOWING PROCEDURE TO REPAIR VEHICLES WHICH EXHIBIT EXCESSIVE EXHAUST NOISE DUE TO EXHAUST MANIFOLD STUD BREAKAGE.

- 1) REMOVE THE EXHAUST MANIFOLD ON THE SIDE OF THE ENGINE WITH THE BROKEN STUD(S). ===>
- 2) REPLACE ONLY THE BROKEN STUD(S), WITH IMPROVED PART (# 14065-V5003), THESE USUALLY ARE THE FRONT AND/OR REAR STUDS.
- 3) REPLACE THE EXHAUST MANIFOLD WITH A NEW PART.

.....
Index # **037602**
.....