

DTC	B0130/63	Short in P/T Squib (RH) Circuit
------------	-----------------	--

CIRCUIT DESCRIPTION


The P/T squib (RH) circuit consists of the airbag sensor assembly and seat belt pretensioner (RH). It causes the seat belt pretensioner (RH) to activate when the seat belt pretensioner (RH) activation conditions are satisfied.

For details of the function of each component, see OPERATION on page [RS-2](#).

DTC B0130/63 is recorded when a short is detected in the P/T squib (RH) circuit.


DTC No.	DTC Detecting Condition	Trouble Area
B0130/63	• Short circuit between PR+ wire harness and PR- wire harness of squib • P/T squib (RH) malfunction • Airbag sensor assembly malfunction	• Seat belt pretensioner (RH) • Airbag sensor assembly • Wire harness

WIRING DIAGRAM

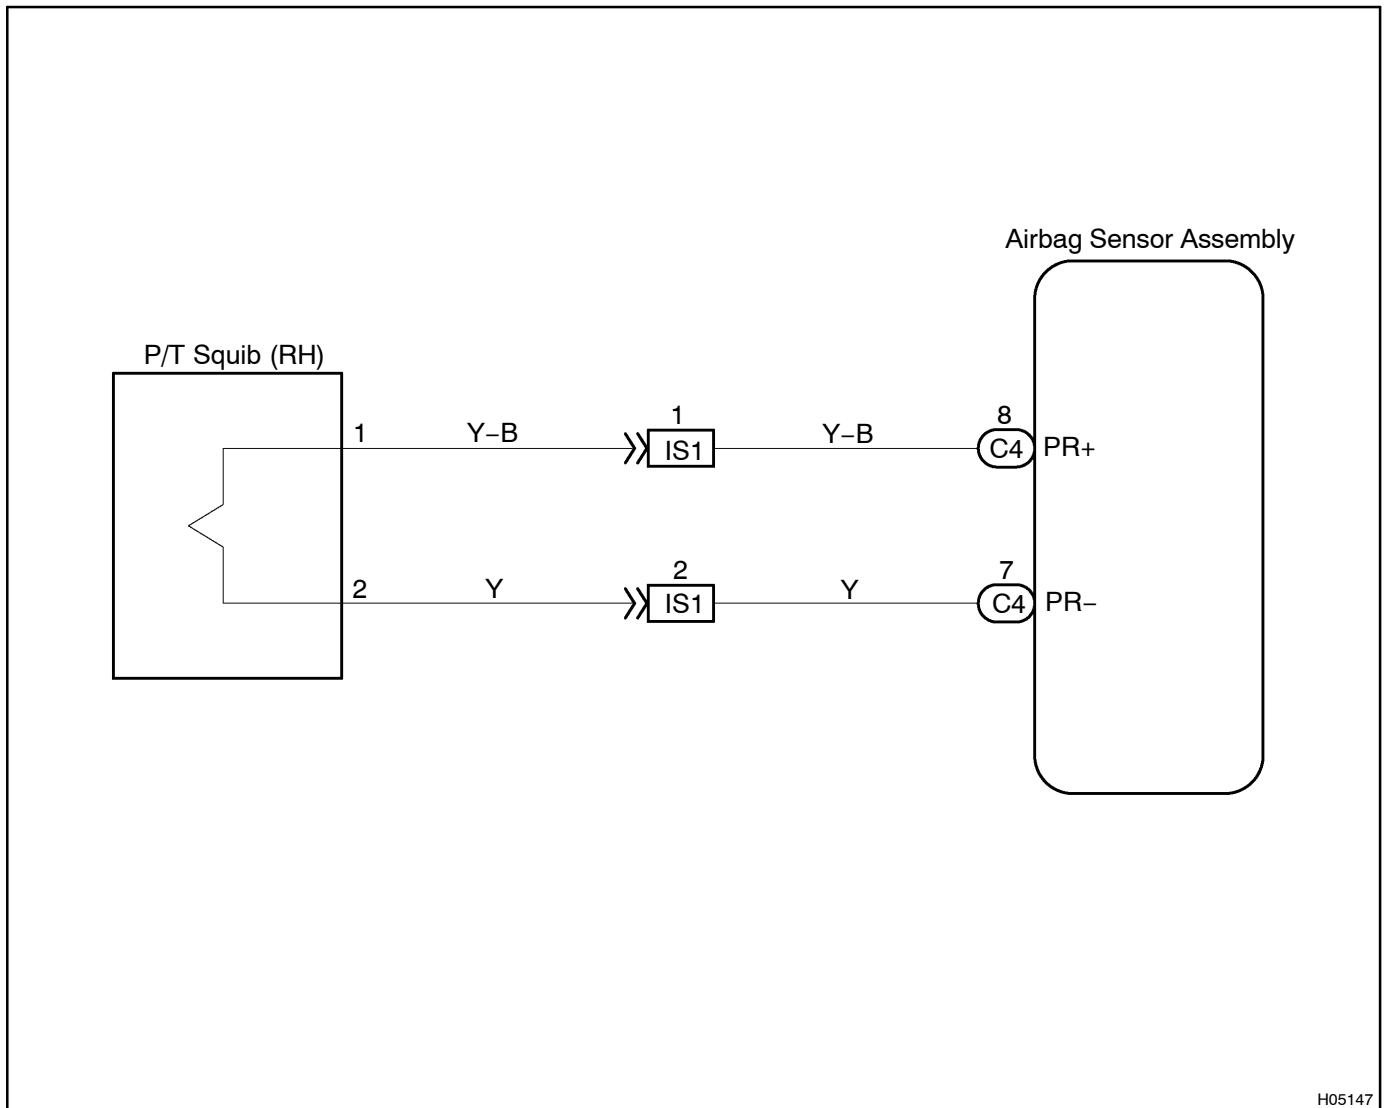


INSPECTION PROCEDURE

 1 Prepare for inspection. (See step 1 on page [DI-445](#))



2 Check P/T squib (RH) circuit.

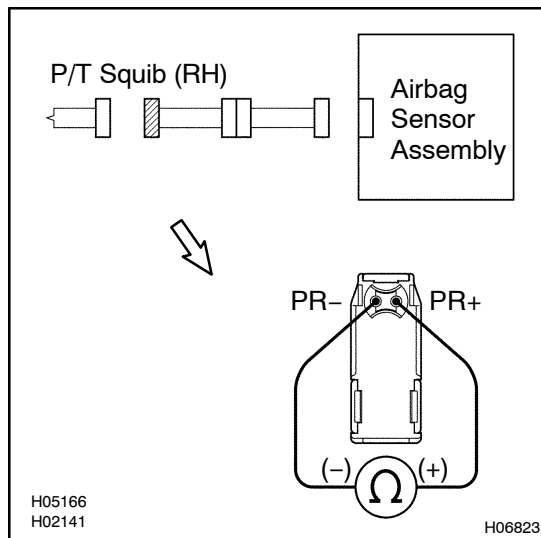**PREPARATION:**

Release airbag activation prevention mechanism of the connector (on the airbag sensor assembly side) between the airbag sensor assembly and the seat belt pretensioner (RH).
(See page [DI-344](#))

CHECK:

For the connector (on the seat belt pretensioner side) between the seat belt pretensioner (RH) and the airbag sensor assembly, measure the resistance between PR+ and PR-.

OK:


Resistance: 1 MΩ or Higher

NG

Go to step 5.

OK

3 Check airbag sensor assembly.

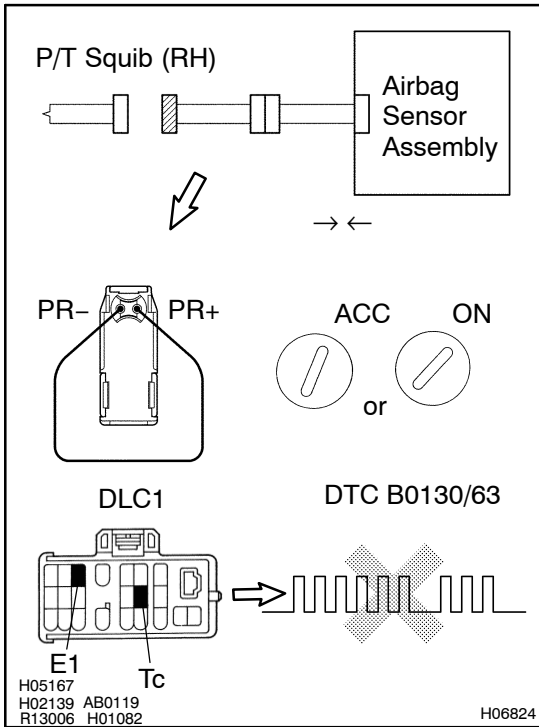

PREPARATION:

- Connect the connector to the airbag sensor assembly.
- Using a service wire, connect PR+ and PR- of the connector (on the seat belt pretensioner side) between the airbag sensor assembly and the seat belt pretensioner (RH).
- Connect negative (-) terminal cable to the battery, and wait at least for 2 seconds.

CHECK:

- Turn ignition switch to ACC or ON and wait at least for 20 seconds.
- Clear DTC stored in memory.
(See page [DI-344](#))
- Turn ignition switch to LOCK, and wait at least for 20 seconds.
- Turn ignition switch to ACC or ON, and wait at least for 20 seconds.
- Check DTC.
(See page [DI-344](#))

OK:

DTC B0130/63 is not output.


HINT:

Codes other than code B0130/63 may be output at this time, but they are not relevant to this check.

NG

Replace airbag sensor assembly.

OK

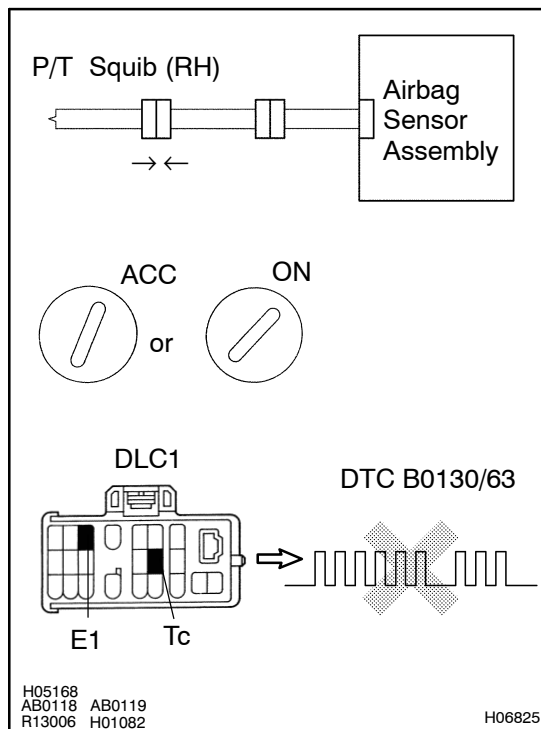4 Check P/T squib (RH).**PREPARATION:**

- Turn ignition switch to LOCK.
- Disconnect negative (-) terminal cable from the battery, and wait at least for 90 seconds.
- Connect the seat belt pretensioner (RH) connector.
- Connect negative (-) terminal cable to the battery, and wait at least for 2 seconds.

CHECK:

- Turn ignition switch to LOCK, and wait at least for 20 seconds.
- Turn ignition switch to ACC or ON, and wait at least for 20 seconds.
- Clear DTC stored in memory.
(See page [DI-344](#))
- Turn ignition switch to LOCK, and wait at least for 20 seconds.
- Turn ignition switch to ACC or ON, and wait at least for 20 seconds.
- Check DTC.
(See page [DI-344](#))


OK:**DTC B0130/63 is not output.****HINT:**

Codes other than code B0130/63 may be output at this time, but they are not relevant to this check.

NG**Replace seat belt pretensioner (RH).****OK**

From the results of the above inspection, the malfunctioning part can now be considered normal. To make sure of this, use the simulation method to check.

5 Check floor wire harness.

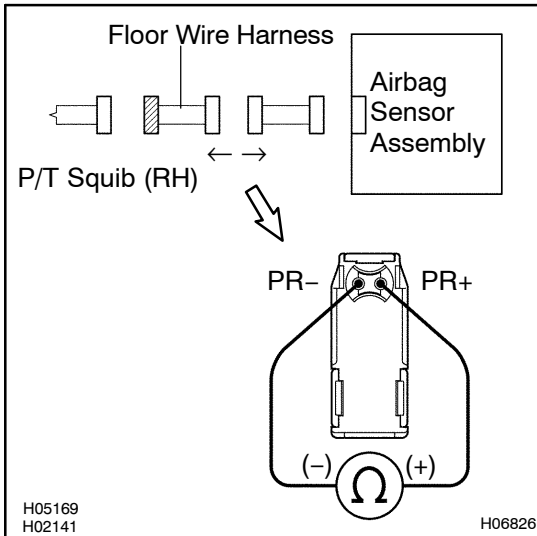

PREPARATION:

- Disconnect floor wire harness connector on the airbag sensor assembly side.
- Release airbag activation prevention mechanism of the floor wire harness connector on the airbag sensor assembly side. (See page [DI-344](#))

CHECK:

For the connector (on the floor wire harness side) between the seat belt pretensioner and the floor wire harness, measure the resistance between PR+ and PR-.

OK:


Resistance: 1 MΩ or Higher

NG

Replace floor wire harness.

OK

6 Check harness between airbag sensor assembly and floor wire harness.

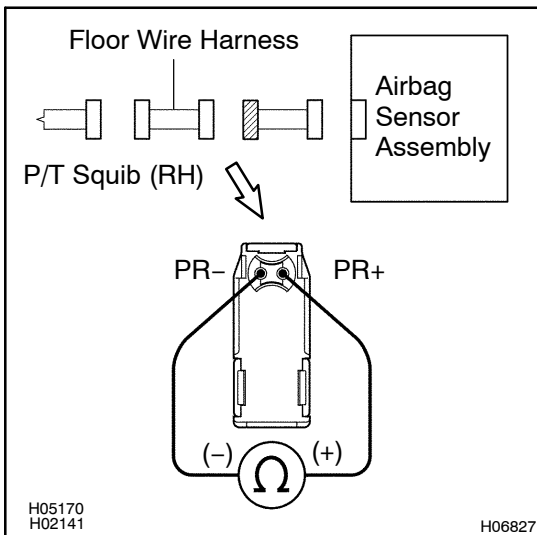

PREPARATION:

Release airbag activation prevention mechanism of the airbag sensor assembly connector. (See page [DI-344](#))

CHECK:

For the connector (on the floor wire harness side) between the airbag sensor assembly and floor wire harness, measure the resistance between PR+ and PR-.

OK:

Resistance: 1 MΩ or Higher

NG

Replace harness and connector between airbag sensor assembly and floor wire harness.

OK

From the results of the above inspection, the malfunctioning part can now be considered normal. To make sure of this, use the simulation method to check.