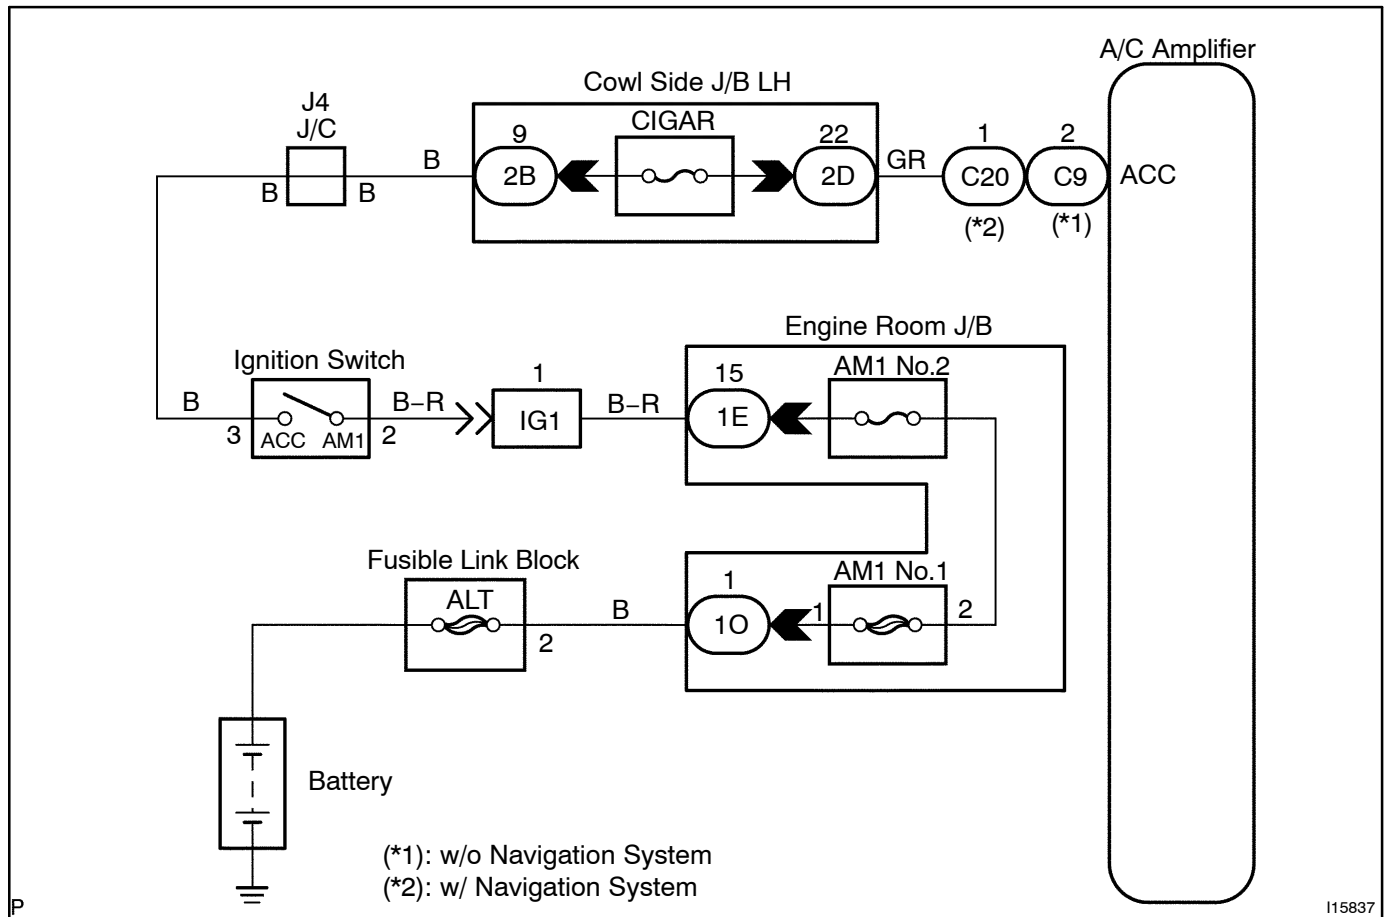


ACC Power Source Circuit

CIRCUIT DESCRIPTION

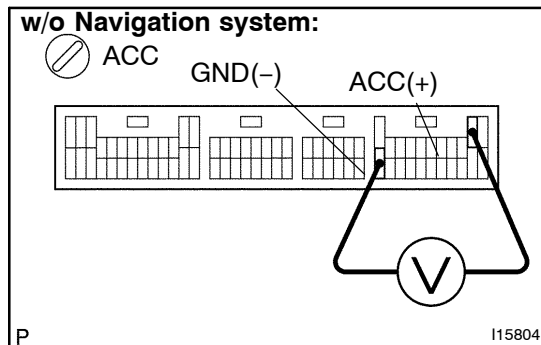
This is the power source for A/C amplifier and servomotors, etc.

WIRING DIAGRAM



INSPECTION PROCEDURE

- | | |
|----------|--|
| 1 | Check voltage between terminals ACC and GND of A/C amplifier connector. |
|----------|--|

**PREPARATION:**

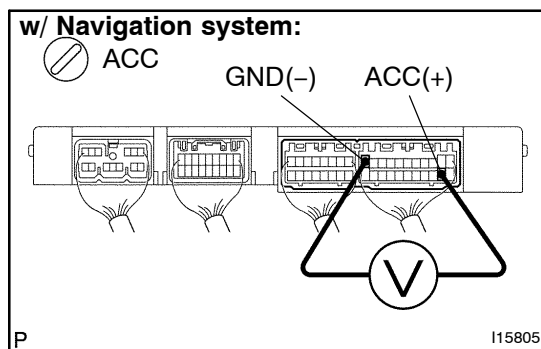
Remove A/C amplifier with connectors still connected.

CHECK:

- (a) Turn ignition switch ON.
- (b) Measure voltage between terminals ACC and GND of A/C amplifier.

OK:

Voltage : Battery positive voltage

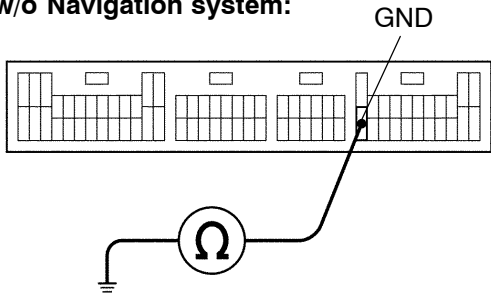


OK

Proceed to next circuit inspection shown on problem symptoms table (See page [DI-891](#)).

NG

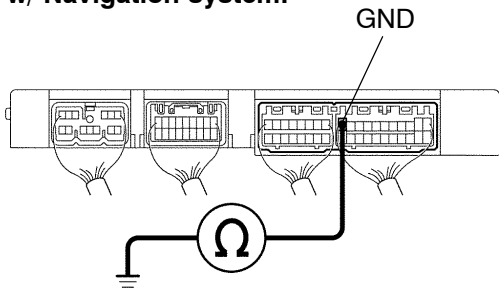
2

Check continuity between terminal GND of A/C amplifier and body ground.**w/o Navigation system:**

I08304

CHECK:

Measure resistance between terminal GND of A/C amplifier and body ground.

OK:**Resistance : 0 Ω (continuity)****NG****Repair or replace harness or connector.****w/ Navigation system:**

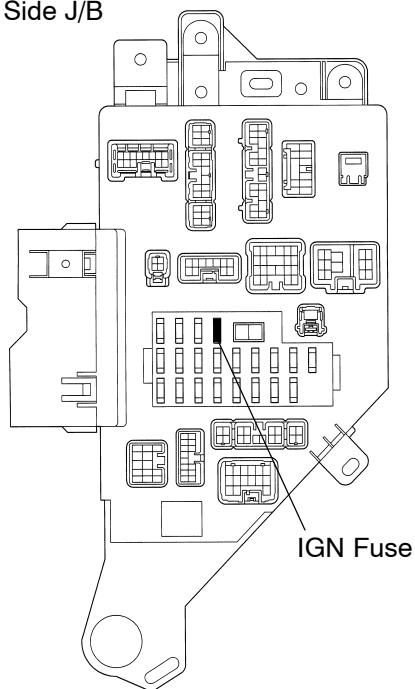
P

I15806

OK

3**Check IGN fuse.**

Cowl Side J/B

**PREPARATION:**

Remove IGN fuse from cowl side J/B.

CHECK:

Check continuity of IGN fuse.

OK:**Continuity****NG****Check for short in all the harness and components connected to the IGN fuse (See attached wiring diagram).****OK****Check and repair harness and connector between A/C amplifier.**