

25. Navigation system cannot be operated with voice recognition.

INSPECTION PROCEDURE

1 Check microphone.

NG

Replace microphone (See page [IN-36](#)).

OK

2 Check overhead J/B (See page [BE-185](#)).

NG

Replace overhead J/B (See page [IN-36](#)).

OK

3 Check wire harness between overhead J/B (microphone) and navigation ECU.

PREPARATION:

Disconnect the overhead J/B and navigation ECU connectors.

CHECK:

Check continuity of the wire harness between terminals of the overhead J/B and those of the navigation ECU0.

OK:

Continuity

NG

Replace or repair wire harness or connector.

OK

Check and replace navigation ECU.