

25. Navigation system cannot be operated with voice recognition.**INSPECTION PROCEDURE****1 Check microphone.****NG****Replace microphone (See page IN-38).****OK****2 Check overhead J/B.****NG****Replace overhead J/B (See page IN-38).****OK****3 Check wire harness between overhead J/B (microphone) and navigation ECU.****PREPARATION:**

Disconnect the overhead J/B and navigation ECU connectors.

CHECK:

Check continuity of the wire harness between terminals of the overhead J/B and those of the navigation ECU.

OK:**Continuity****NG****Replace or repair wire harness or connector.****OK****Check and replace navigation ECU.**