

11. No sound (radio, cassette tape, DVD) can be heard from driver side door speaker only.

INSPECTION PROCEDURE

1 Service check mode.

NG

Troubleshoot for each diagnosis.

OK

2 Check the navigation system voice.

OK

Go to step 5.

NG

3 Check for open or short in harness and connector between navigation ECU and driver side door speaker (see page [DI-1253](#)).

NG

Replace or repair wire harness or connector.

OK

4 Check the driver side door speaker.

NG

Replace the speaker.

OK

Replace the navigation ECU.

5	Check for open or short in harness and connector between navigation ECU and driver side door speaker (see page DI-1253).
---	---

NG

Replace or repair wire harness or connector.

OK

Replace the stereo component amplifier.