


Power source circuit

CIRCUIT DESCRIPTION

This circuit provides power to operate the Transponder Key ECU.

WIRING DIAGRAM

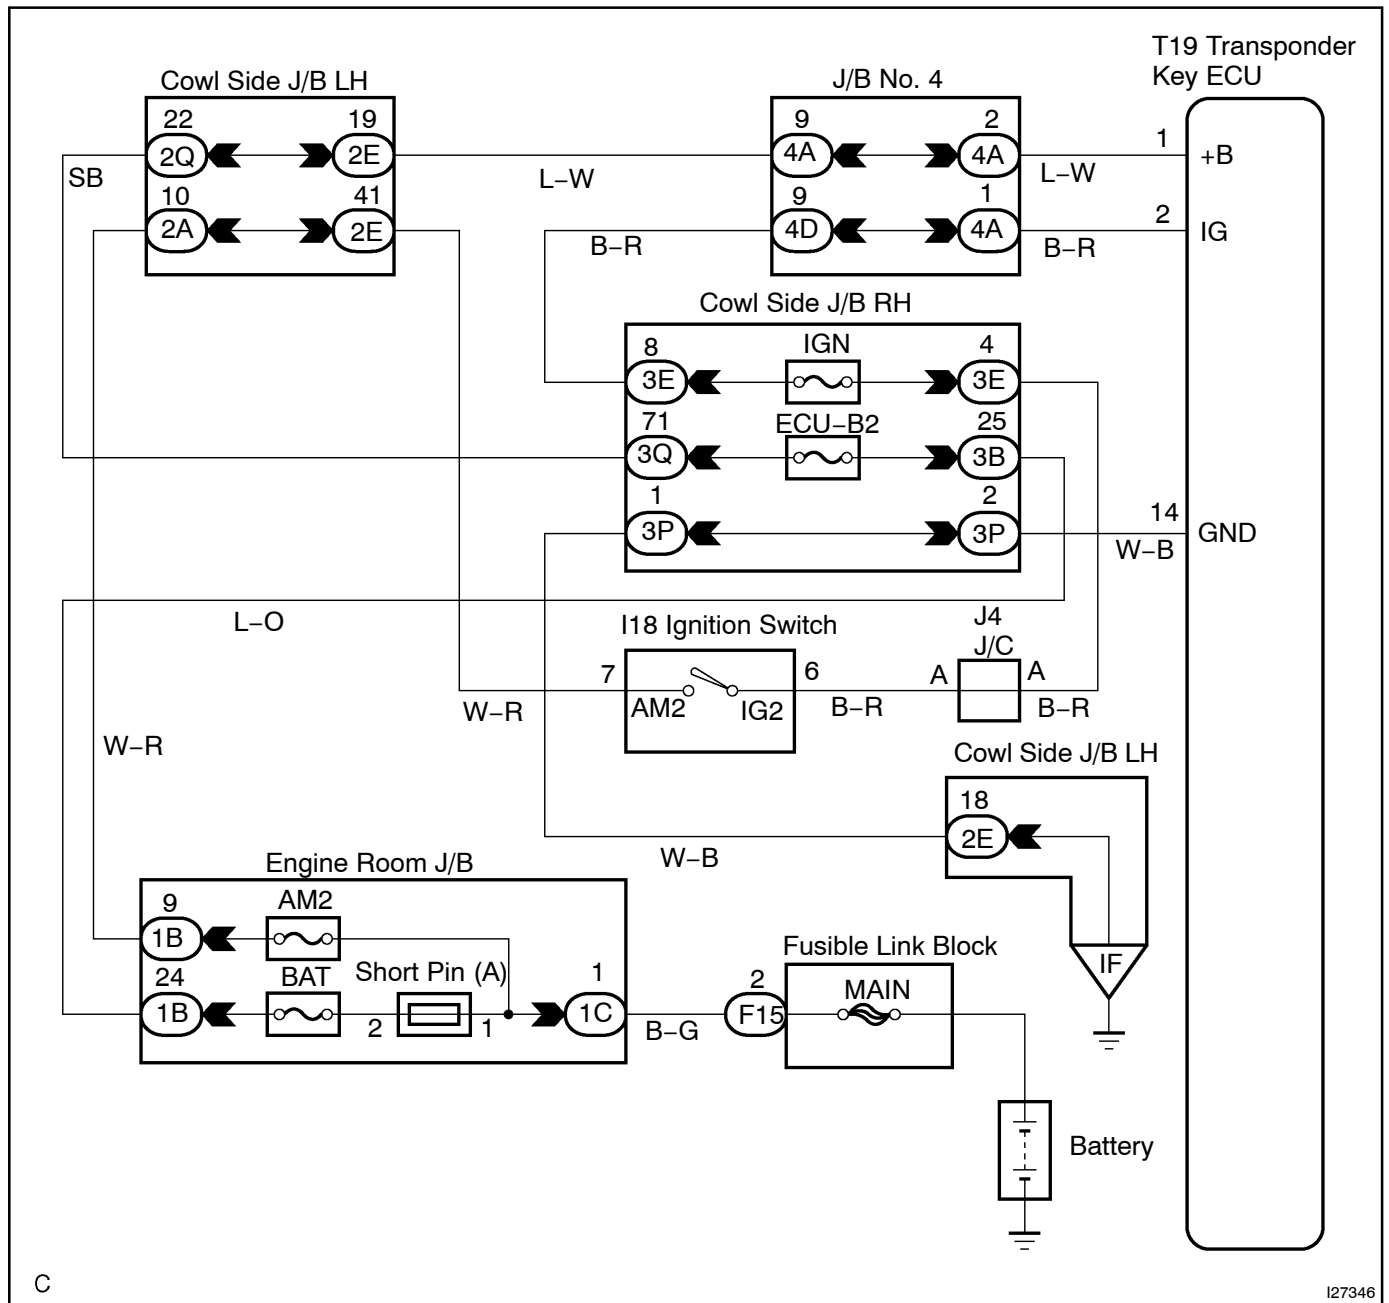

C

I27346

INSPECTION PROCEDURE

1	Check fuse.
---	-------------

CHECK:

Check continuity of fuse.

OK:

Continuity

NG

Replace the failure fuse.

OK

2	Check voltage between terminals IG, +B and GND of transponder key ECU connector.
---	--

PREPARATION:

Turn the ignition switch ON.

CHECK:

Measure voltage between terminals IG and GND.

OK:

Voltage: 10 – 14 V

PREPARATION:

- (a) Turn the ignition switch OFF.
- (b) Disconnect the transponder key ECU connector.

CHECK:

Measure voltage between terminals +B and GND.

OK:

Voltage: 10 – 14 V

OK

Proceed to next circuit inspection shown in problem symptoms table (See page [DI-1014](#)).

NG

3	Check wire harness and connector between transponder key ECU and body ground (See page IN-36).
---	---

NG

Repair or replace wire harness or connector.

OK

Proceed to next circuit inspection shown on problem symptom table (See page [DI-1014](#)).