

## 11. No sound (radio, cassette tape, DVD) can be heard from driver side door speaker only.

### INSPECTION PROCEDURE

1 Service check mode.

NG

Troubleshoot for each diagnosis.

OK

2 Check the navigation system voice.

OK

Go to step 5.

NG

3 Check for open or short in harness and connector between navigation ECU and driver side door speaker (see page [DI-1261](#)).

NG

Replace or repair wire harness or connector.

OK

4 Check the driver side door speaker.

NG

Replace the speaker.

OK

Replace the navigation ECU.

|   |                                                                                                                                           |
|---|-------------------------------------------------------------------------------------------------------------------------------------------|
| 5 | Check for open or short in harness and connector between navigation ECU and driver side door speaker (see page <a href="#">DI-1261</a> ). |
|---|-------------------------------------------------------------------------------------------------------------------------------------------|

NG

Replace or repair wire harness or connector.

OK

Replace the stereo component amplifier.