

DTC P0133 Heated Oxygen Sensor Circuit Slow Response (Bank 1 Sensor 1)

CIRCUIT DESCRIPTION

Refer to "Insufficient Coolant Temp. for Closed Loop Fuel Control" on page [EG-263](#).

DTC No.	Diagnostic Trouble Code Detecting Condition	Trouble Area
P0133	Response time for the heated oxygen sensor's voltage output to change from rich to lean, or from lean to rich, is 1 sec. or more during idling after the engine is warmed up (2 trip detection logic)	Heated oxygen sensor

HINT: Sensor 1 refers to the sensor closer to the engine body.

INSPECTION PROCEDURE

1 Are there any other codes (besides DTC P0133) being output?

NO

YES

Go to relevant diagnostic trouble code chart.

Replace heated oxygen sensor.