

SERVICE BULLETIN

APPLICABILITY

ALL LEGACY MODELS EQUIPPED WITH
ANTI-LOCK BRAKES

DATE


08-15-

SUBJECT:

SECONDARY SIDE BLEEDING OF A.B.S. HYDRAULIC
CONTROL UNIT

When performing secondary side bleeding of the A.B.S. Hydraulic Control Unit, make certain you are referencing the connector (F9) at the control unit correctly.

The locking claw at the forward part of the large connector should be at the top or 12 o'clock position. This will properly locate pins 1, 2, 11, and 12 which are used during the bleeding process. See diagram below. If connector F9 is not referenced correctly, pin 10, which is not used, may be mistaken for one of the pins used in the bleeding process.

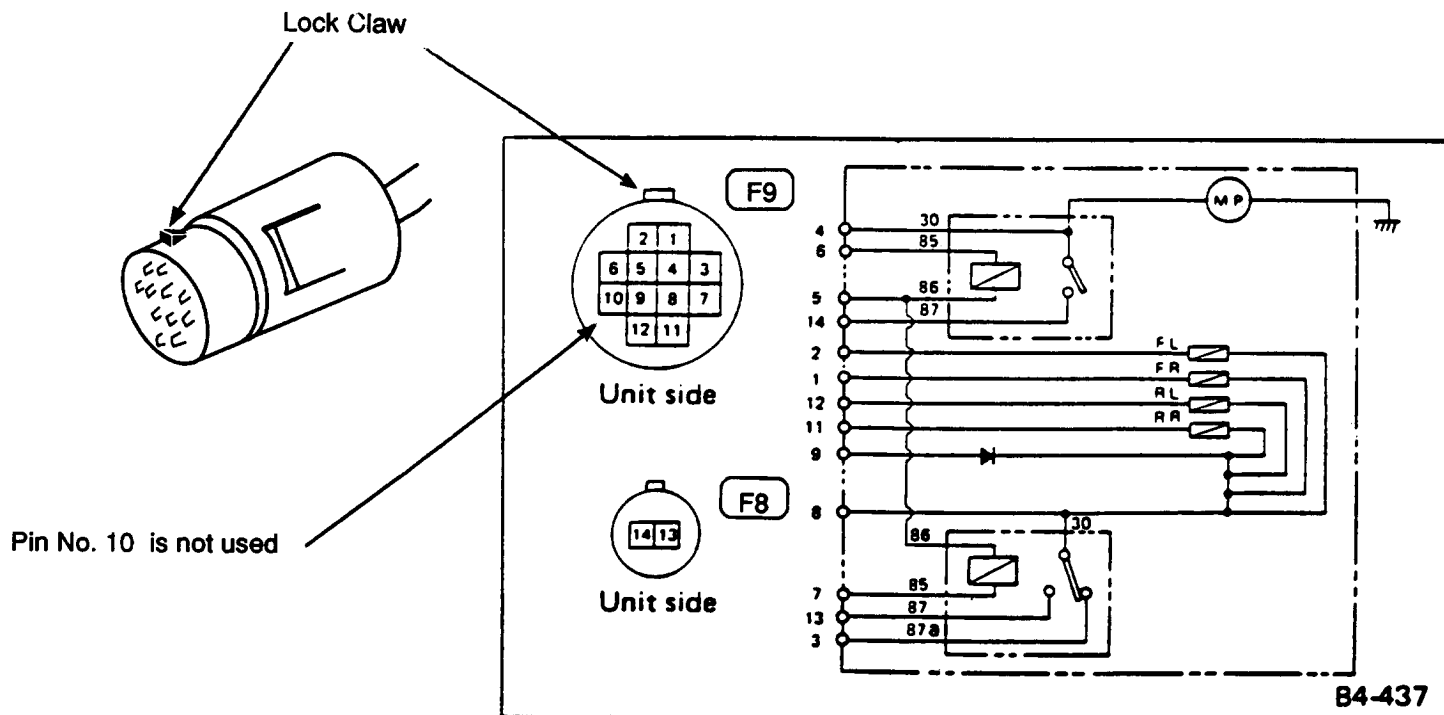

CAUTION

VEHICLE SERVICING PERFORMED BY UNTRAINED PERSONS COULD
RESULT IN SERIOUS INJURY TO THOSE PERSONS OR TO OTHERS.

Subaru Service Bulletins are intended for use by professional technicians ONLY. They are written to inform those technicians of conditions that may occur in some vehicles, or to provide information that could assist in the proper servicing of the vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do the job correctly and safely. If a condition is described, DO NOT assume that this Service Bulletin applies to your vehicle, or that your vehicle will have that condition.