


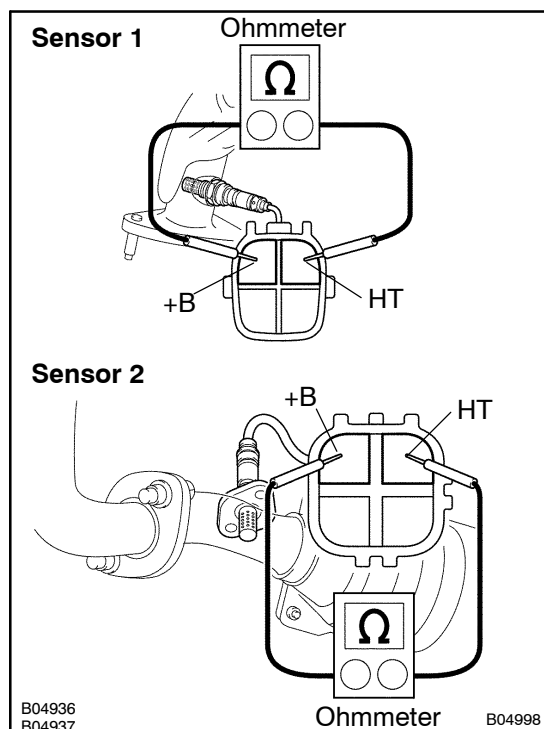

INSPECTION

1. INSPECT HEATER RESISTANCE OF HEATED OXYGEN SENSORS

- Disconnect the oxygen sensor connector.
- Using an ohmmeter, measure the resistance between terminal +B and HT.

Resistance: 11 – 16 Ω at 20°C (68°F)

If the resistance is not as specified, replace the sensor.

Torque:

44 N·m (450 kgf·cm, 32 ft·lbf) for sensor 1

20 N·m (200 kgf·cm, 14 ft·lbf) for sensor 2

- Reconnect the oxygen sensor connector.
- ### 2. INSPECT OPERATION OF HEATED OXYGEN SENSORS (See pages [DI-106](#) and [DI-138](#))