SERVICE BULLETIN

MITSUBISHI MOTORS

QUALITY INFORMATION ANALYSIS
OVERSEAS SERVICE DEPT. MITSUBISHI MOTORS CORPORATION

SERVICE BULLETIN	NO.: MSB-95E54-003	
	DATE: 1996-02-15	<MODEL> (EC,EXP)CARISMA <M/Y> 96-00
SUBJECT: CHANGE OF WIRING HARNESSES		
GROUP: CHASSIS ELECTRICAL	DRAFTNO.: 95-CH-007	
INFORMATION	OVERSEAS SERVICE DEPT	R. Usami R. USAMI - MANAGER QUALITY INFORMATION ANALYSIS

DRAFTNO.: 95-CH-007
95-CH-008

1. Description:

This Service Bulletin informs you of changes in the following wiring harnesses and circuits.

(1) Change of wire colors
- A/T
- HEADLAMP LEVELING SYSTEM
- FRONT FOG LAMP
- REAR FOG LAMP
- TURN-SIGNAL LAMP AND HAZARD WARNING LAMP
- HORN
- CENTRAL DOOR LOCKING SYSTEM
- POWER WINDOWS
- REAR WIPER AND WASHER
- HEADLAMP WASHER
- REMOTE CONTROLLED MIRROR
- ANTI-LOCK BRAKING SYSTEM (ABS)
- IMMOBILIZER SYSTEM

(2) Change of wire diameters and colors
- WINDSHIELD WIPER AND WASHER

(3) Changes in circuits
- A/C CONTROL PANEL AND ECU ASSEMBLY TERMINAL NO. 18
- ABS-ECU TERMINAL NO. 14

3. Details:

ELC 4-SPEED AUTOMATIC TRANSMISSION (CONTINUED)

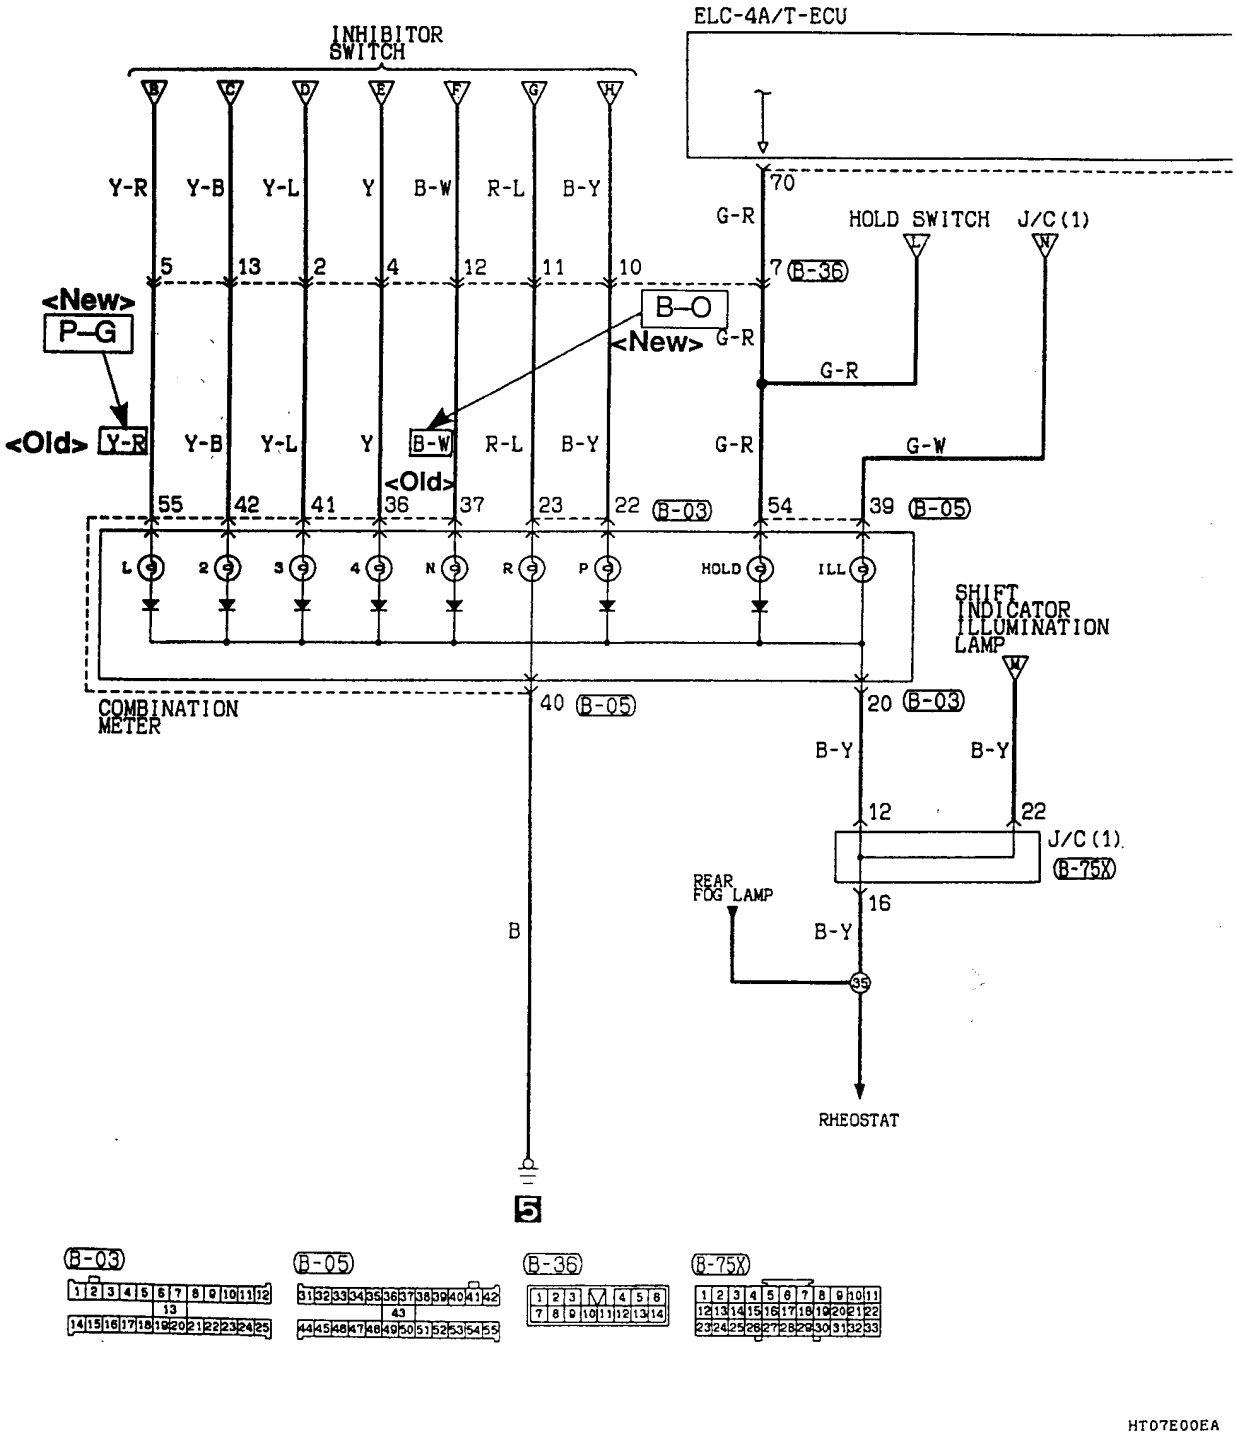

HT07E00EA

FRONT FOG LAMP

90101190044

Vehicles without daytime running lamp

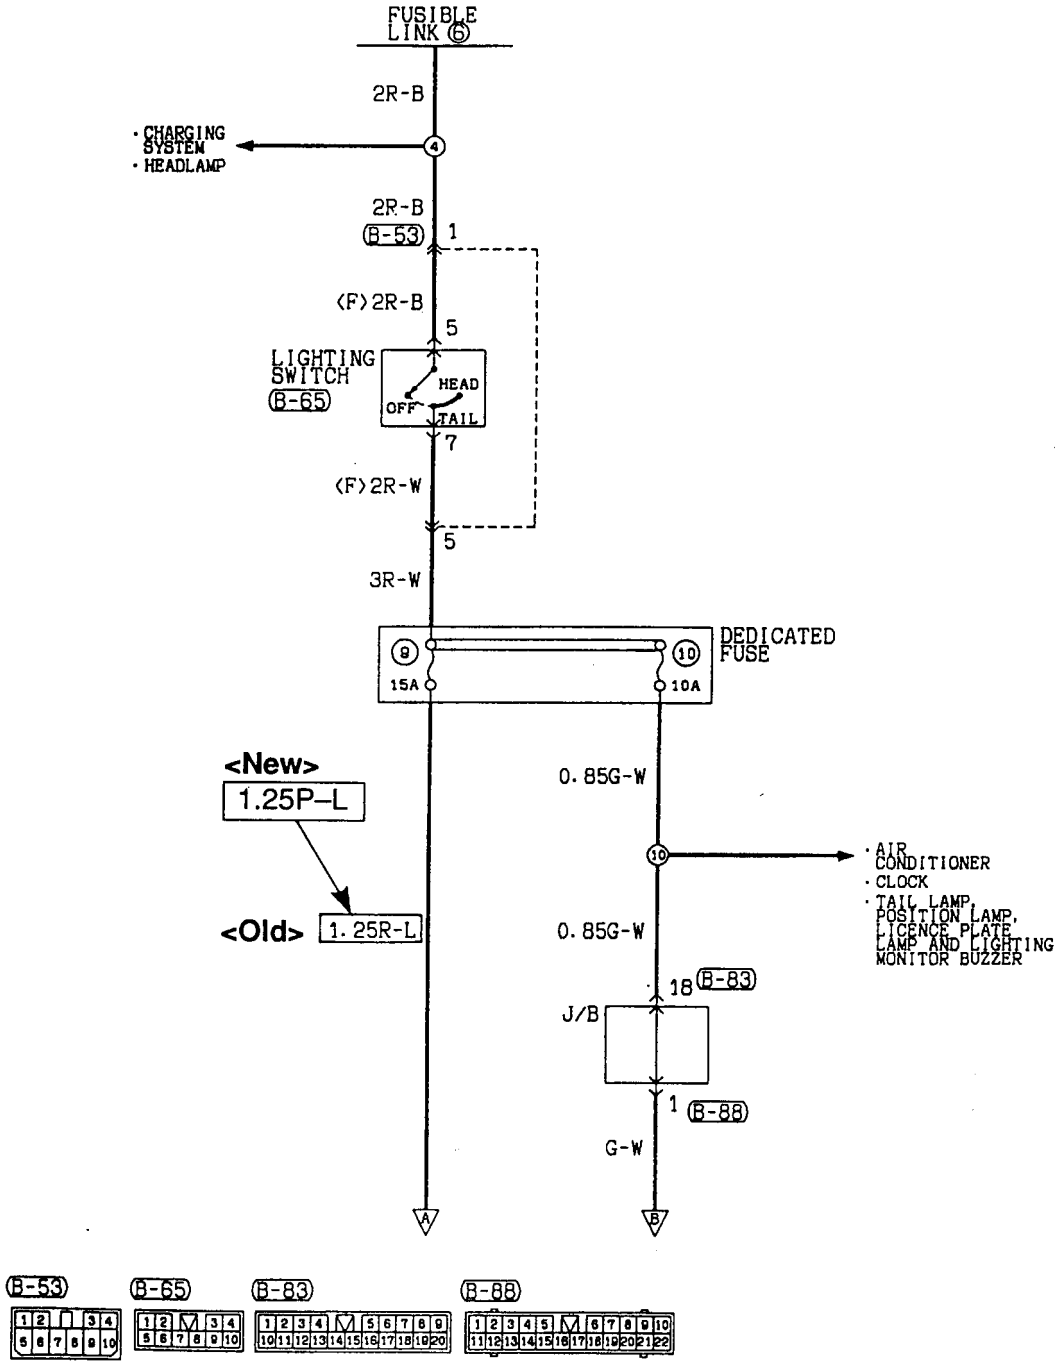

HT08E05AA

REAR FOG LAMP

90101200051

Vehicles with daytime running lamp

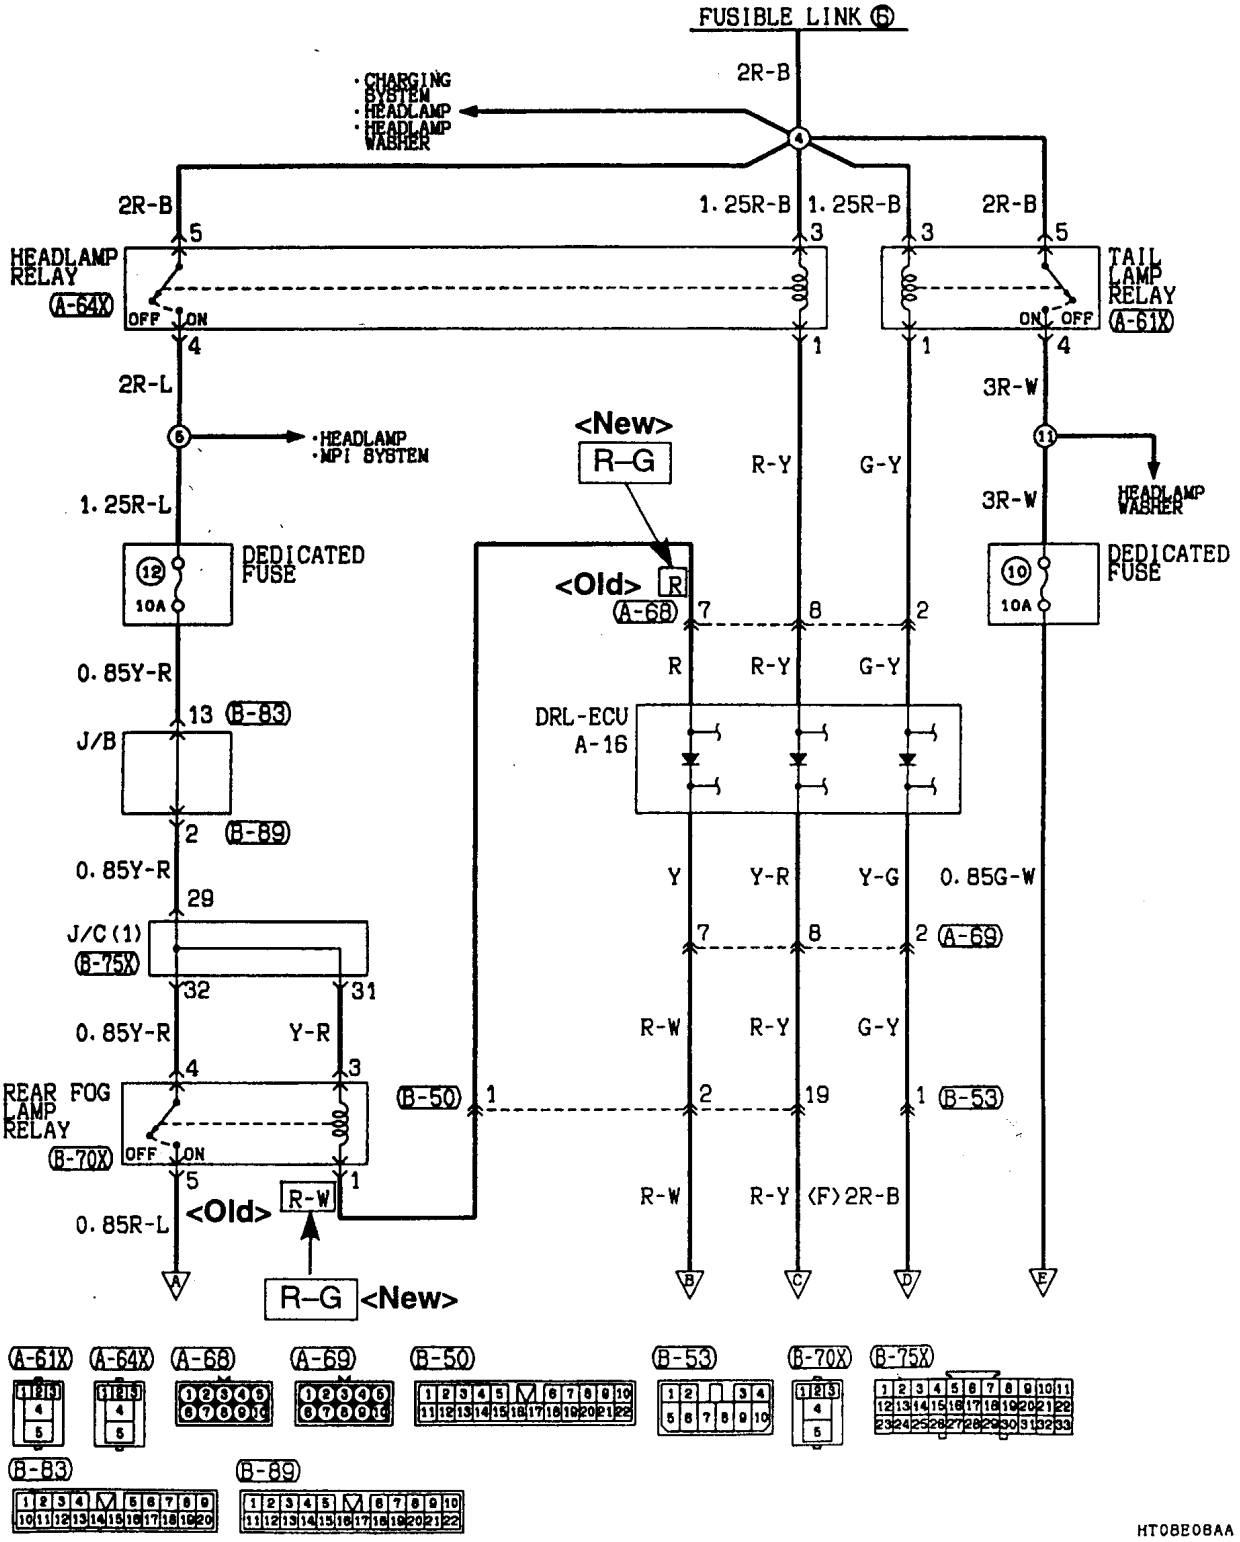

HT08E08AA

HORN

90100330041

Vehicles without SRS

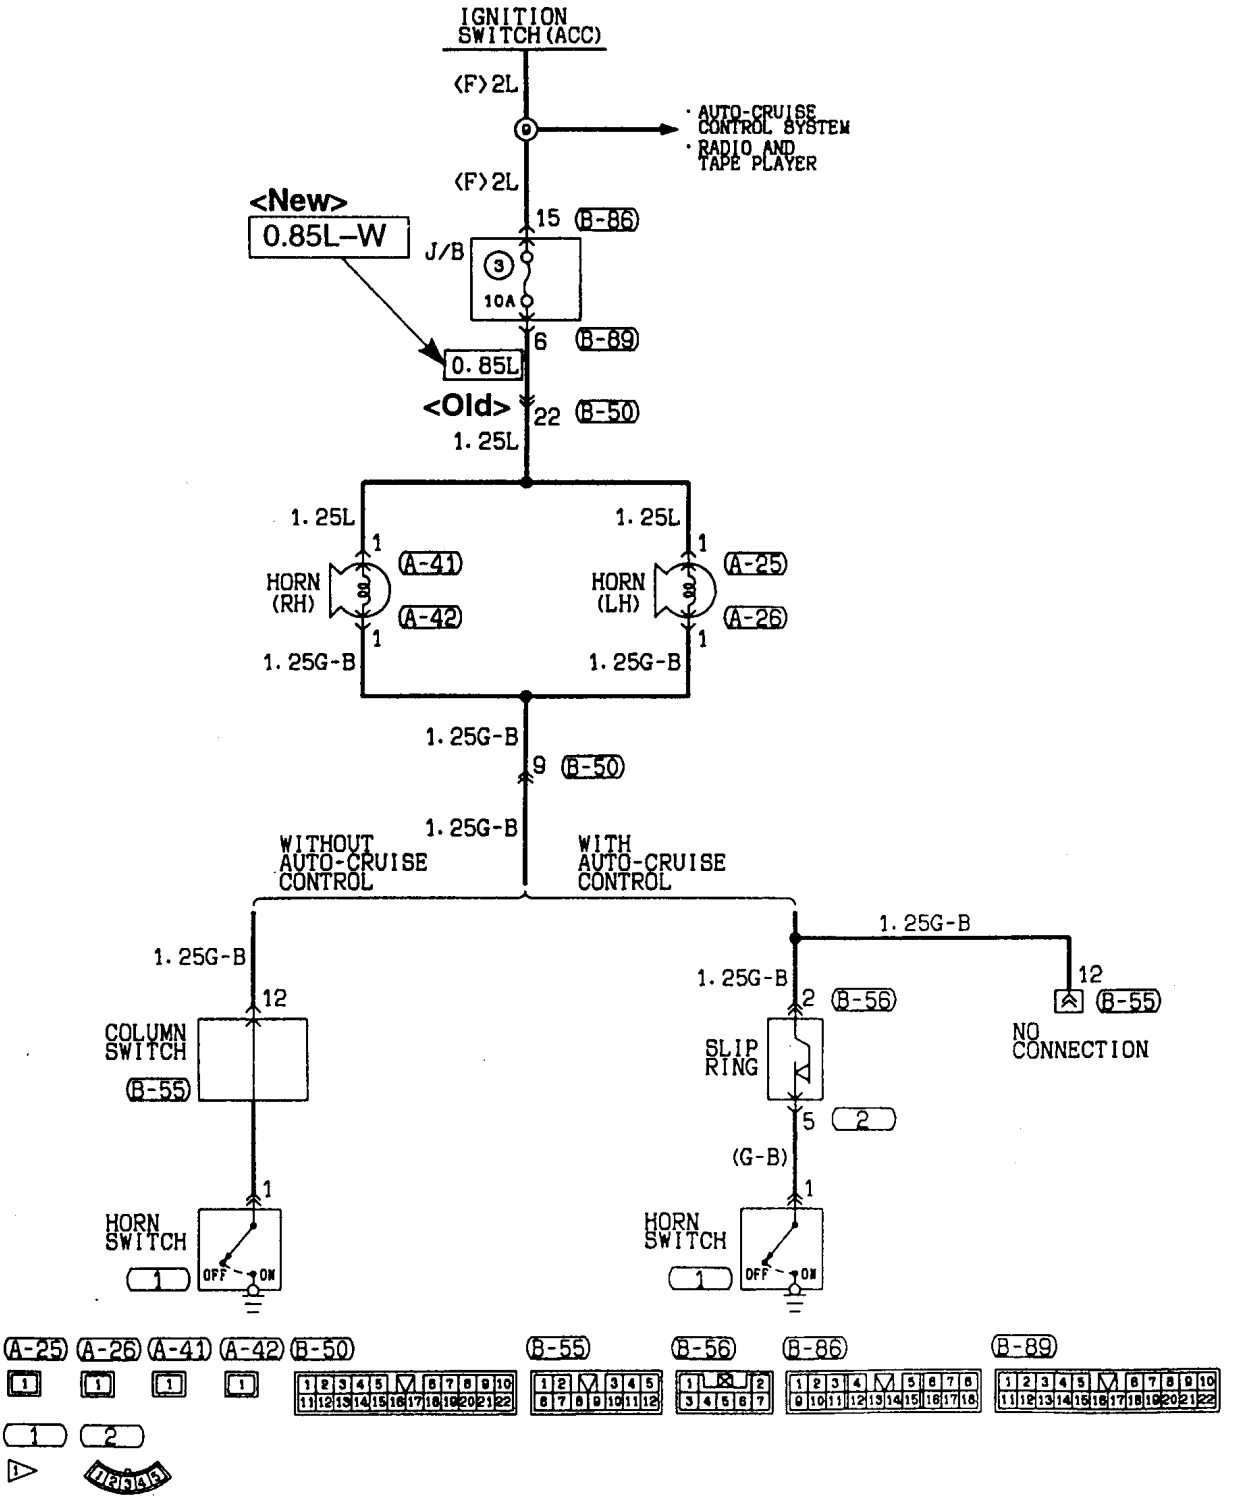

HT09E03AA

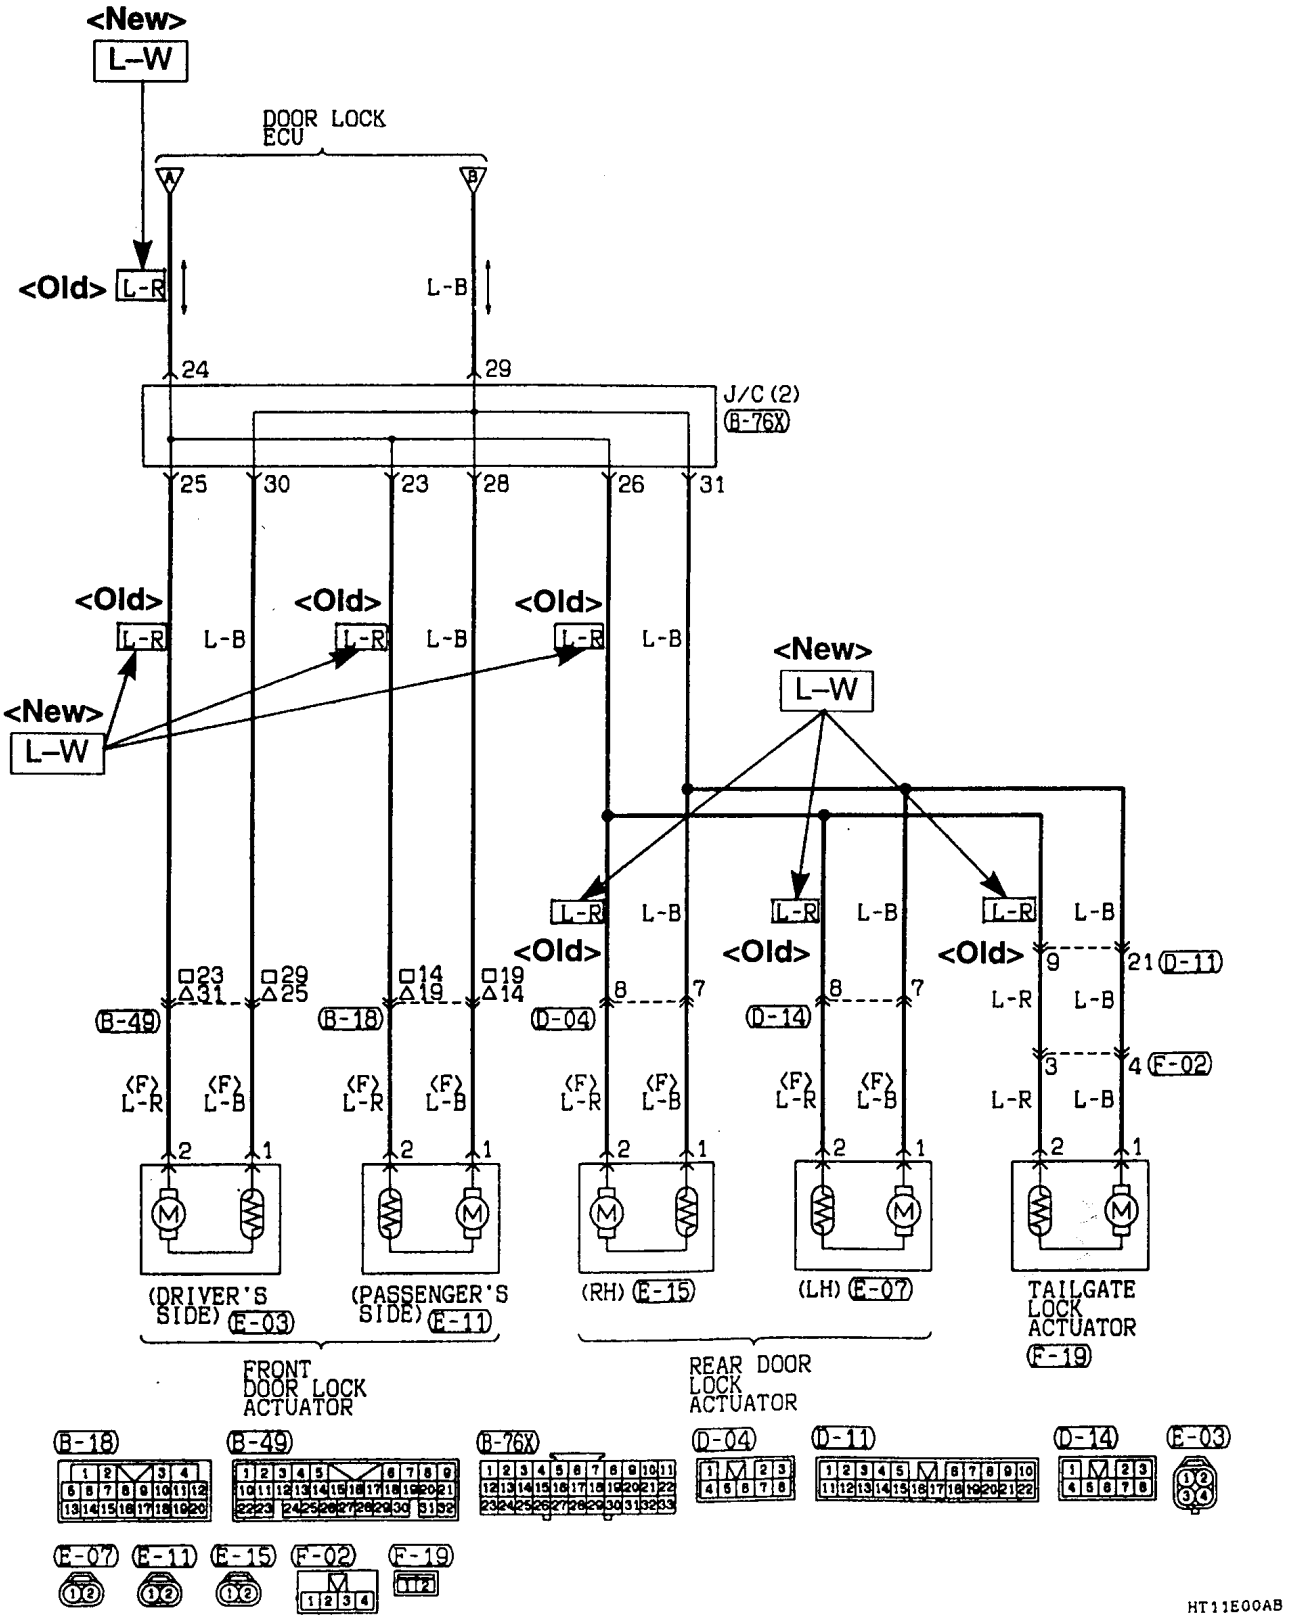
<New>
L–W
DOOR LOCK ECU
<Old> L-R
L-B
24
29
J/C (2) B-76X
25 30 23 28 26 31
<Old> <Old> <Old>
L-R L-B L-R L-B L-R L-B
<New>
L–W
<New>
L–W
L-R L-B L-R L-B L-R L-B
<Old> <Old> <Old>
□23 △31 □29 △25
□14 △19 □19 △14
8 7 9 21 D-11
B-49 B-18 D-04 D-14
3 4 F-02
(F) L-R (F) L-B
2 1
(DRIVER'S SIDE) E-03
(PASSENGER'S SIDE) E-11
(RH) E-15
(LH) E-07
TAILGATE LOCK ACTUATOR F-19
FRONT DOOR LOCK ACTUATOR
REAR DOOR LOCK ACTUATOR
B-18 B-49 B-76X D-04 D-11 D-14 E-03
E-07 E-11 E-15 F-02 F-19
HT11E00AB

POWER WINDOWS

90100460047

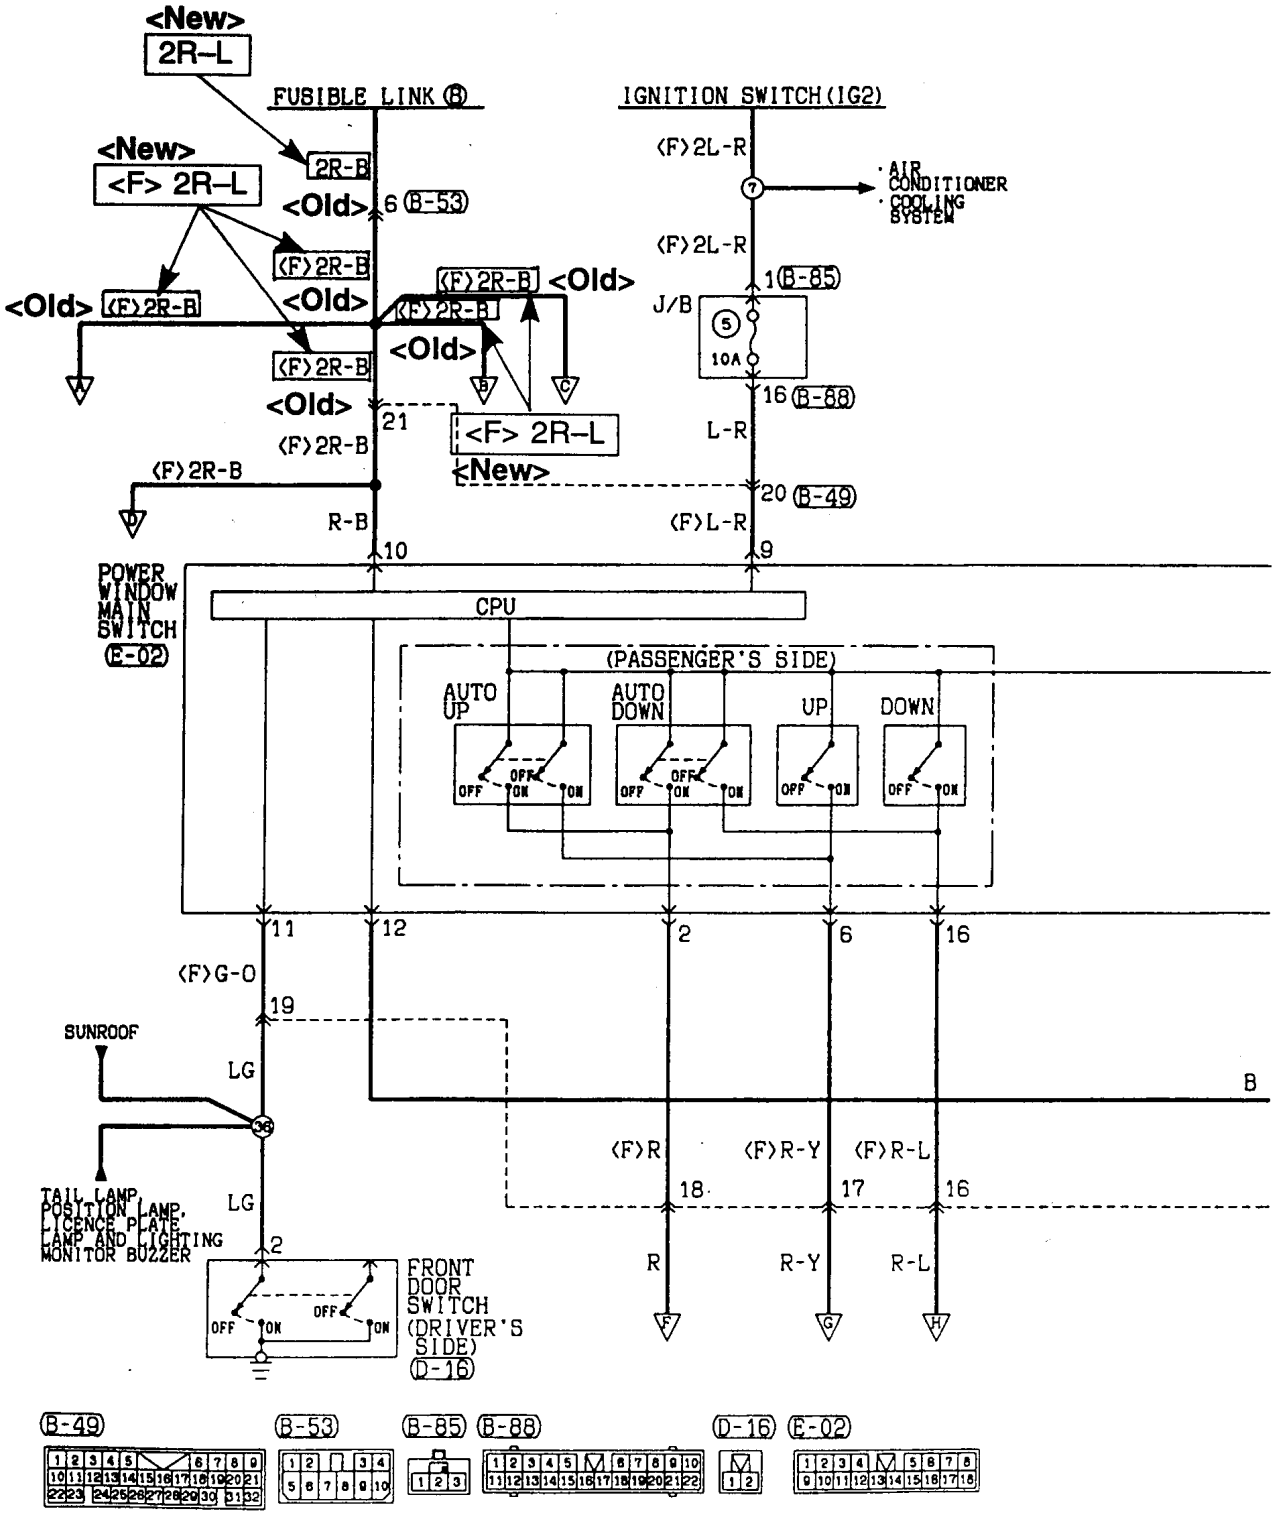

HT11E02AA

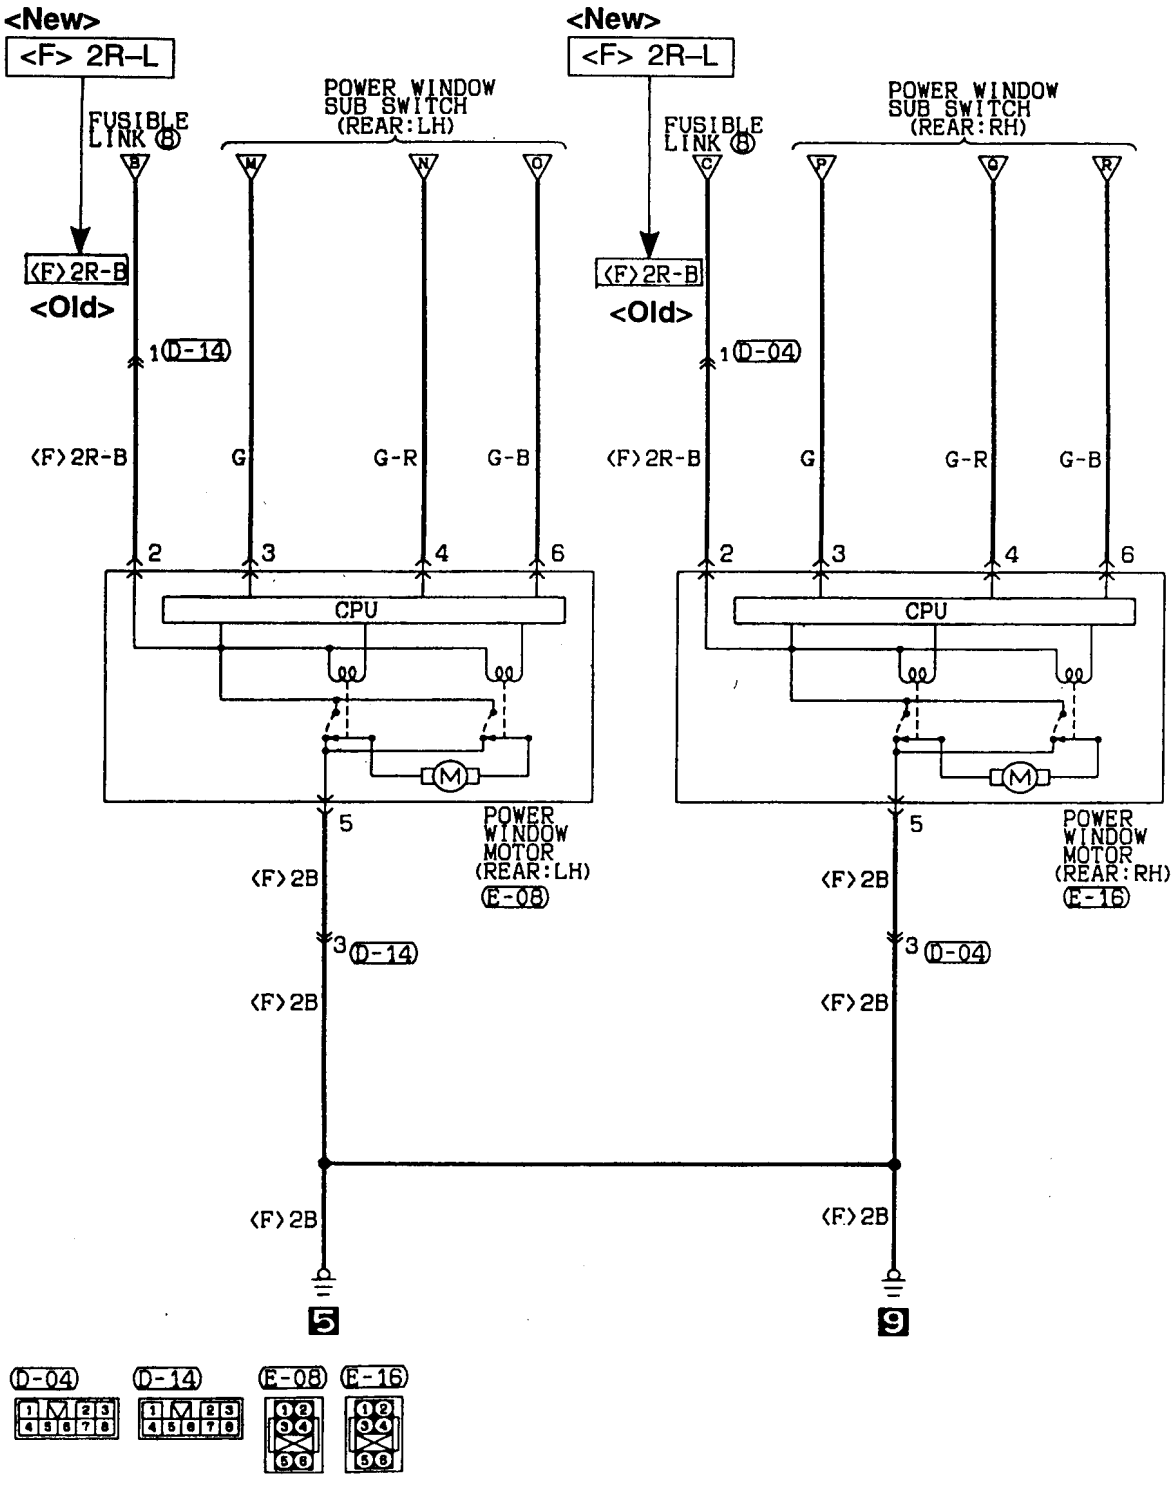
<New>
<F> 2R-L
FUSIBLE LINK ⑧
POWER WINDOW SUB SWITCH (REAR:LH)
B
W
W
O
⟨F⟩2R-B
<Old>
1 D-14
⟨F⟩2R-B
G
G-R
G-B
2
3
4
6
CPU
M
5
POWER WINDOW MOTOR (REAR:LH)
E-08
⟨F⟩2B
3 D-14
⟨F⟩2B
⟨F⟩2B
5
<New>
<F> 2R-L
FUSIBLE LINK ⑧
POWER WINDOW SUB SWITCH (REAR:RH)
C
P
Q
R
⟨F⟩2R-B
<Old>
1 D-04
⟨F⟩2R-B
G
G-R
G-B
2
3
4
6
CPU
M
5
POWER WINDOW MOTOR (REAR:RH)
E-16
⟨F⟩2B
3 D-04
⟨F⟩2B
⟨F⟩2B
9
D-04
D-14
E-08
E-16

HT11F02CB

WINDSHIELD WIPER AND WASHER

90100610046

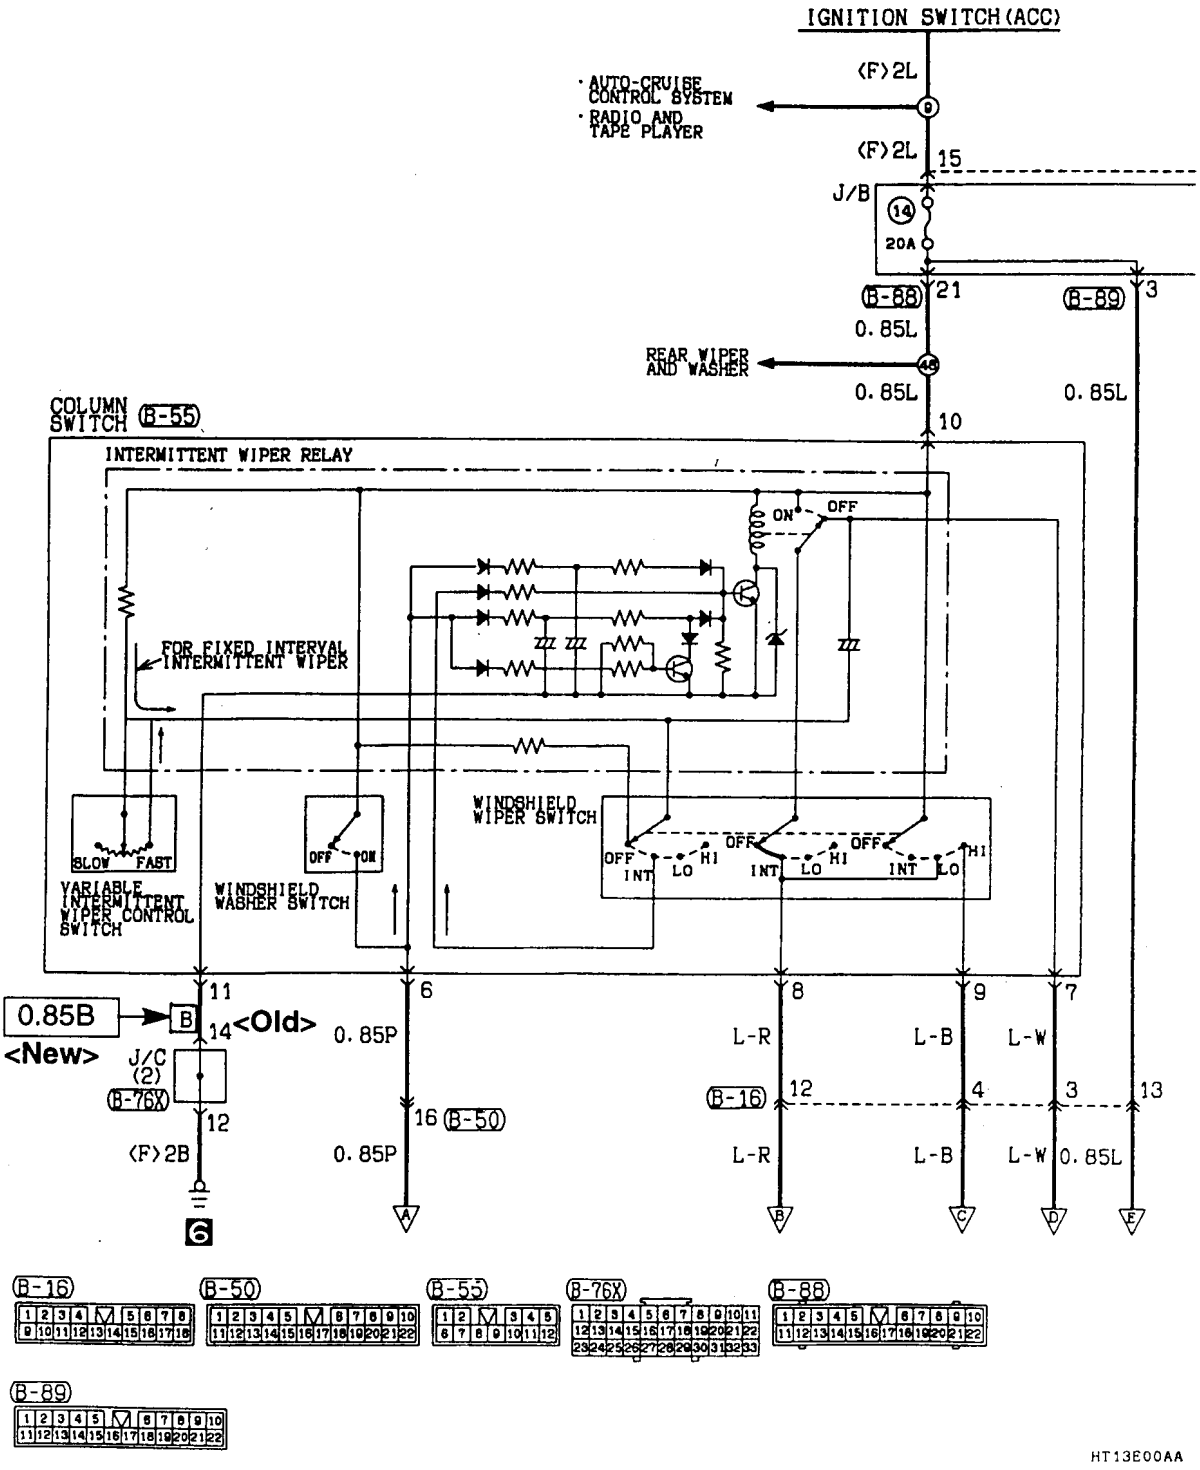

REAR WIPER AND WASHER

90100820070

Vehicles without intermittent wiper

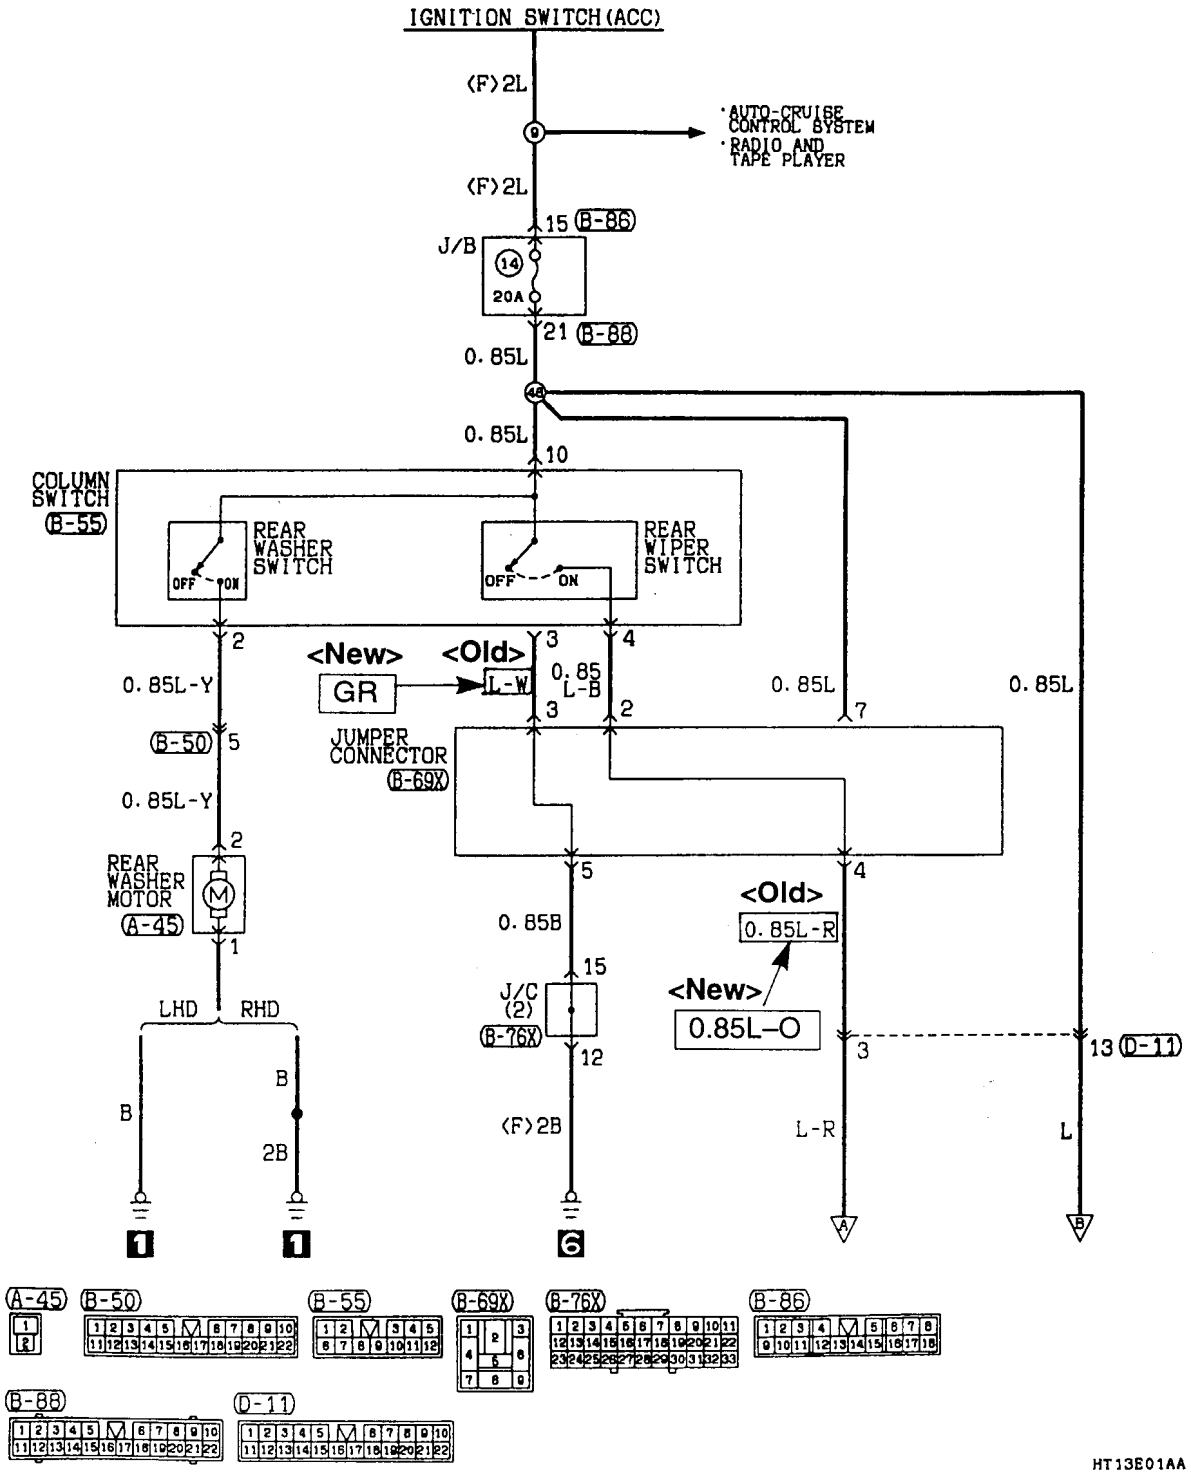

HEADLAMP WASHER

90100830042

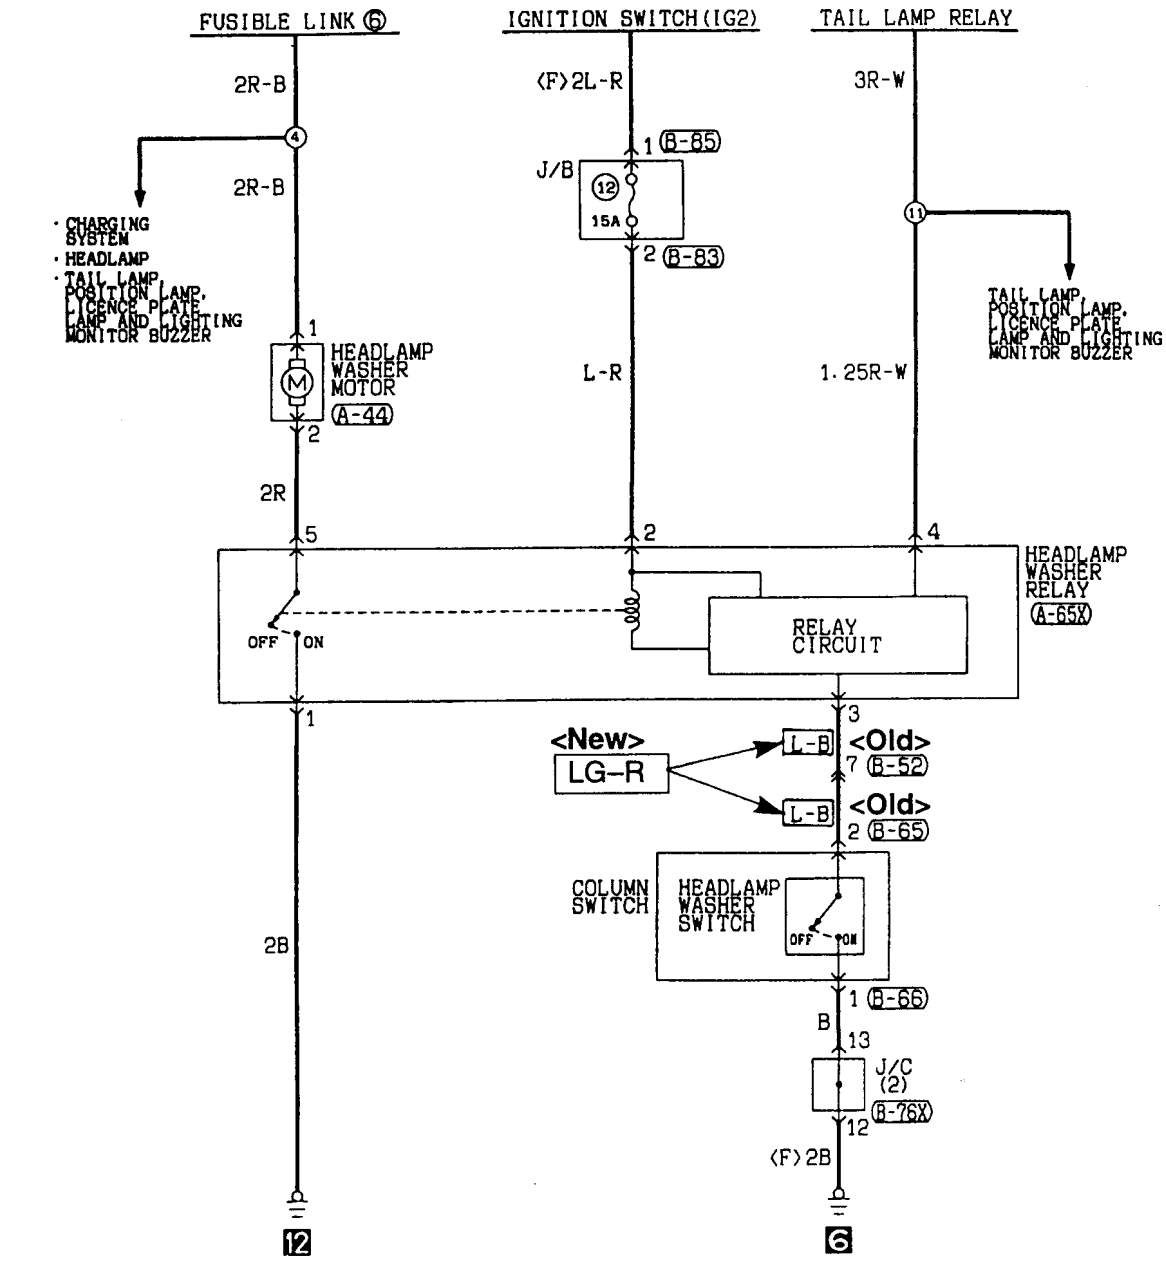

HT13E03AA

- For English Page 4–168
- For Spanish, French, German, Dutch and Swedish Page 4–166

ANTI-LOCK BRAKING SYSTEM (ABS)

90100840117

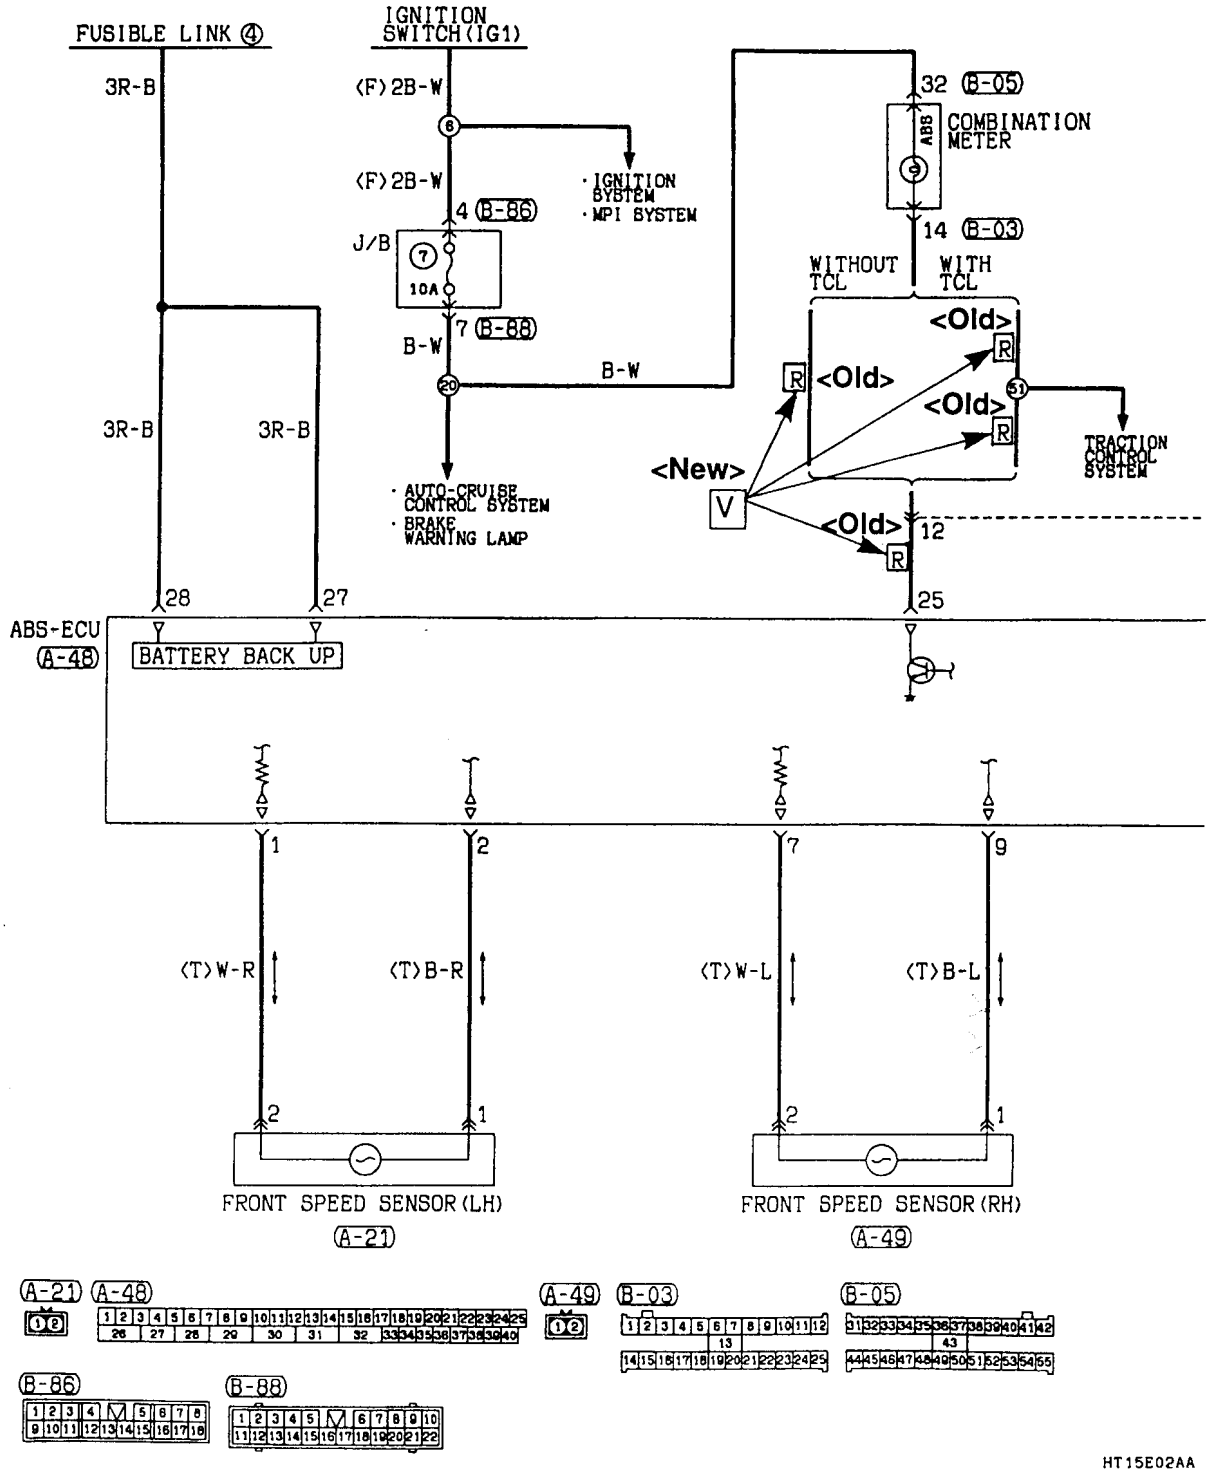

HT15E02AA

- For English Page 4–170
- For Spanish, French, German, Dutch and Swedish Page 4–168

ANTI-LOCK BRAKING SYSTEM (ABS) (CONTINUED)

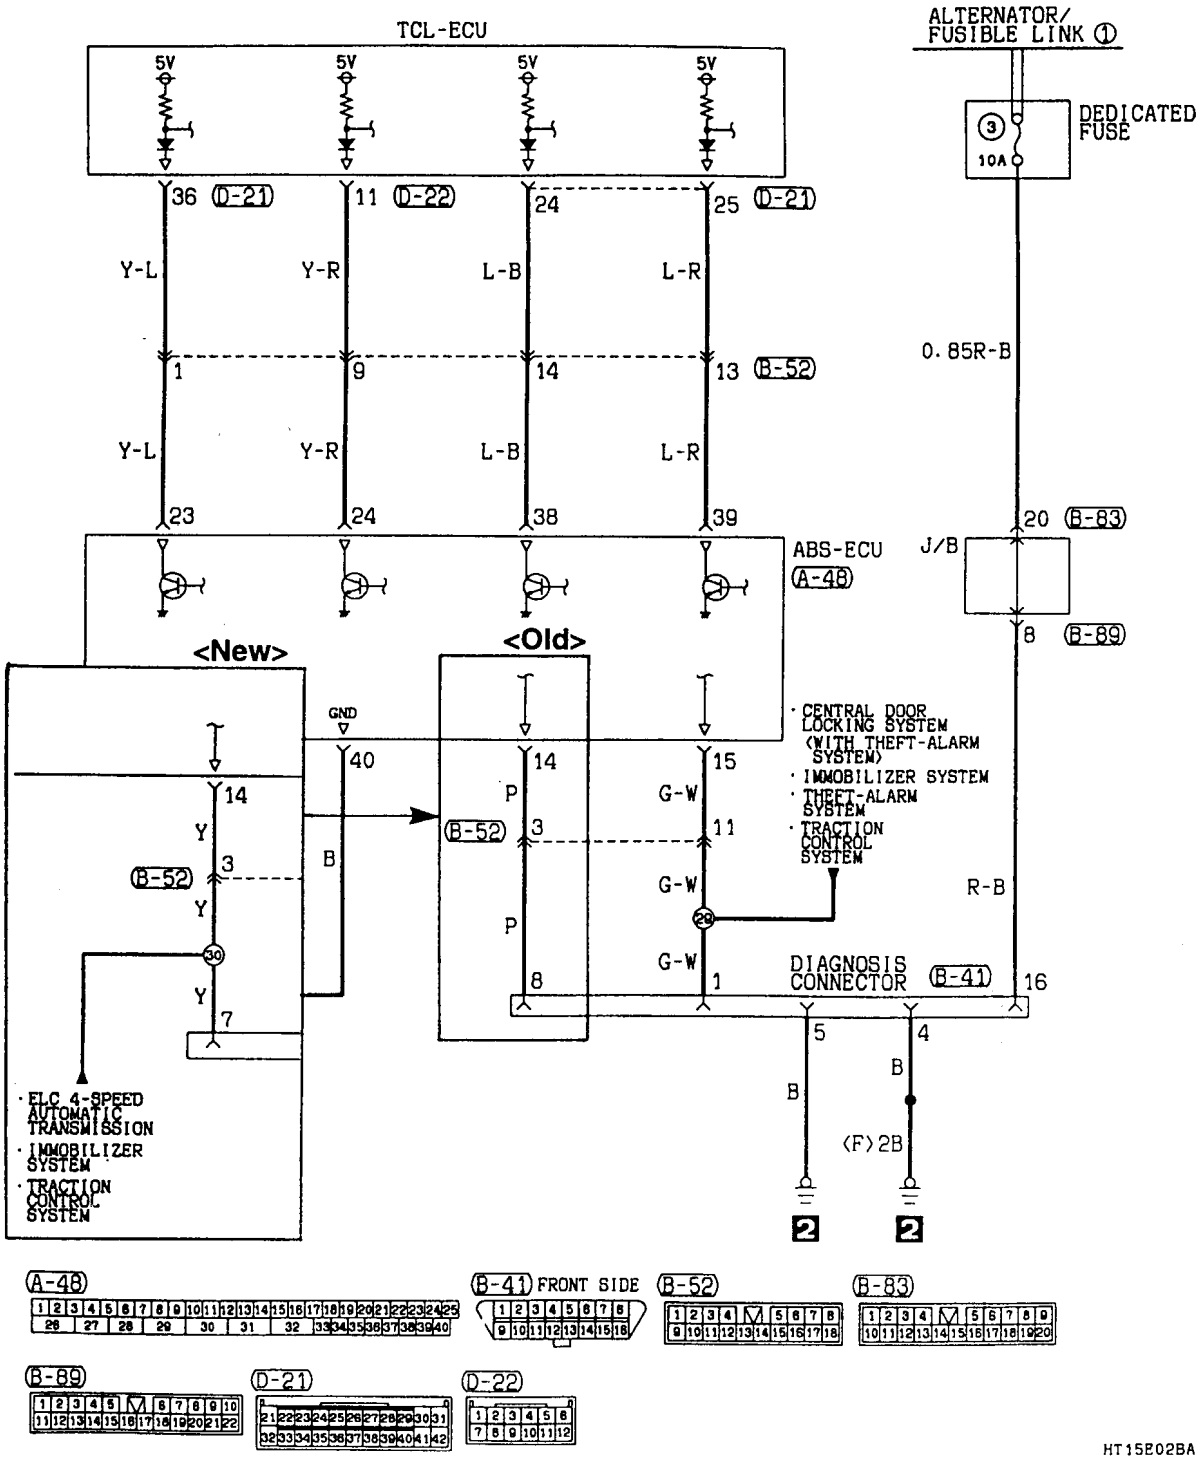
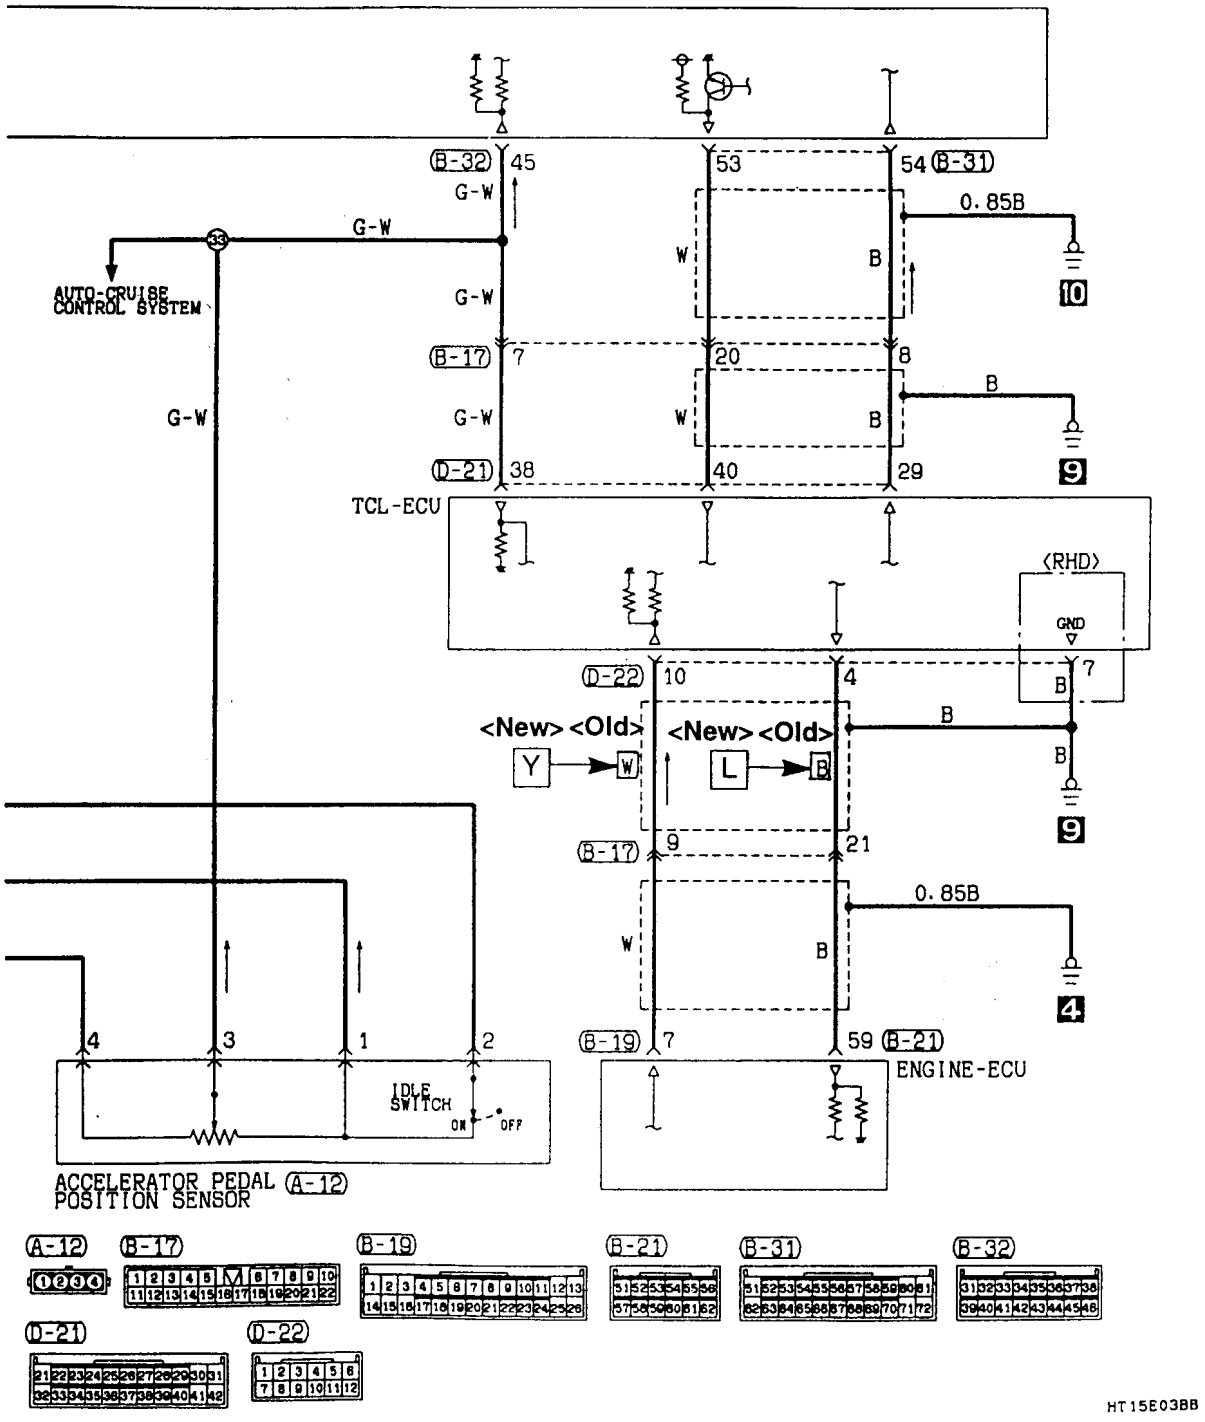
- For English Page 4–175
- For Spanish, French, German, Dutch and Swedish Page 4–173