RADIO BROADCAST CANNOT BE RECEIVED (POOR RECEPTION)

INSPECTION PROCEDURE

1	CHECK RADIO AND NAVIGATION ASSY

(a) Check the radio's automatic search function.
(1) Check that the radio's automatic station search function works properly.
Standard: The radio's automatic station search function works properly.

OK → **REPLACE RADIO AND NAVIGATION ASSY (SEE PUB. NO. RM915E, PAGE 67–4)**

NG

2	CHECK OPTIONAL COMPONENTS

(a) Check the optional components (sun–shade film, telephone antenna, etc.).
(1) Check if optional components, such as sun–shade film or telephone antenna that may decrease reception sensitivity, are installed.
Standard: Optional components are installed.

OK → **REMOVE OPTIONAL COMPONENTS AND CHECK AGAIN**

NG


3	CHECK THE ANTENNA

(a) Check the antenna for noise.
(1) Turn the ignition switch to the ACC position, turn the radio on, and put the radio into AM mode. Bring the tip of a screwdriver into contact with the antenna assy and check that noise can be heard from the speaker.
Standard: Noise occurs.

OK → **REPLACE ANTENNA ASSY (SEE PUB. NO. RM915E, PAGE 67–14)**

NG

4	CHECK RADIO AND NAVIGATION ASSY

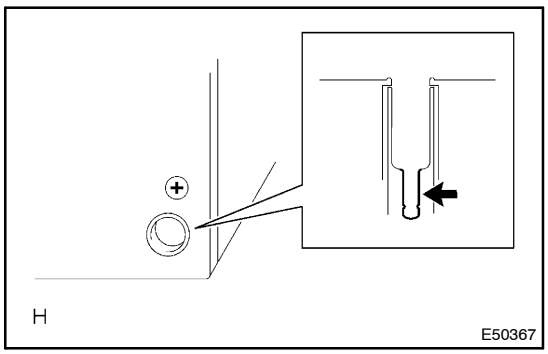

(a) Preparation for check
  (1) Remove the antenna plug from the radio and navigation assy.

(b) Check for noise
  (1) Turn the ignition switch to the ACC position with the radio and navigation assy connector connected.
  (2) Turn the radio on and select AM mode.
  (3) Bring a flat head screwdriver, thin wire, or other metal object into contact with the radio receiver's antenna jack. Check that noise can be heard from the speaker.

Standard: Noise occurs.

NG → **REPLACE RADIO AND NAVIGATION ASSY (SEE PUB. NO. RM915E, PAGE 67–4)**

OK

PROCEED TO NEXT CIRCUIT INSPECTION SHOWN IN PROBLEM SYMPTOMS TABLE (SEE PAGE 05–46)