
SLIP INDICATOR LIGHT CIRCUIT

CIRCUIT DESCRIPTION

The SLIP indicator blinks during TRAC & VSC operation.

WIRING DIAGRAM

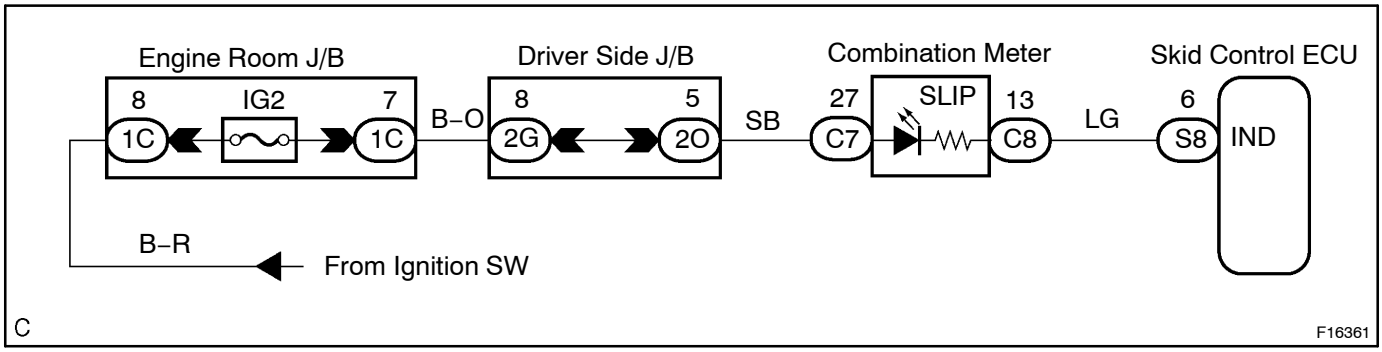

INSPECTION PROCEDURE

HINT:

Start the inspection from step 1 in case of using the hand–held tester and start from step 2 in case of not using the hand–held tester.

1	**PERFORM ACTIVE TEST BY HAND–HELD TESTER(SLIP INDICATOR LIGHT OPERATION)**

(a) Select the item ”SLIP INDI LIGHT” in the ACTIVE TEST and operate the SLIP indicator light on the hand–held tester.

(b) Check that ”ON” and ”OFF” of the SLIP indicator light can be shown on the combination meter by the hand–held tester.

OK → **Go to step 4**

NG

2	**CHECK SLIP INDICATOR LIGHT**

(a) Check that the SLIP indicator light is on for 3 seconds soon after ignition switch ON.

OK → **END**

NG

3	INSPECT COMBINATION METER ASSY(SLIP INDICATOR LIGHT CIRCUIT)

NG → REPAIR OR REPLACE COMBINATION METER ASSY

OK

4	CHECK HARNESS AND CONNECTOR(COMBINATION METER – SKID CONTROL ECU ASSY)(See page 01–31)

NG → REPAIR OR REPLACE HARNESS OR CONNECTOR

OK

CHECK AND REPLACE SKID CONTROL ECU ASSY