
POWER SOURCE CIRCUIT (MULTI–DISPLAY)

CIRCUIT DESCRIPTION


This circuit provides power to the multi–display.

WIRING DIAGRAM

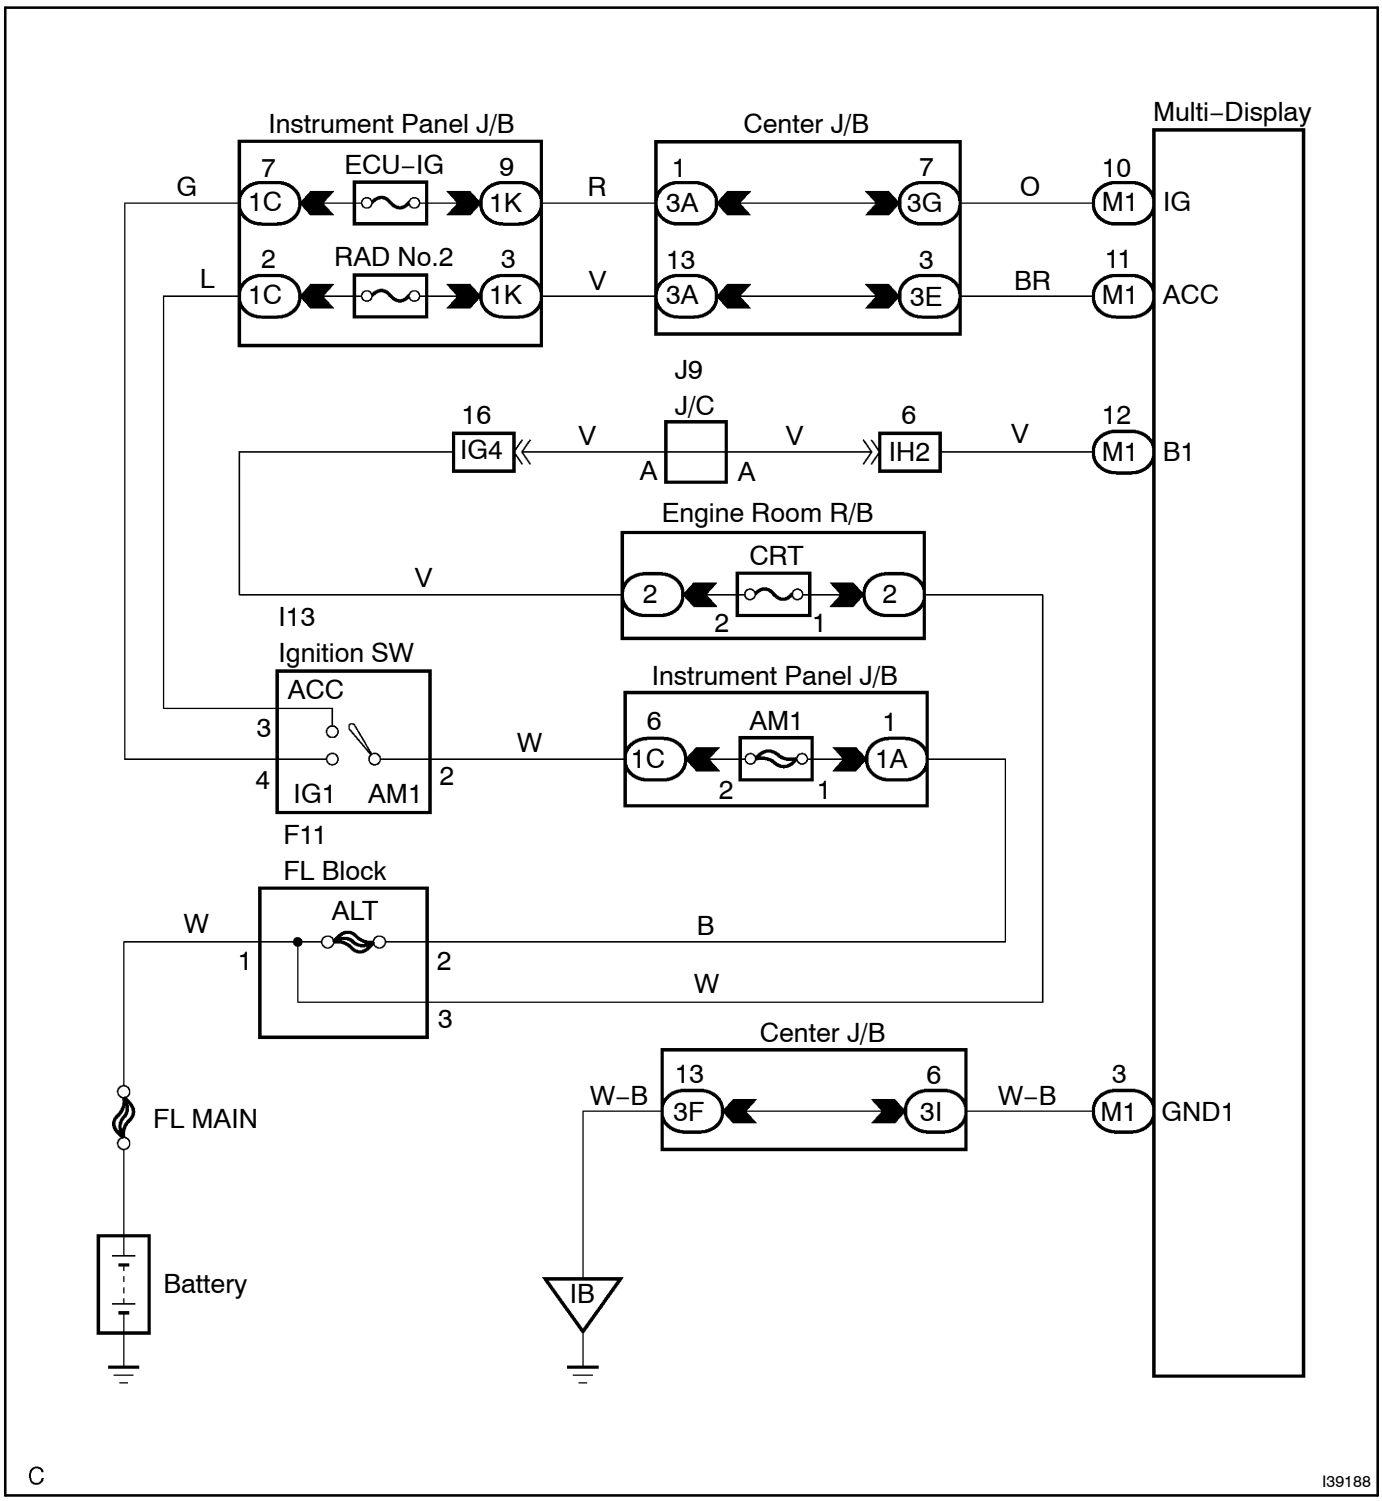

INSPECTION PROCEDURE

1	INSPECT MULTI–DISPLAY(B1, ACC, IG, GND1)

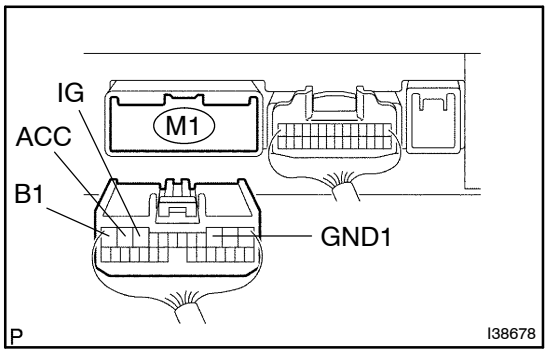

(a) Disconnect the multi–display connector M1.

(b) Measure the resistance according to the value(s) in the table below.

Standard:

Tester connection	Condition	Specified condition
GND1 – Body ground	Always	Below 1 Ω

(c) Measure the voltage according to the value(s) in the table below.

Standard:

Tester connection	Condition	Specified condition
B1 – GND1	Always	10 to 14 V
ACC – GND1	Ignition SW ACC	10 to 14 V
IG – GND1	Ignition SW ON	10 to 14 V

NG → **REPAIR OR REPLACE HARNESS OR CONNECTOR**

OK

PROCEED TO NEXT CIRCUIT INSPECTION SHOWN IN PROBLEM SYMPTOMS TABLE OR DIAGNOSTIC TROUBLE CODE CHART (SEE PAGE 05–880 OR 05–892)