
ENTIRE COMBINATION METER DOES NOT OPERATE


WIRING DIAGRAM

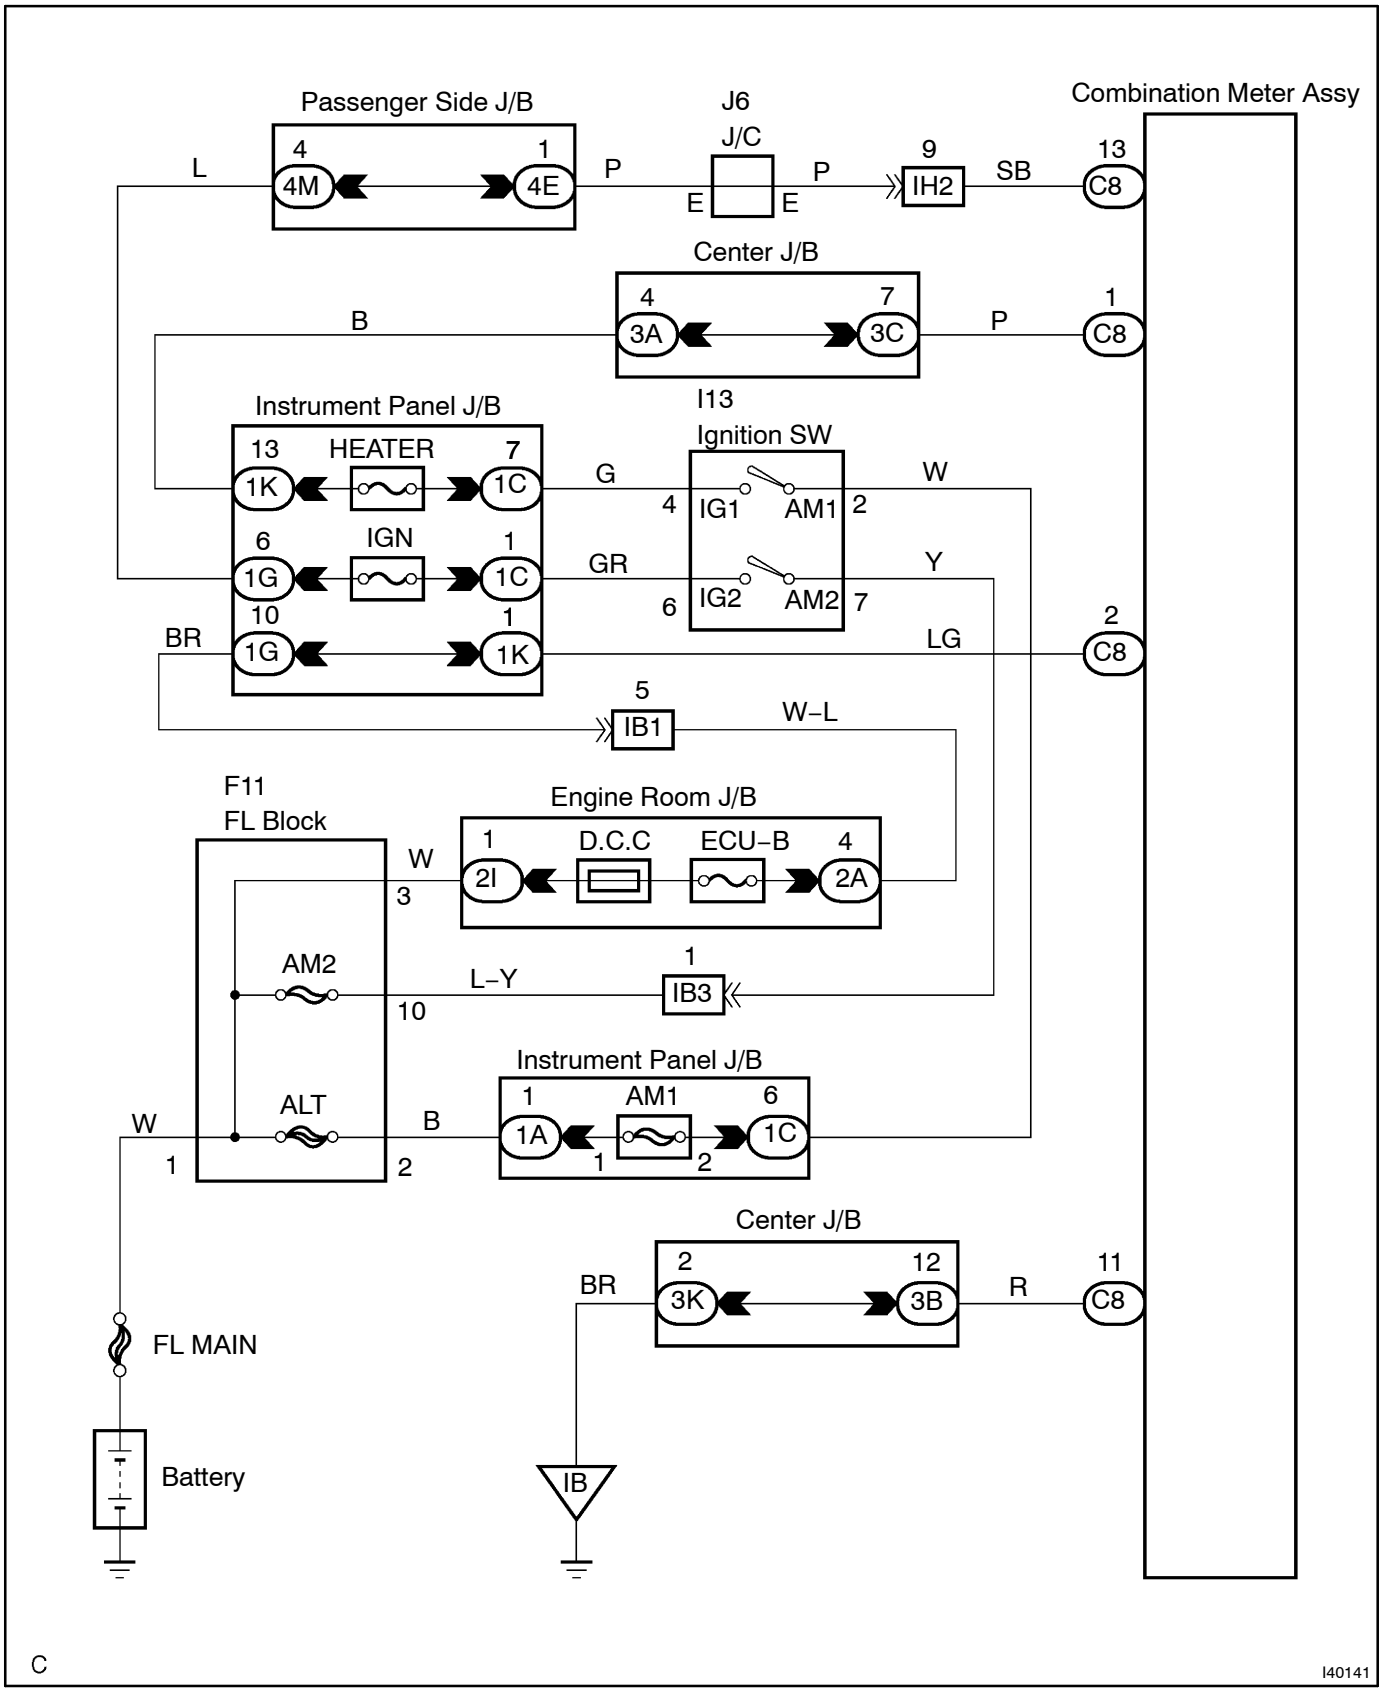

INSPECTION PROCEDURE

1	INSPECT COMBINATION METER ASSY

Wire Harness View:

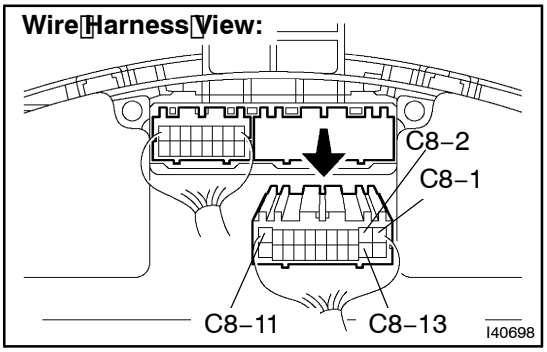

(a) Measure the resistance according to the value(s) in the table below.

Standard:

Terminal No	Condition	Specified condition
C8–11 – Body ground	Always	Below 1 Ω

(b) Measure the voltage according to the value(s) in the table below.

Standard:

Terminal No	Condition	Specified condition
C8–2 – Body ground	Always	10 to 14 V
C8–1 – Body ground	Ignition switch ON	10 to 14 V
C8–13 – Body ground	Ignition switch ON	10 to 14 V

NG → **REPAIR OR REPLACE HARNESS OR CONNECTOR**

OK

REPLACE COMBINATION METER ASSY (SEE PAGE 71–17)