
VSC WARNING LIGHT CIRCUIT (DOES NOT LIGHT UP)

CIRCUIT DESCRIPTION

If the ECU stores DTC, the VSC warning light lights on the combination meter.

WIRING DIAGRAM

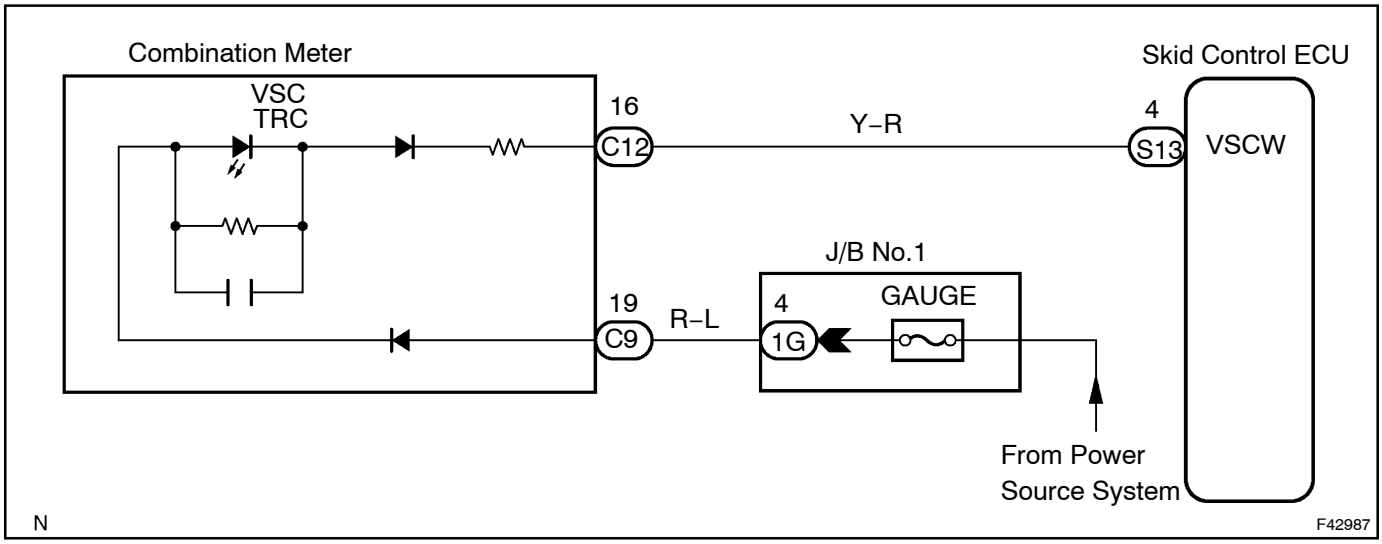

INSPECTION PROCEDURE

HINT:
Start the inspection from step 1 in case of using the hand–held tester and start from step 2 in case of not using the hand–held tester.

1	PERFORM ACTIVE TEST BY VSC WARNING LIGHT

(a) Check that ”ON” and ”OFF” of the VSC warning light can be shown on the combination meter with the hand–held tester.

OK → CHECK AND REPLACE SKID CONTROL ECU ASSY

NG

2	INSPECT VSC WARNING LIGHT

(a) See combination meter troubleshooting on page 05–1546.

NG → REPAIR OR REPLACE COMBINATION METER ASSEMBLY

OK

3	CHECK HARNESS AND CONNECTOR(SKID CONTROL ECU – COMBINATION METER)

(a) Check for open and short circuit in harness and connector between skid control ECU and combination meter (See page 01–36).

NG → REPAIR OR REPLACE HARNESS OR CONNECTOR

OK

CHECK AND REPLACE SKID CONTROL ECU ASSY