
IG POWER SOURCE CIRCUIT

CIRCUIT DESCRIPTION

This is the power source for the A/C amplifier and servomotor, etc.

WIRING DIAGRAM

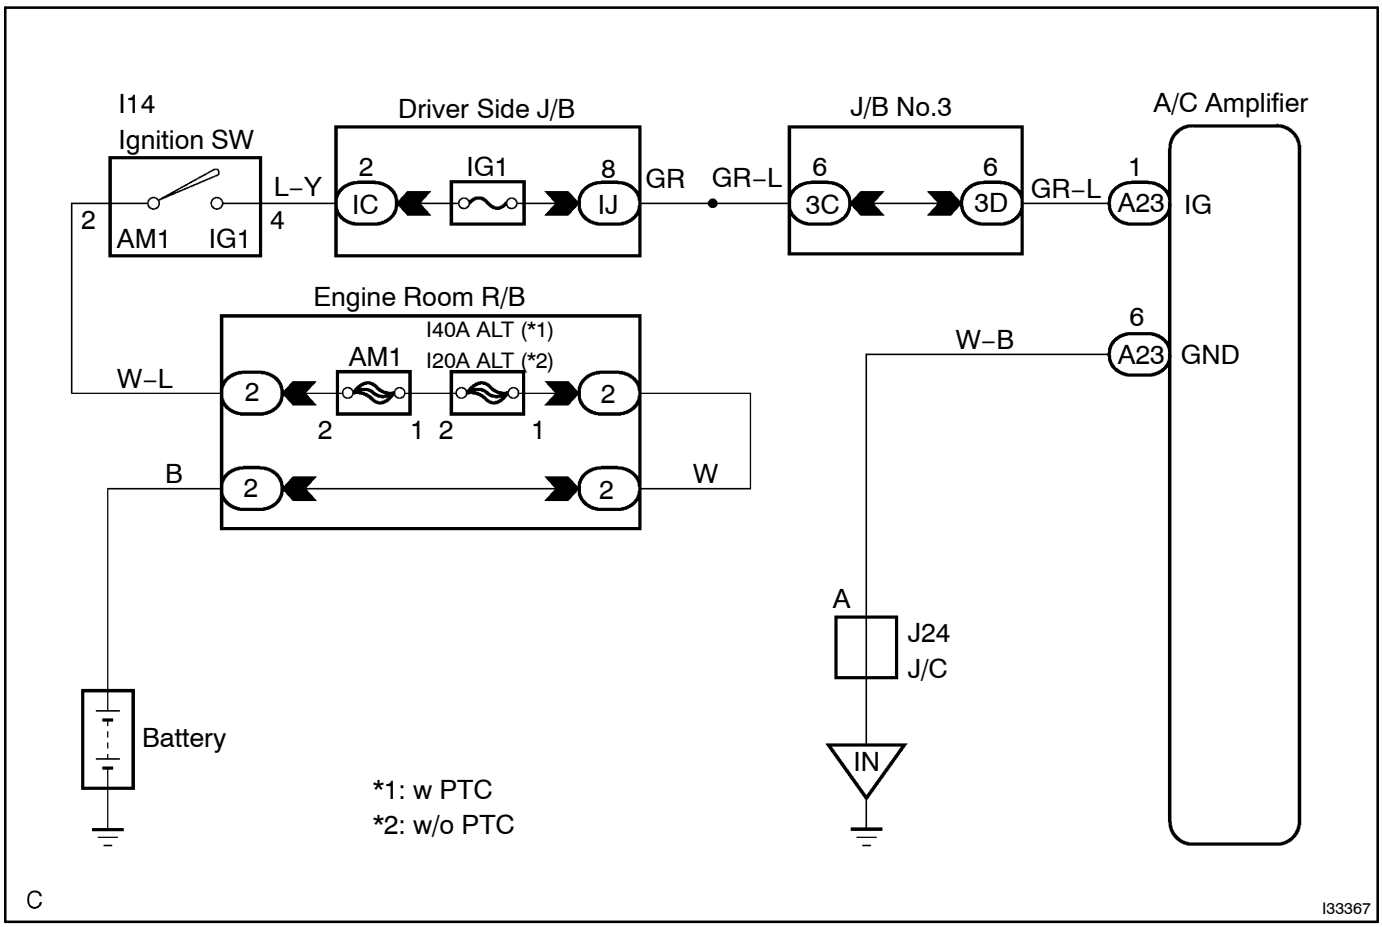

INSPECTION PROCEDURE


1	CHECK FUSE(IG1 FUSE)

(a) Remove the IG1 fuse from the driver side J/B or J/B No.1.
(b) Check that the continuity exists of IG1 fuse.

NG → **REPLACE FUSE**

OK

2	CHECK HARNESS AND CONNECTOR(A/C AMPLIFIER – BATTERY)

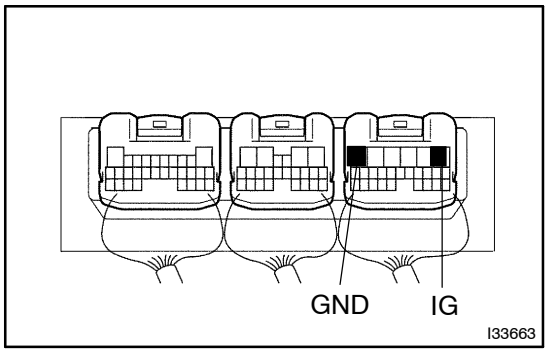

(a) Remove the A/C amplifier with being connected.
(b) Turn the ignition switch to ON.
(c) Measure voltage between terminal IG and GND of the A/C amplifier.
Voltage: 10 – 14 V

NG → **REPAIR OR REPLACE HARNESS OR CONNECTOR**

OK

PROCEED TO NEXT CIRCUIT INSPECTION SHOWN ON PROBLEM SYMPTOMS TABLE