DTC B0108/52 SHORT IN P SQUIB CIRCUIT (TO B+)

CIRCUIT DESCRIPTION

The P squib circuit consists of the airbag sensor assy center and instr pnl pass l/door airbag assy.
It causes the SRS to deploy when the SRS deployment conditions are satisfied.
DTC B0108/52 is recorded when a B+ short is detected in the P squib circuit.


DTC No.	DTC Detecting Condition	Trouble Area
B0108/52	• Short in P squib circuit (to B+) • P squib malfunction • Airbag sensor assy center malfunction	• Instr pnl pass l/door airbag assy (P squib) • Airbag sensor assy center • Instrument panel wire

WIRING DIAGRAM

See page 05–1154.

INSPECTION PROCEDURE

1	CHECK INSTRUMENT PANEL WIRE (P SQUIB CIRCUIT)

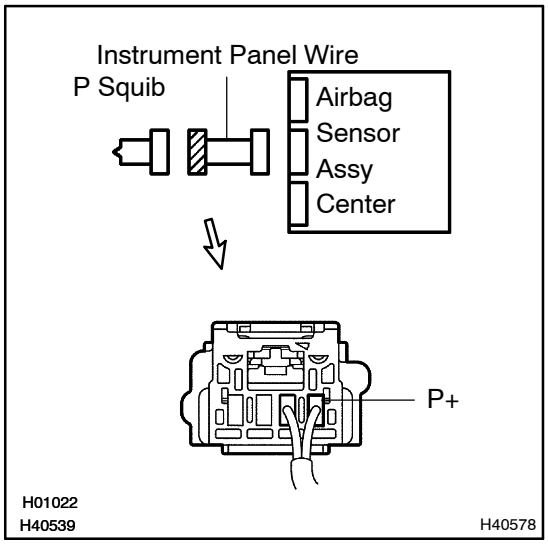


(a) Disconnect the negative (–) terminal cable from the battery, and wait at least for 90 seconds.
(b) Disconnect the connectors between the airbag sensor assy center and the instr pnl pass l/door airbag assy.
(c) Connect the negative (–) terminal cable to the battery, and wait at least for 2 seconds.
(d) Turn the ignition switch to ON.
(e) Measure the voltage between the body ground and P+ of the instrument panel wire connector on the instr pnl pass l/door airbag assy side.
OK:
Voltage: Below 1 V

NG → **REPAIR OR REPLACE INSTRUMENT PANEL WIRE**

OK

2 CHECK AIR BAG SENSOR ASSY CENTER

SST 09843–18040

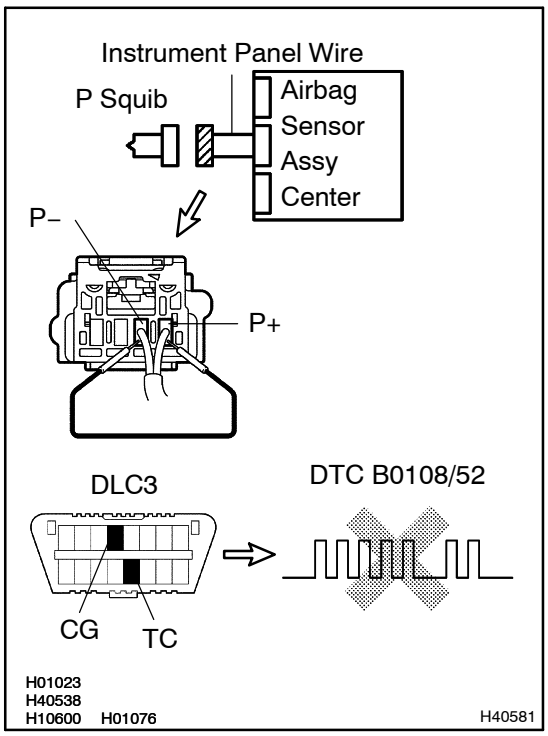

(a) Turn the ignition switch to LOCK.
(b) Disconnect the negative (–) terminal cable from the battery, and wait at least for 90 seconds.
(c) Connect the connector to the airbag sensor assy center.
(d) Using a service wire, connect P+ and P– of the instrument panel wire connector on the instr pnl pass l/door airbag assy side.
(e) Connect negative (–) terminal cable to the battery, and wait at least for 2 seconds.
(f) Turn the ignition switch to ON, and wait at least for 10 seconds.
(g) Clear the DTC stored in memory (See page 05–1122).
(h) Turn the ignition switch to LOCK, and wait at least for 10 seconds.
(i) Turn the ignition switch to ON, and wait at least for 10 seconds.
(j) Check the DTC (See page 05–1122).
OK:
DTC B0108/52 is not output.


HINT:
Codes other than code B0108/52 may be output at this time, but they are not relevant to this check.

NG → **REPLACE AIR BAG SENSOR ASSY CENTER**

OK

3 CHECK P SQUIB

SST 09843–18040

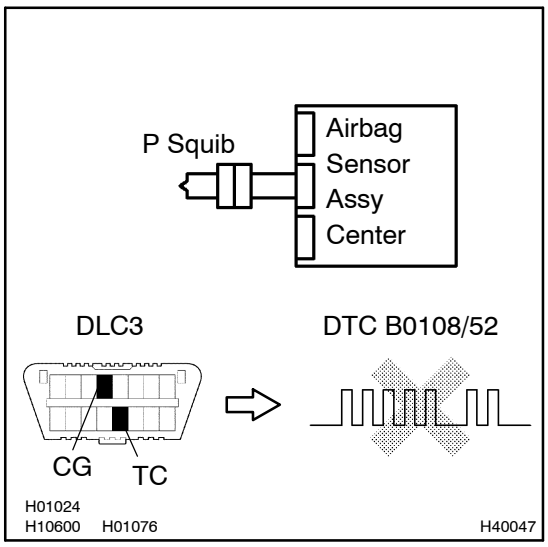

(a) Turn the ignition switch to LOCK.
(b) Disconnect the negative (–) terminal cable from the battery, and wait at least for 90 seconds.
(c) Connect the instr pnl pass l/door airbag assy connectors.
(d) Connect the negative (–) terminal cable to the battery, and wait at least for 2 seconds.
(e) Turn the ignition switch to ON, and wait at least for 10 seconds.
(f) Clear the DTC stored in memory (See page 05–1122).
(g) Turn the ignition switch to LOCK, and wait at least for 10 seconds.
(h) Turn the ignition switch to ON, and wait at least for 10 seconds.
(i) Check the DTC (See page 05–1122).
OK:
DTC B0108/52 is not output.

HINT:
Codes other than code B0108/52 may be output at this time, but they are not relevant to this check.

NG → **REPLACE INSTR PNL PASS L/DOOR AIR BAG ASSY**

OK

4 USE SIMULATION METHOD TO CHECK

NG → **Go to step 1**

OK

REPLACE ALL SRS COMPONENTS INCLUDING WIRE HARNESS