
DTC B1185/57 SHORT IN P SQUIB (2ND STEP) CIRCUIT

CIRCUIT DESCRIPTION

The P squib (2nd step) circuit consists of the airbag sensor assy center and the instr pnl pass l/door airbag assy.
It causes the SRS to deploy when the SRS deployment conditions are satisfied.
DTC B1185/57 is recorded when a short is detected in the P squib (2nd step) circuit.


DTC No.	DTC Detecting Condition	Trouble Area
B1185/57	• Short in P squib (2nd step) circuit • P squib (2nd step) malfunction • Airbag sensor assy center malfunction	• Instr pnl pass l/door airbag assy (P squib, 2nd step) • Airbag sensor assy center • Instrument panel wire

WIRING DIAGRAM

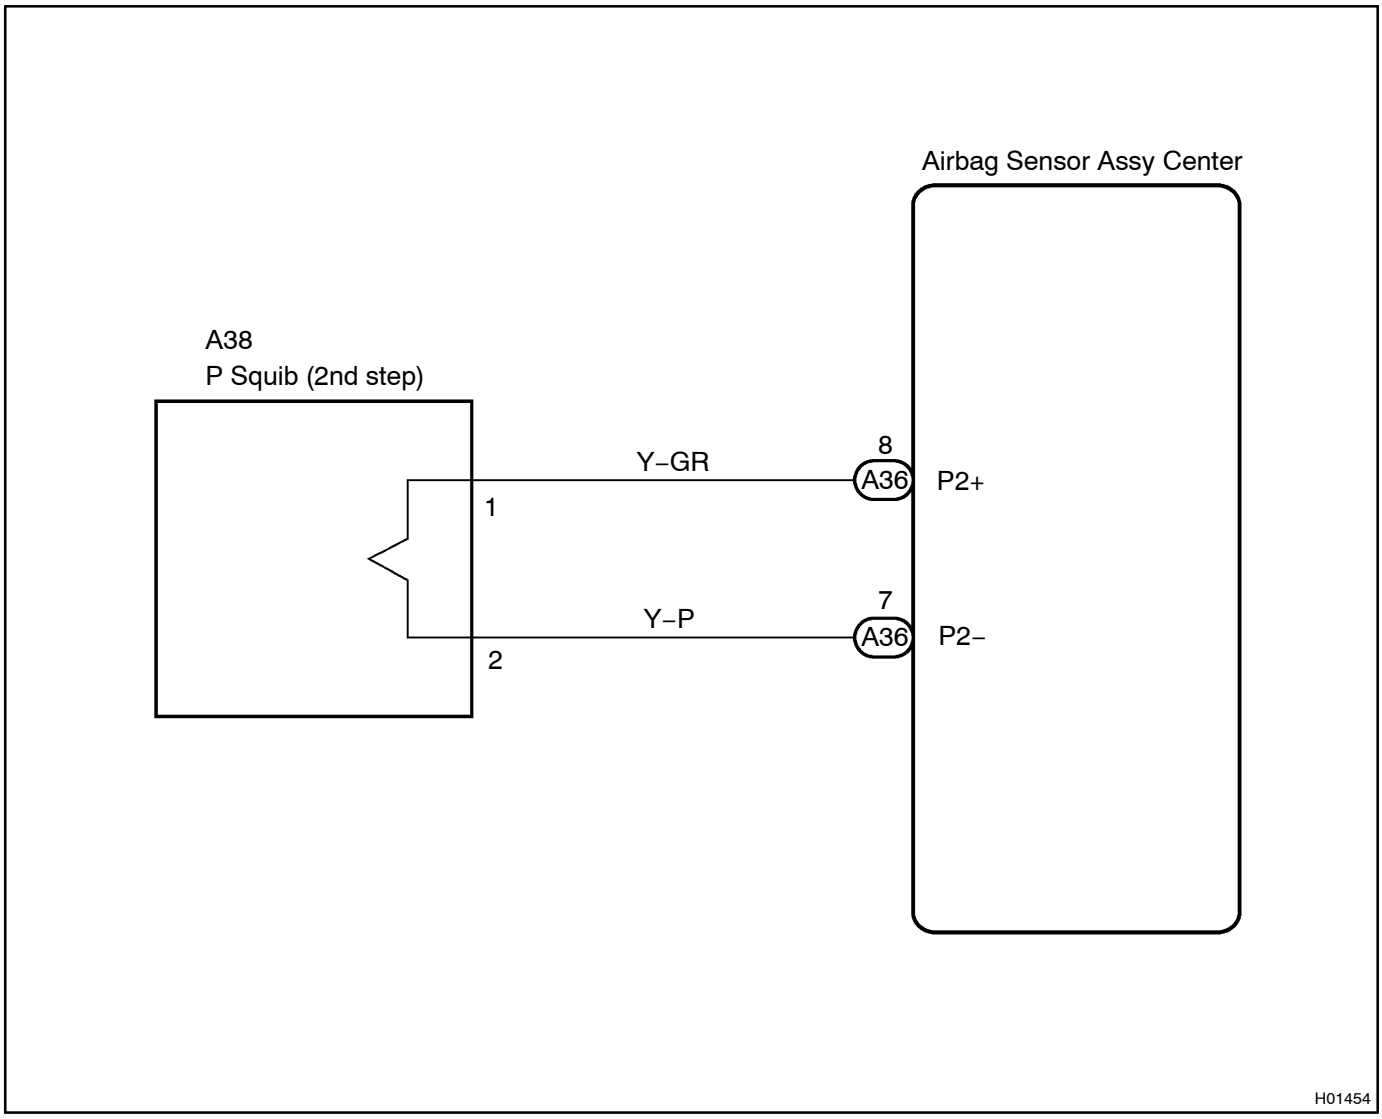

INSPECTION PROCEDURE

1 CHECK INSTRUMENT PANEL WIRE (P SQUIB (2ND STEP) CIRCUIT)

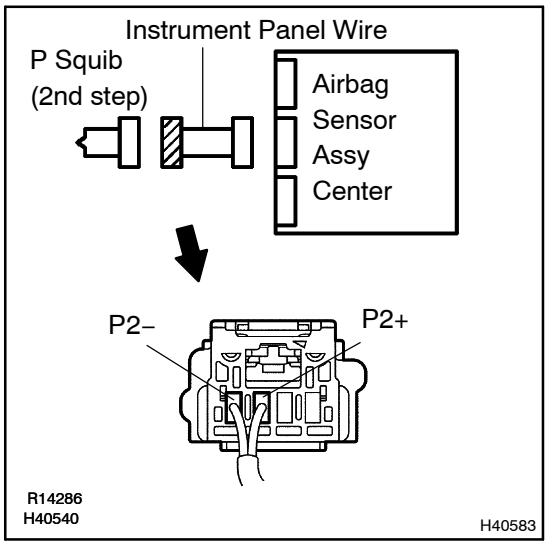


(a) Disconnect the negative (–) terminal cable from the battery, and wait at least for 90 seconds.
(b) Disconnect the connectors between the airbag sensor assy center and the instr pnl pass l/door airbag assy.
(c) Release the airbag activation prevention mechanism built in the connector of the instrument panel wire on the airbag sensor assy center side (See page 05–1122).
(d) Measure the resistance between P2+ and P2– of the instrument panel wire connector on the instr pnl pass l/door airbag assy side.
OK:
Resistance: 1 MΩ or Higher

NG	REPAIR OR REPLACE INSTRUMENT PANEL WIRE

OK

2 CHECK AIR BAG SENSOR ASSY CENTER

SST 09843–18040

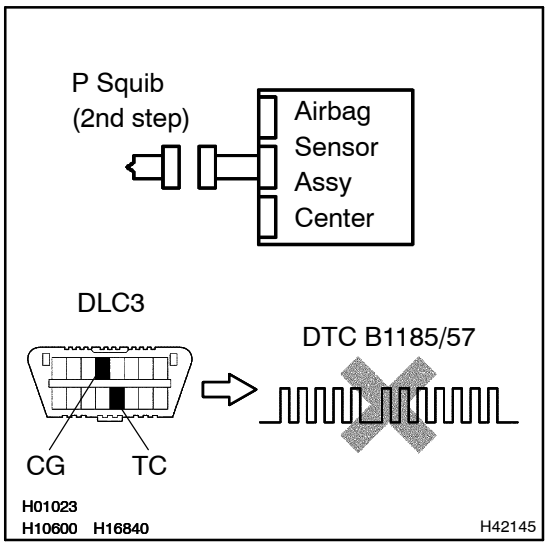

(a) Connect the connector to the airbag sensor assy center.
(b) Connect the negative (–) terminal cable to the battery, and wait at least for 2 seconds.
(c) Turn the ignition switch to ON, and wait at least for 10 seconds.
(d) Clear the DTC stored in memory (See page 05–1122).
(e) Turn the ignition switch to LOCK, and wait at least for 10 seconds.
(f) Turn the ignition switch to ON, and wait at least for 10 seconds.
(g) Check the DTC (See page 05–1122).
OK:
DTC B1185/57 is not output.


HINT:
Codes other than code B1185/57 may be output at this time, but they are not relevant to this check.

NG	REPLACE AIR BAG SENSOR ASSY CENTER

OK

3	CHECK P SQUIB (2ND STEP)

SST 09843–18040

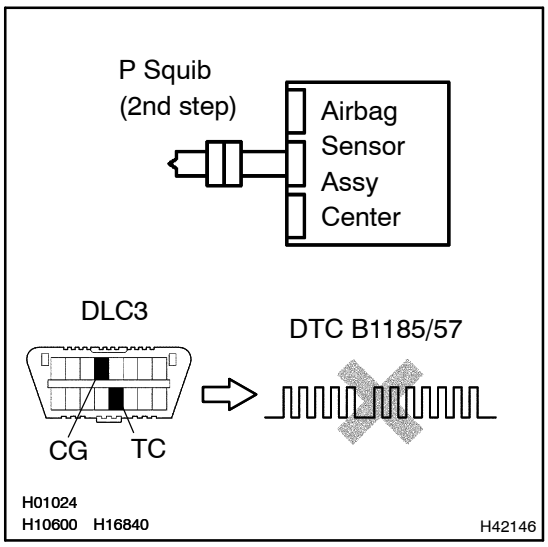

(a) Turn the ignition switch to LOCK.
(b) Disconnect the negative (–) terminal cable from the battery, and wait at least for 90 seconds.
(c) Connect the instr pnl pass l/door airbag assy connectors.
(d) Connect the negative (–) terminal cable to the battery, and wait at least for 2 seconds.
(e) Turn the ignition switch to ON, and wait at least for 10 seconds.
(f) Clear the DTC stored in memory (See page 05–1122).
(g) Turn the ignition switch to LOCK, and wait at least for 10 seconds.
(h) Turn the ignition switch to ON, and wait at least for 10 seconds.
(i) Check the DTC (See page 05–1122).
OK:
DTC B1185/57 is not output.

HINT:
Codes other than code B1185/57 may be output at this time, but they are not relevant to this check.

NG	REPLACE INSTR PNL PASS L/DOOR AIR BAG ASSY

OK

USE SIMULATION METHOD TO CHECK