
DTC B2797 COMMUNICATION MALFUNCTION NO.1

CIRCUIT DESCRIPTION

This DTC is output when an error occurs in the normal communication.
HINT:
Some noise exists in the communication line.

DTC No.	DTC Detection Condition	Trouble Area
B2797	Keys are positioned too close each other, or noise occurred in communication line	• Key • Wire harness • Transponder key amplifier (transponder key coil) • Transponder key ECU assy

WIRING DIAGRAM

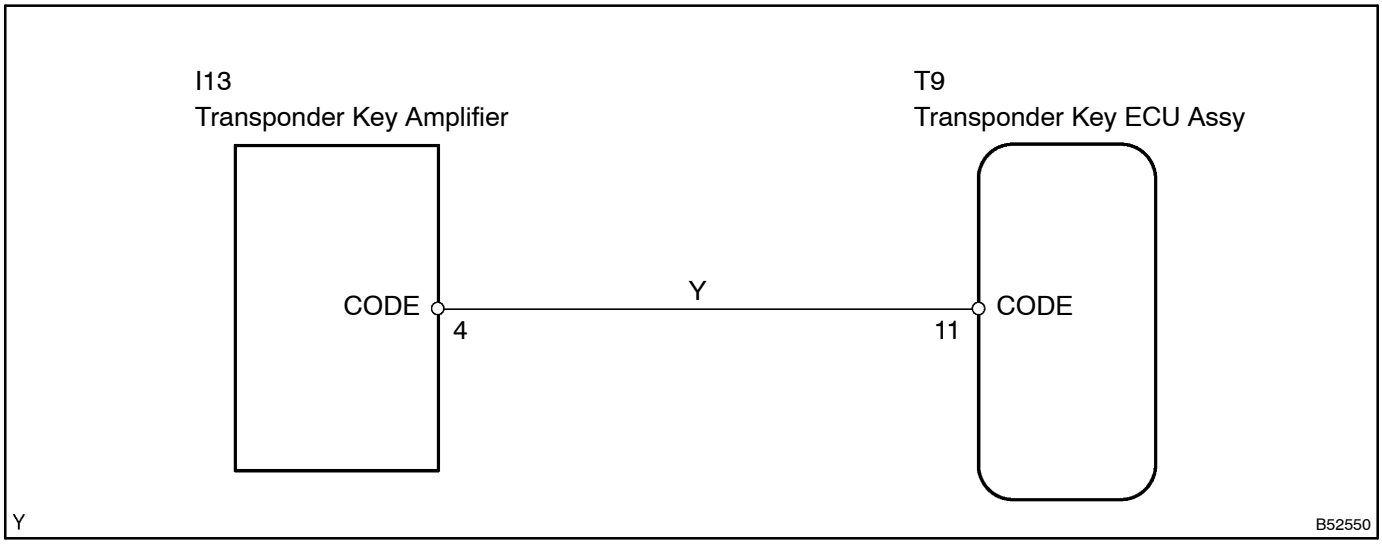

INSPECTION PROCEDURE

1	CHECK OPERATION OF TRANSPONDER KEY AMPLIFIER

(a) After exchanging the transponder key ECU, check that the engine starts.

OK → **NORMAL (TRANSPONDER KEY AMPLIFIER DEFECTIVE)**

NG

REPLACE TRANSPONDER KEY ECU ASSY