
POWER SOURCE CIRCUIT (MULTI–DISPLAY)

CIRCUIT DESCRIPTION


This circuit provides the power to the multi–display.

WIRING DIAGRAM

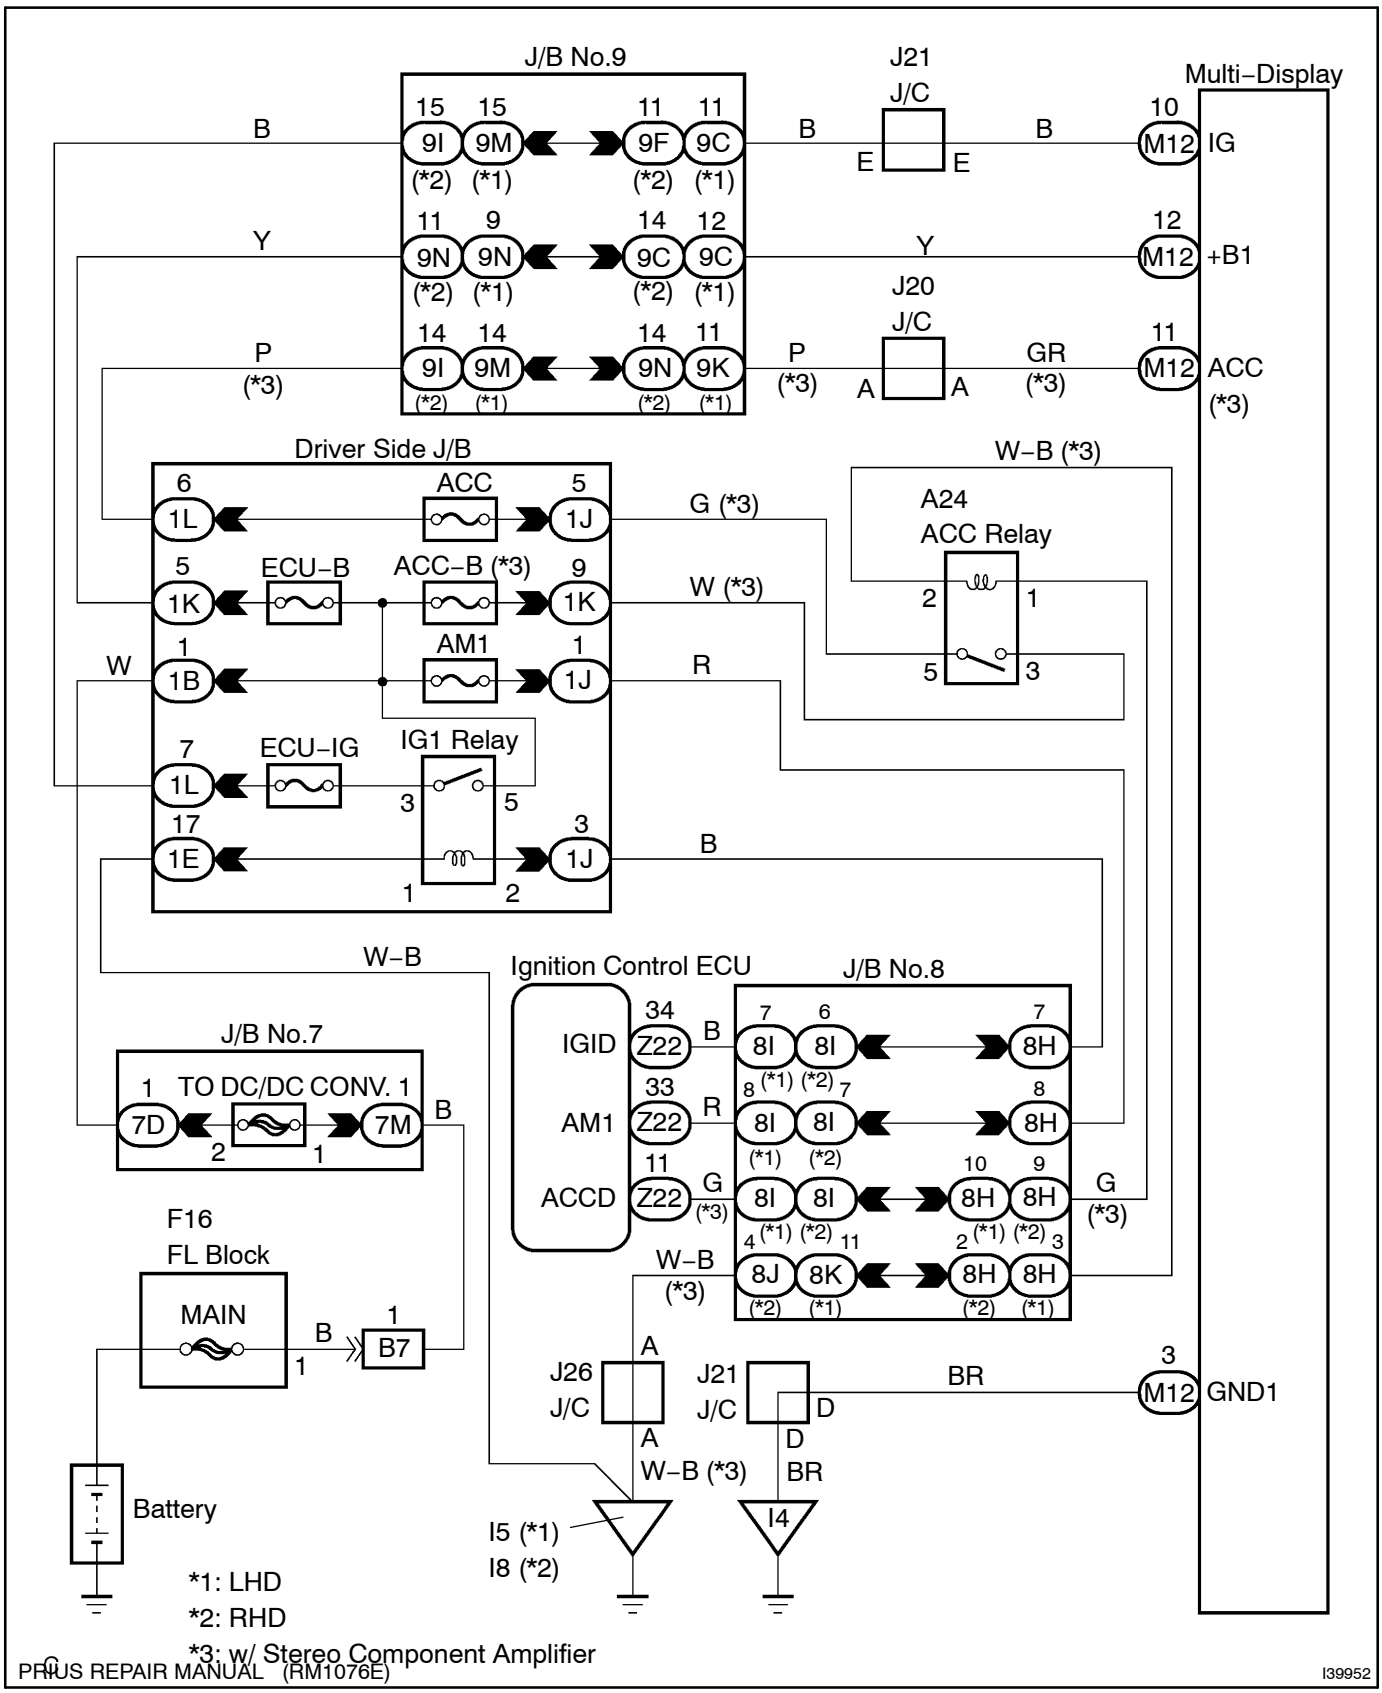

INSPECTION PROCEDURE

1	INSPECT MULTI–DISPLAY(+B1, ACC, IG, GND1)

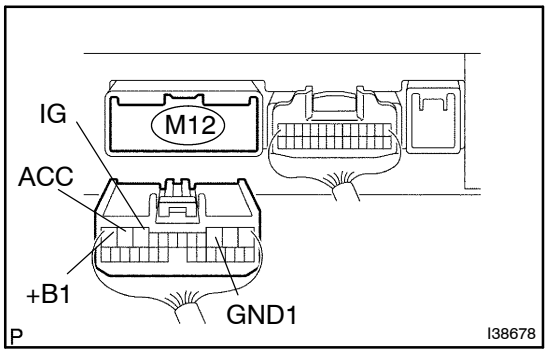

(a) Disconnect the multi–display connector M12.

(b) Measure the resistance according to the value(s) in the table below.

Standard:

Tester connection	Condition	Specified condition
GND1 – Body ground	Always	Below 1 Ω

(c) Measure the voltage according to the value(s) in the table below.

Standard:

Tester connection	Condition	Specified condition
+B1 – GND1	Always	10 to 14 V
ACC – GND1	Power switch ON (ACC)	10 to 14 V
IG – GND1	Power switch ON (IG)	10 to 14 V

NG → **REPAIR OR REPLACE HARNESS OR CONNECTOR**

OK

PROCEED TO NEXT CIRCUIT INSPECTION SHOWN IN PROBLEM SYMPTOMS TABLE OR DIAGNOSTIC TROUBLE CODE CHART (SEE PAGE 05–1570 or 05–1585)