ABS Warning Light does not Come ON

WIRING DIAGRAM

Refer to ABS Warning Light Remains ON (See page BC-141).

INSPECTION PROCEDURE

1	CHECK ABS WARNING LIGHT

(a) Disconnect the skid control ECU connector.
(b) Turn the ignition switch to the ON position.
(c) Check that the ABS warning light comes on.
OK:
ABS warning light comes on.
HINT:
If troubleshooting has been carried out according to the PROBLEM SYMPTOMS TABLE, refer back to the table and proceed to the next step (See page BC-79).

NG → **Go to step 2**

OK ↓

REPLACE BRAKE ACTUATOR ASSEMBLY

2	CHECK HARNESS AND CONNECTOR (SKID CONTROL ECU - COMBINATION METER)

(a) Turn the ignition switch off.
(b) Disconnect the combination meter connector.

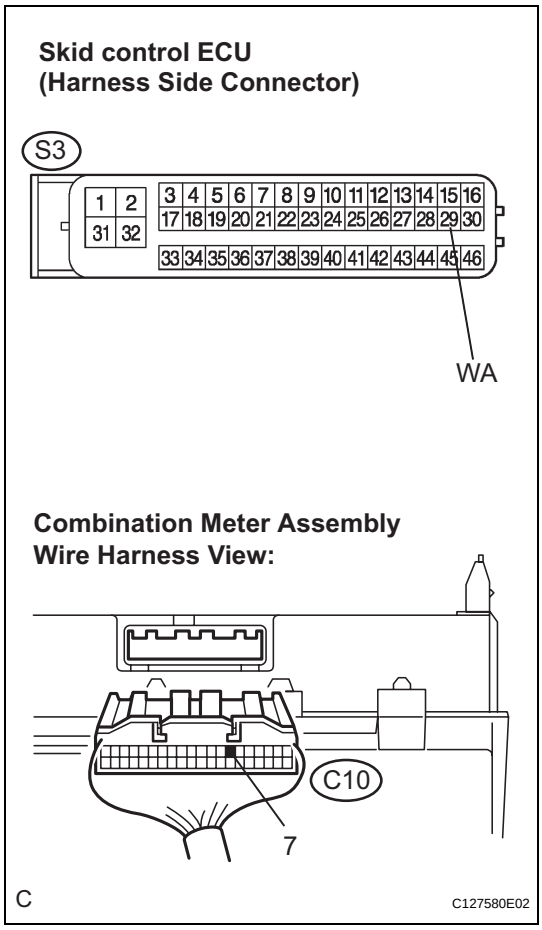

(c) Measure the resistance according to the value(s) in the table below.

Standard resistance

Tester Connection	Specified Condition
S3-29 (WA) - C10-7	Below 1 Ω
S3-29 (WA) - Body ground	10 kΩ or higher

NG → **REPAIR OR REPLACE HARNESS OR CONNECTOR**

OK

3	INSPECT COMBINATION METER ASSEMBLY

(a) Check the combination meter (See page ME-4).
HINT:
If troubleshooting has been carried out according to the PROBLEM SYMPTOMS TABLE, refer back to the table and proceed to the next step (See page BC-79).

NG → **REPLACE COMBINATION METER ASSEMBLY**

OK

END