
Entire Combination Meter does not Operate

DESCRIPTION

This is the power source circuit to operate the combination meter assembly.

WIRING DIAGRAM

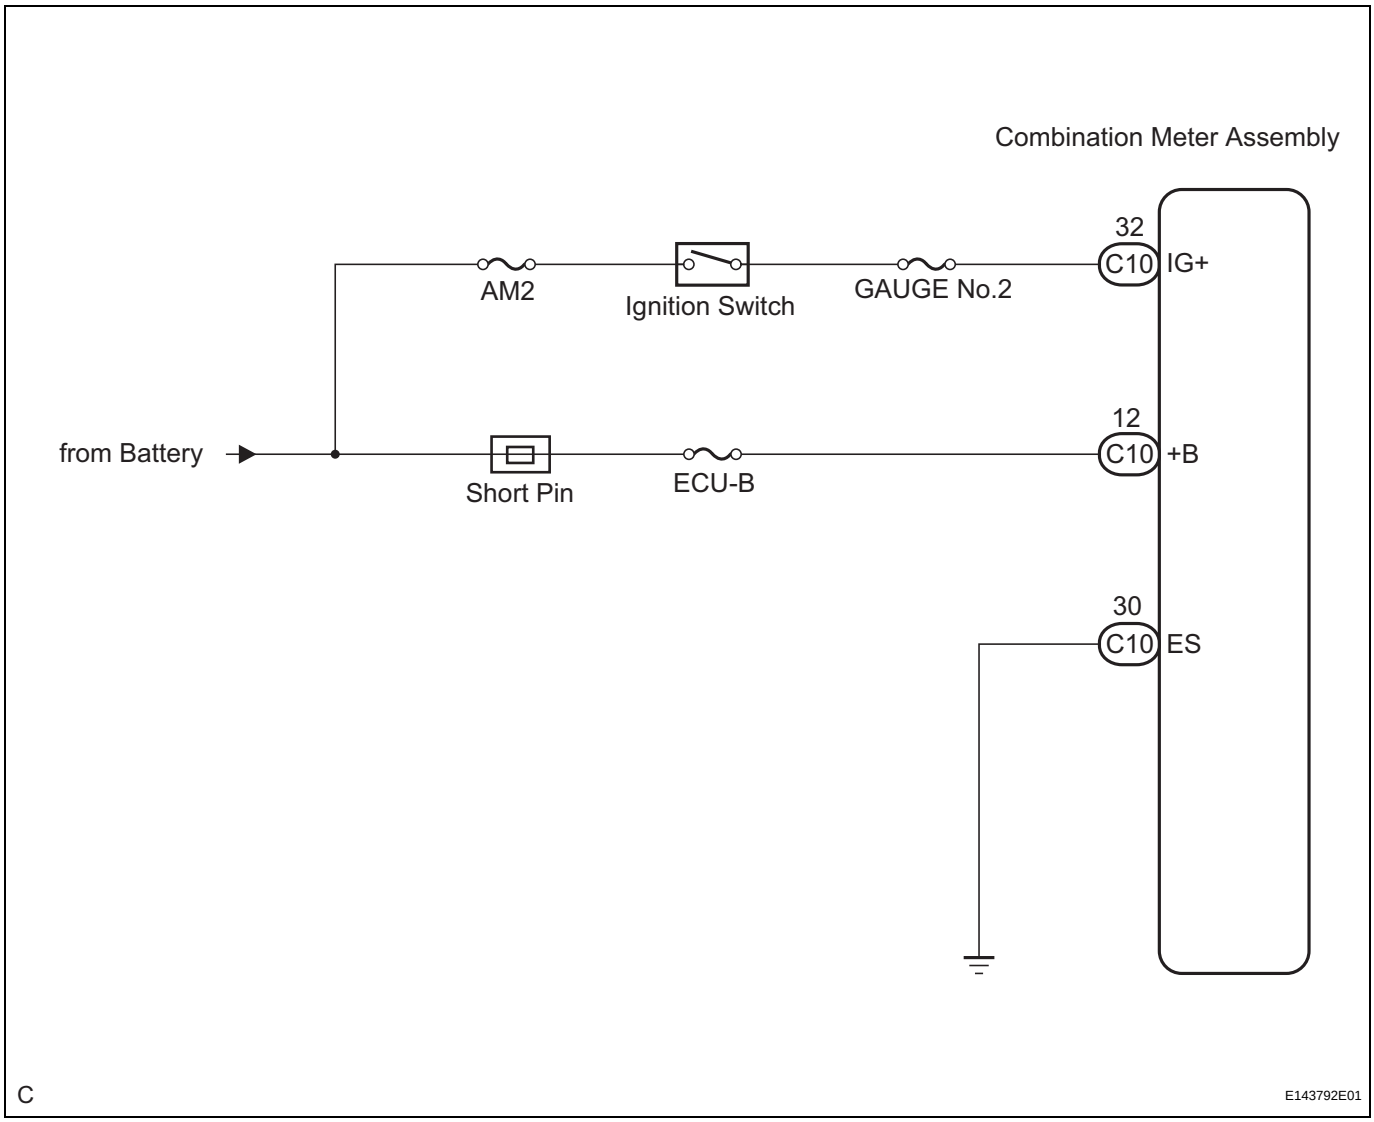


ME

INSPECTION PROCEDURE

1	INSPECT COMBINATION METER ASSEMBLY

Combination Meter Assembly

Wire Harness View:

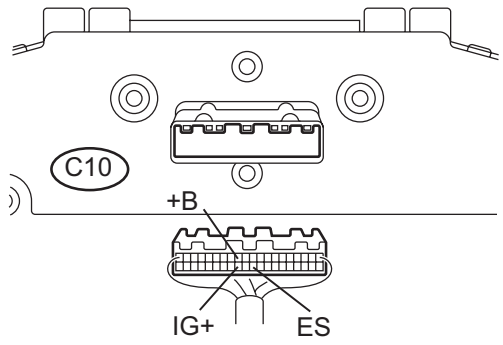

H

E118053E01

(a) Disconnect the C10 connector.
(b) Measure the resistance according to the value(s) in the table below.

Standard resistance

Tester Connection	Condition	Specified Condition
C10-30 (ES) - Body ground	Always	Below 1 Ω

(c) Measure the voltage according to the value(s) in the table below.

Standard voltage

Tester Connection	Condition	Specified Condition
C10-32 (IG+) - Body ground	Turn the ignition switch to the ON position	10 to 14 V
C10-12 (+B) - Body ground	Always	10 to 14 V

NG → **REPAIR OR REPLACE HARNESS OR CONNECTOR**

OK

REPLACE COMBINATION METER ASSEMBLY

ME