
Stereo Component Amplifier Power Source Circuit

DESCRIPTION

This circuit provides power to the stereo component amplifier.


WIRING DIAGRAM

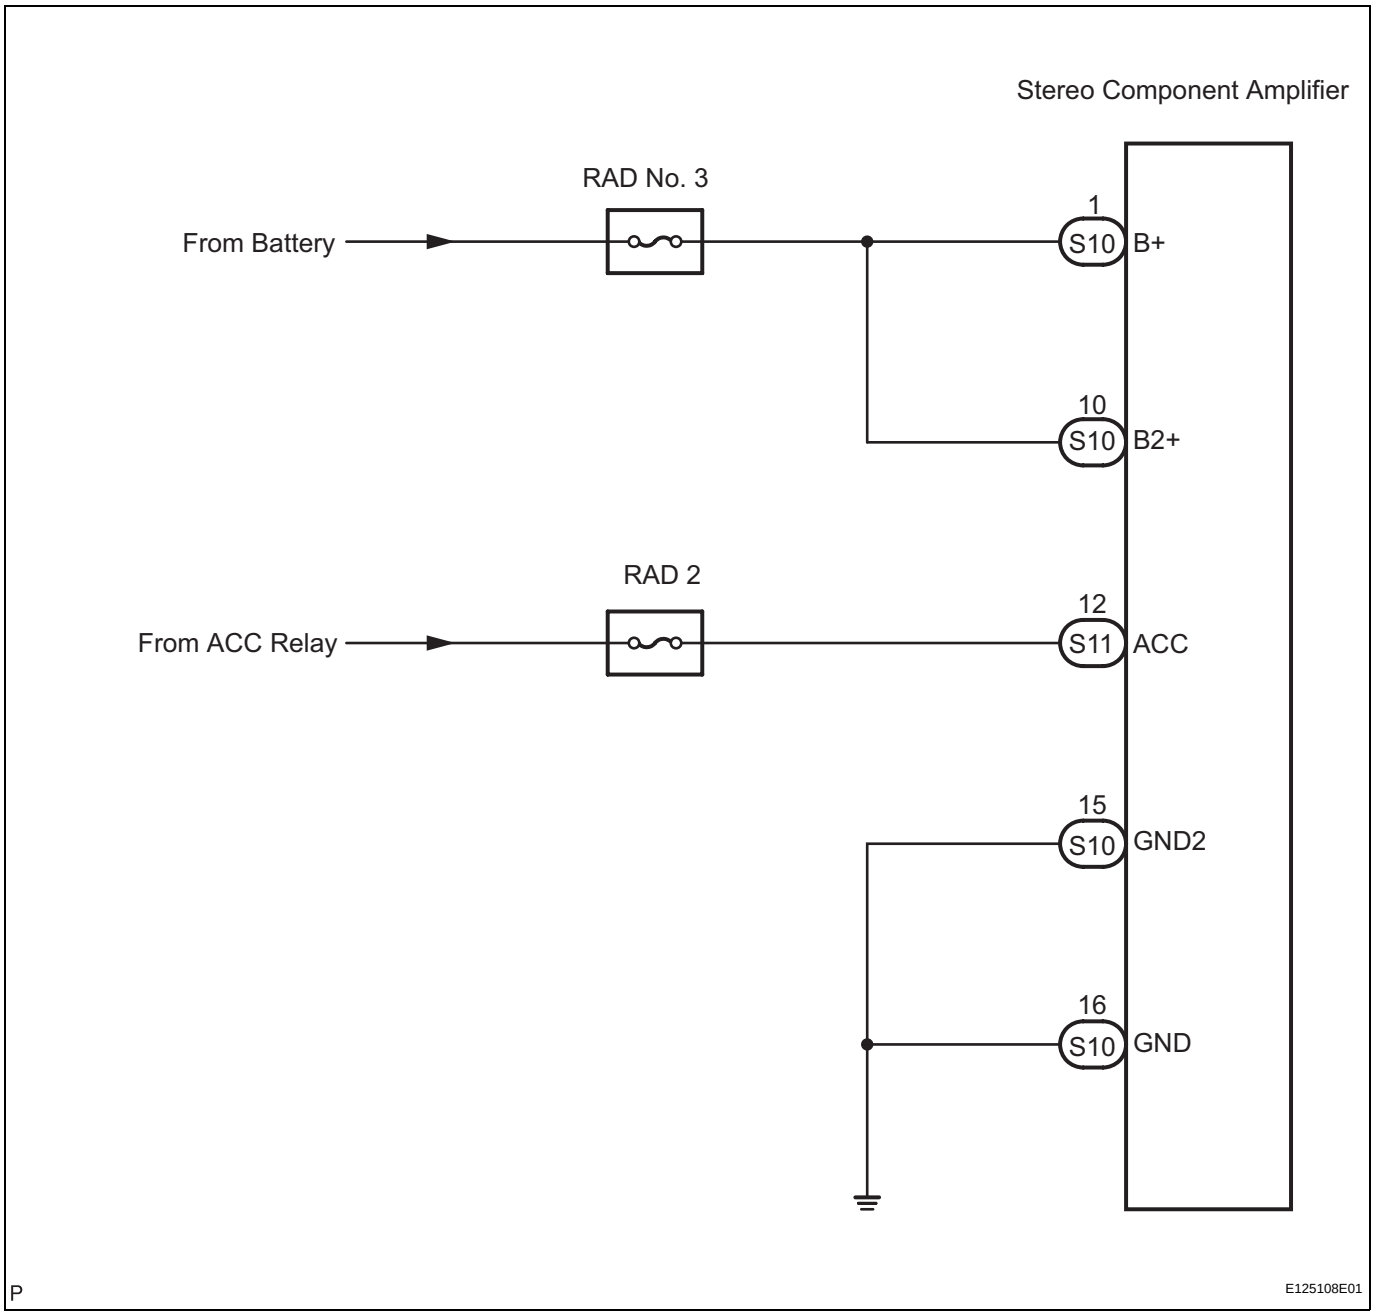

INSPECTION PROCEDURE

1	INSPECT STEREO COMPONENT AMPLIFIER

Wire Harness View:

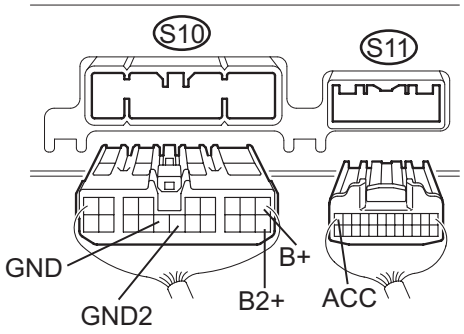

(a) Disconnect the stereo component amplifier connectors.
(b) Measure the resistance according to the values in the table below.

Standard resistance

Tester connection	Condition	Specified condition
GND - Body ground	Always	Below 1 Ω
GND2 - Body ground	Always	Below 1 Ω

(c) Measure the voltage according to the values in the table below.

Standard voltage

Tester connection	Condition	Specified condition
B+ - GND	Always	10 to 14 V
B2+ - GND	Always	10 to 14 V
ACC - GND	Ignition SW ACC	10 to 14 V

NG → **REPAIR OR REPLACE HARNESS OR CONNECTOR**

OK

AV

PROCEED TO NEXT CIRCUIT INSPECTION SHOWN IN PROBLEM SYMPTOMS TABLE