
Stereo Component Amplifier Power Source Circuit

DESCRIPTION

This circuit provides power to the stereo component amplifier.

WIRING DIAGRAM

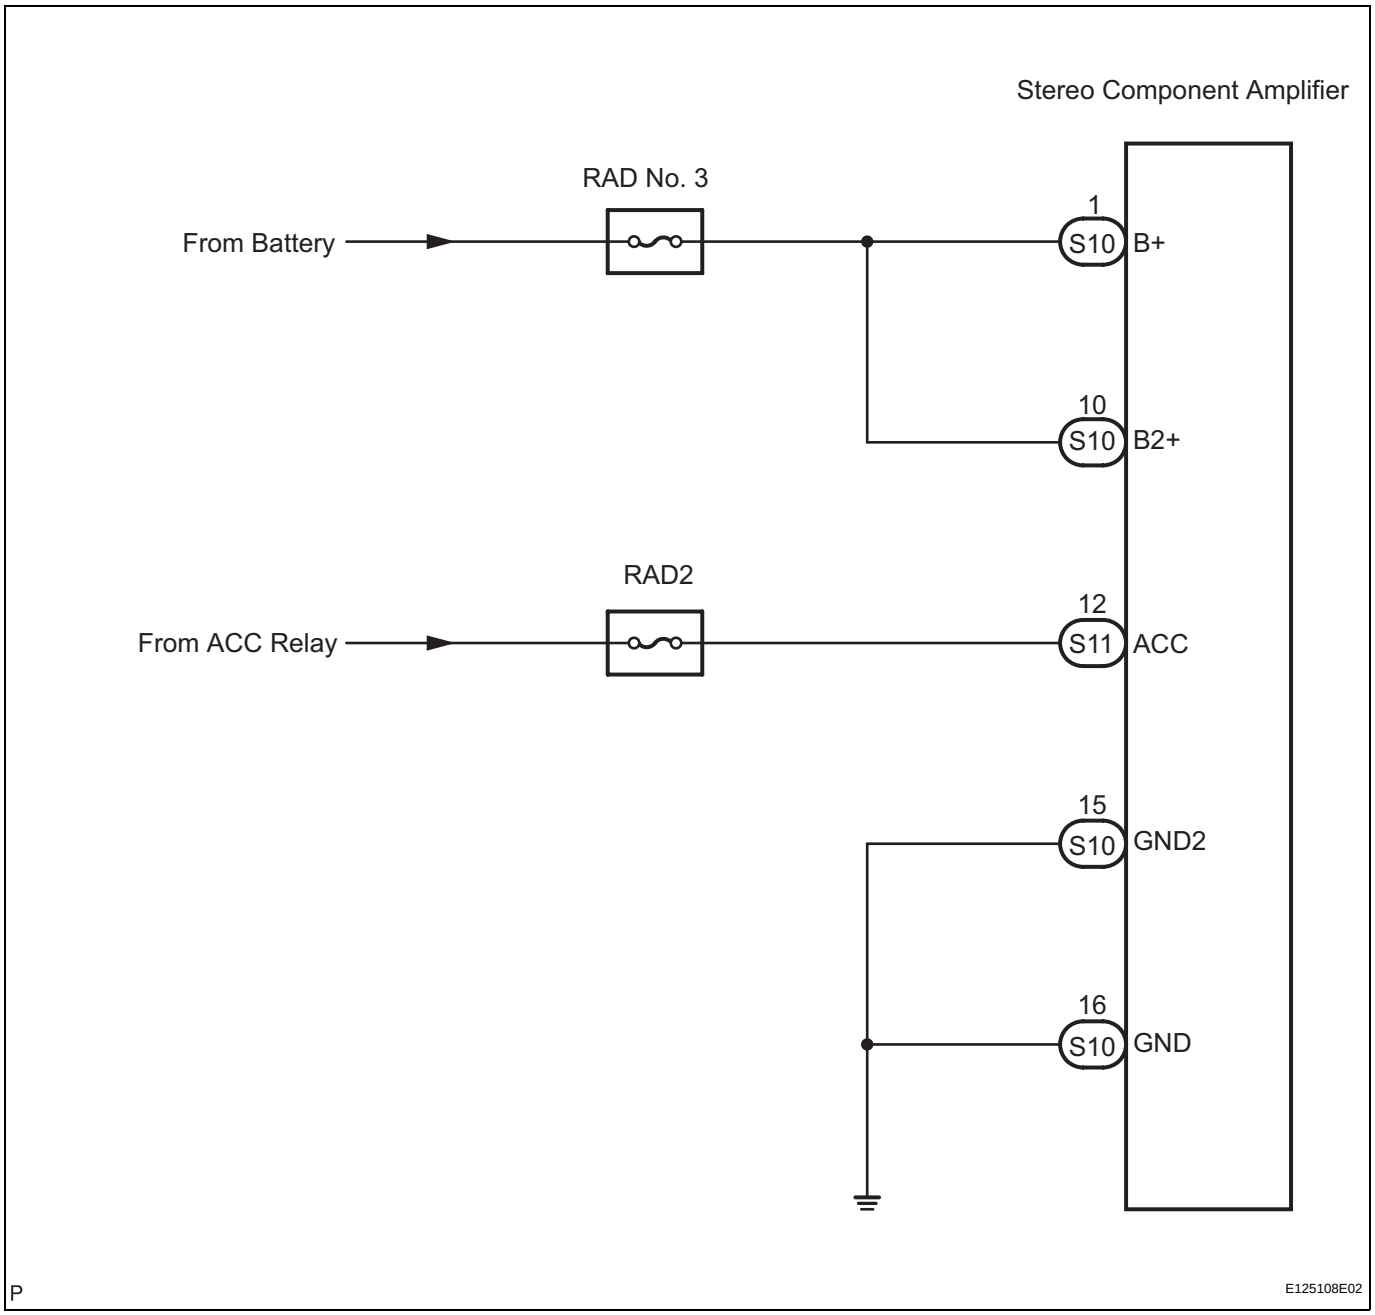


NS

INSPECTION PROCEDURE

1	**INSPECT STEREO COMPONENT AMPLIFIER**

Wire Harness View:

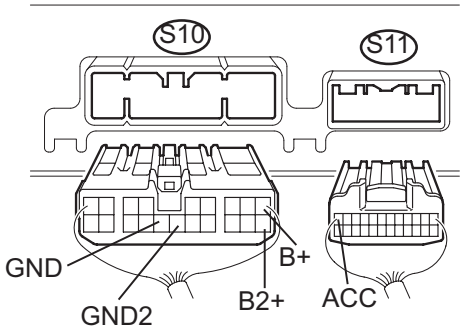

(a) Disconnect the stereo component amplifier connector.
(b) Measure the resistance according to the value(s) in the table below.

Standard resistance

Tester connection	Condition	Specified condition
GND - Body ground	Always	Below 1 Ω
GND2 - Body ground	Always	Below 1 Ω

(c) Measure the voltage according to the value(s) in the table below.

Standard voltage

Tester connection	Condition	Specified condition
B2+ - GND	Always	10 to 14 V
B+ - GND	Always	10 to 14 V
ACC - GND	Ignition SW ACC	10 to 14 V

NG → **REPAIR OR REPLACE HARNESS OR CONNECTOR**

OK

PROCEED TO NEXT CIRCUIT INSPECTION SHOWN IN PROBLEM SYMPTOMS TABLE