
Back Sonar Sensor LH Circuit

DESCRIPTION

An ultrasonic sensor consists of a sensor portion that transmits and receives ultrasonic waves and a pre-amplifier that amplifies them. The ultrasonic sensor outputs the ultrasonic waves and sends the received signals to the clearance warning ECU.


WIRING DIAGRAM

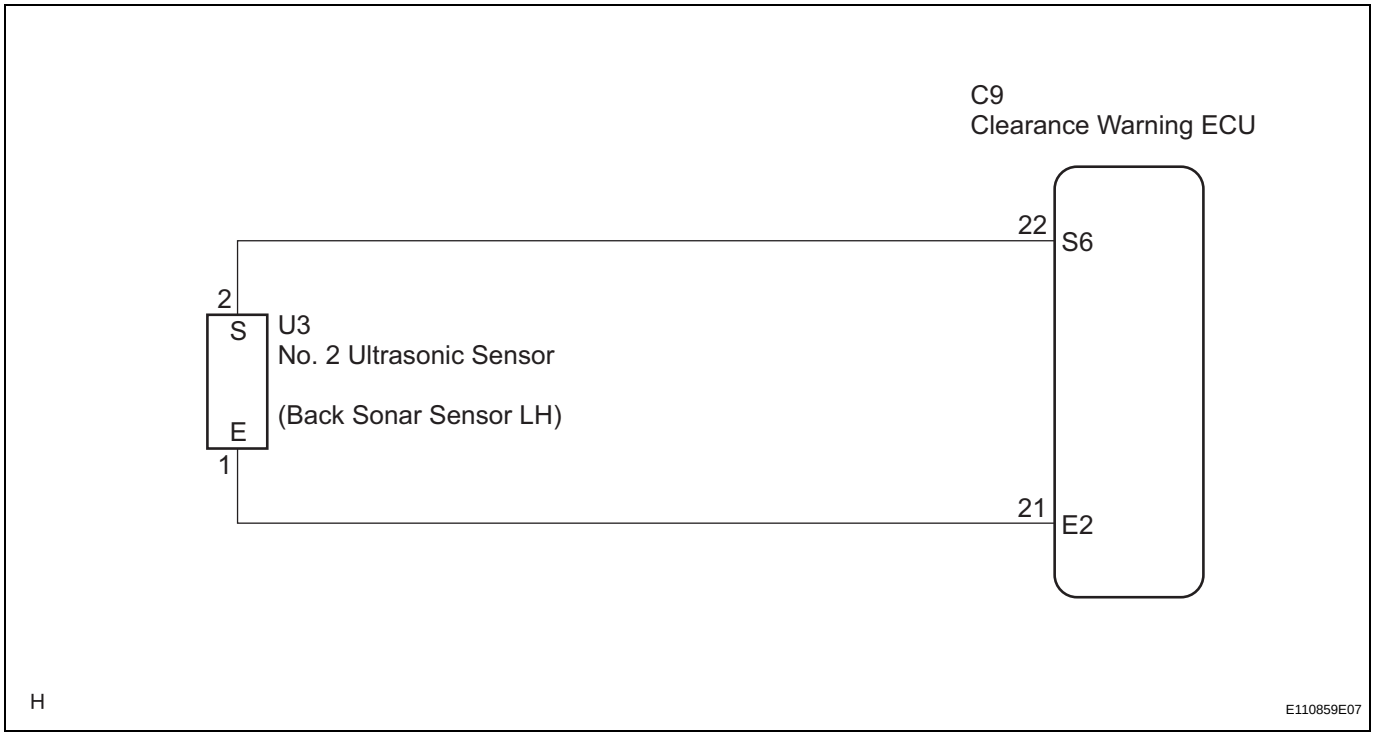

PM

INSPECTION PROCEDURE

1	INSPECT NO. 2 ULTRASONIC SENSOR

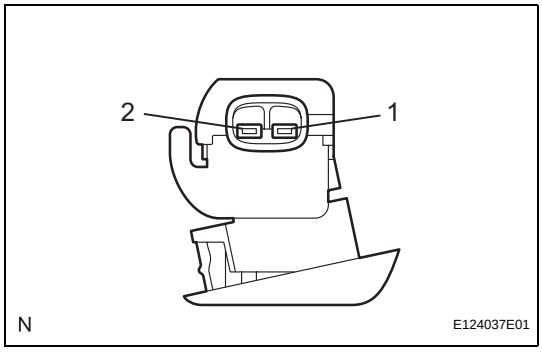

(a) Remove the No. 2 ultrasonic sensor.
(b) Measure the resistance according to the value(s) in the table below.

Standard resistance


Tester connection	Condition	Specified condition
1 - 2	Always	8 to 12 kΩ

NG → **REPLACE NO. 2 ULTRASONIC SENSOR**

OK

2	CHECK HARNESS AND CONNECTOR (CLEARANCE WARNING ECU - NO. 2 ULTRASONIC SENSOR)


Clearance Warning ECU Wire Harness View:

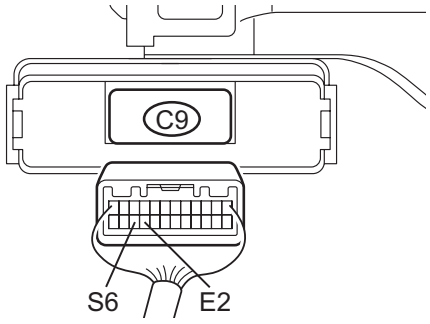

N E124033E04

(a) Disconnect the C9 connector from the clearance warning ECU.

No. 2 Ultrasonic Sensor Connector Front View:

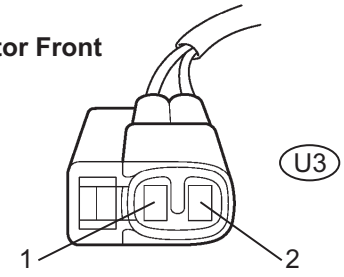

I041776E07

(b) Disconnect the U3 connector from the No. 2 ultrasonic sensor.

(c) Measure the resistance according to the value(s) in the table below.

Standard resistance

Tester connection	Condition	Specified condition
S6 - S	Always	Below 1 Ω
E2 - E	Always	Below 1 Ω
S6 - Body ground	Always	10 kΩ or higher
E2 - Body ground	Always	10 kΩ or higher

PM

NG → REPAIR OR REPLACE HARNESS OR CONNECTOR

OK

PROCEED TO NEXT CIRCUIT INSPECTION SHOWN IN PROBLEM SYMPTOMS TABLE