




# SERVICE BULLETIN

QUALITY INFORMATION ANALYSIS  
OVERSEAS SERVICE DEPT. MITSUBISHI MOTORS CORPORATION

<b>SERVICE BULLETIN</b>		No.: MSB-97E37-001							
		Date: 1997-07-15	<table border="1"> <tr> <td>&lt;Model&gt;</td> <td>&lt;M/Y&gt;</td> </tr> <tr> <td>COLT(CJ0A)</td> <td>96-10</td> </tr> <tr> <td>LANCER(CK0A)</td> <td>96-10</td> </tr> </table>	<Model>	<M/Y>	COLT(CJ0A)	96-10	LANCER(CK0A)	96-10
<Model>	<M/Y>								
COLT(CJ0A)	96-10								
LANCER(CK0A)	96-10								
Subject: CHANGE IN POWER STEERING HOSE PIPING									
Group: STEERING	Draftno: 96-TA-019								
INFORMATION	OVERSEAS SERVICE DEPT	 R. USAMI - MANAGER QUALITY INFORMATION ANALYSIS							

### 1. Description:

This Service Bulletin informs you of changes in the power steering hose piping.

### 2. Effective Date:

RH drive vehicles: From November 13, 1996

LH drive vehicles: From November 29, 1996


### 2. Applicable Manuals:

Manual	Pub. No.	Language	Page(s)
'96 COLT/LANCER Workshop Manual Chassis	PWME9511	(English)	37A-33
	PWMS9512	(Spanish)	
	PWMF9513	(French)	
	PWMG9514	(German)	
	PWMD9515	(Dutch)	
	PWMW9516	(Swedish)	

### 3. Details:

Please refer to the attached pages.

**POWER STEERING HOSES  
REMOVAL AND INSTALLATION**

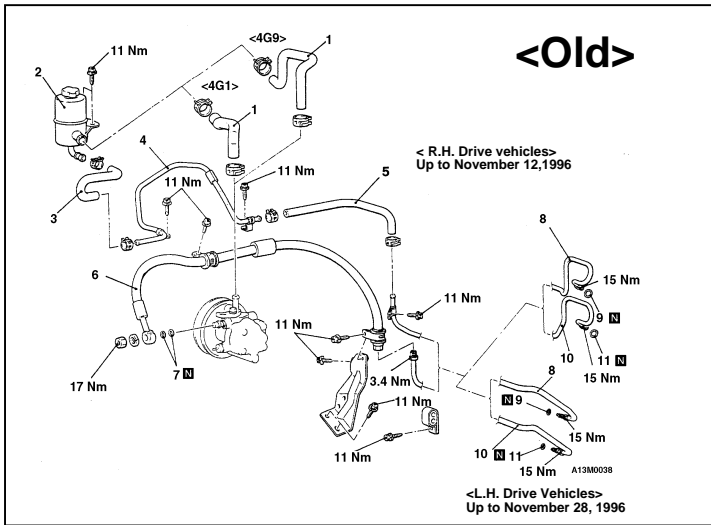


**Pre-removal Operation**

- Power Steering Fluid Draining (Refer to P.37A-9.)

**Post-Installation Operation**

- Power Steering Fluid Supplying (Refer to P.37A-9.)
- Power Steering Fluid Line Bleeding (Refer to P.37A-9.)

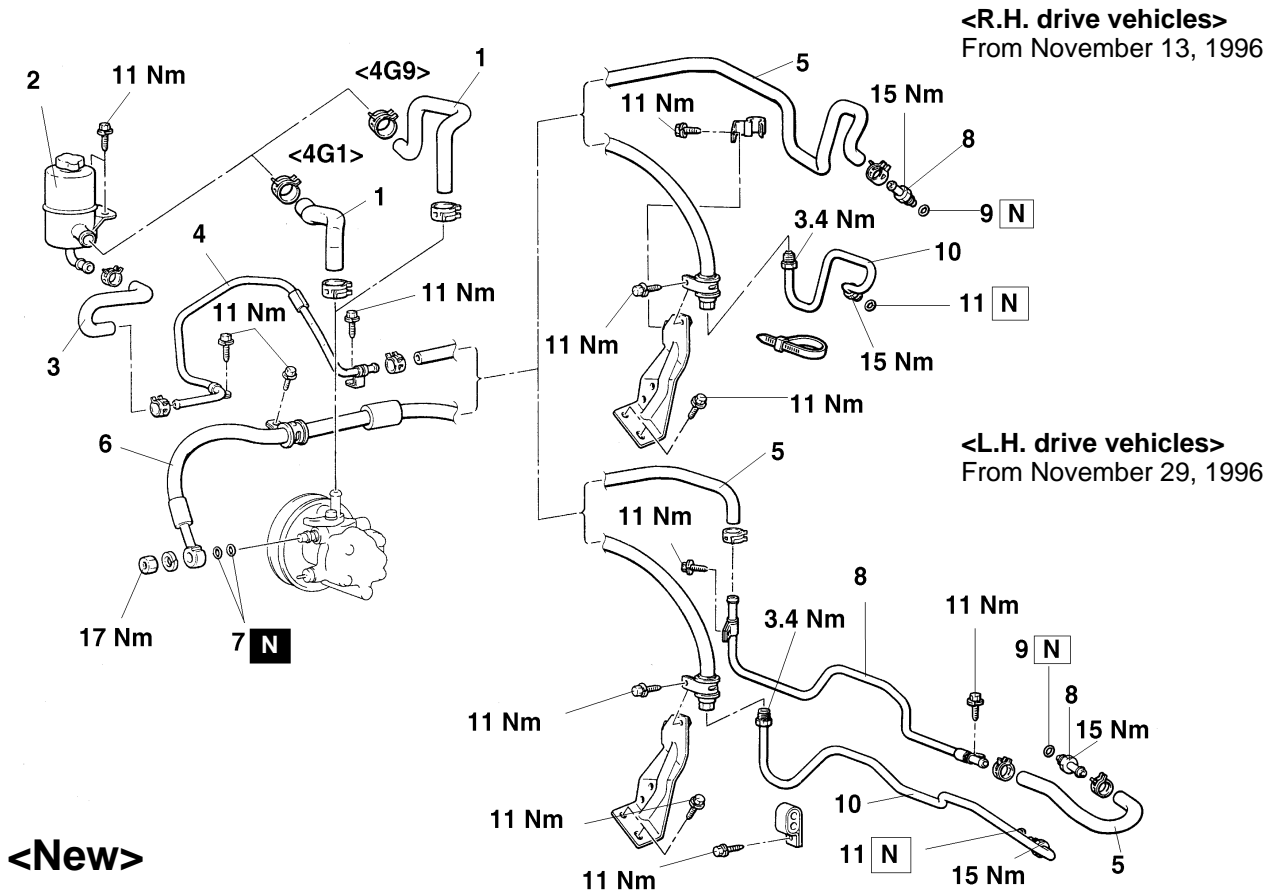

- |                        |                         |
|------------------------|-------------------------|
| 1. Suction hose        | 7. O-ring               |
| 2. Oil reservoir       | 8. Return tube          |
| 3. Return hose         | 9. O-ring               |
| 4. Return tube         | ▶ A ◀ 10. Pressure hose |
| 5. Return hose         | 11. O-ring              |
| ▶ A ◀ 6. Pressure hose |                         |