

SERVICE BULLETIN

APPLICABILITY ALL MODELS EQUIPPED WITH A POWER ANTENNA

DATE 10-08-92

SUBJECT: POWER ANTENNA SERVICING

Power antenna masts are available as separate replacement parts for all Subaru power antennas.

If you receive a customer complaint of improper power antenna operation, the cause may be a stuck, tight or binding mast.

The mast should be removed following the instructions which come with the part.

Inspect the removed mast.


1. Check the mast by manually extending and contracting by hand. Visually inspect the mast. A tight or binding mast may be caused by being bent or rusted. If either of these conditions exist, replace the mast.
2. Inspect the antenna rope for possible damage, such as stripped teeth or breakage. If damage is found, replace the mast.

FLAT RATE INFORMATION

NOTE: ANTENNA PARTS WHICH ARE BENT OR DAMAGED ARE NOT A MATTER FOR WARRANTY. NEVER REPLACE AN ANTENNA ASSEMBLY WHEN ONLY A MAST IS NECESSARY.

The following may be used for repairs to vehicles within the terms of the Subaru Limited Warranty.

ITEM DESCRIPTION/ FAILURE CODE	OPERATION NUMBER	LABOR DESCRIPTION	TIME
ANTENNA MAST/ UKB	A850511	ANTENNA MAST	0.3

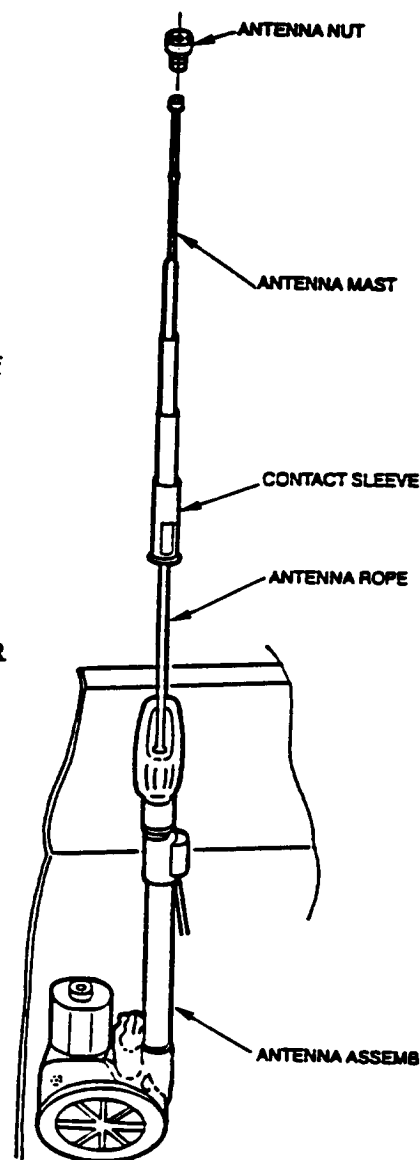

CAUTION

VEHICLE SERVICING PERFORMED BY UNTRAINED PERSONS COULD RESULT IN SERIOUS INJURY TO THOSE PERSONS OR TO OTHERS. Subaru Service Bulletins are intended for use by professional technicians ONLY. They are written to inform those technicians of conditions that may occur in some vehicles, or to provide information that could assist in the proper servicing of the vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do the job correctly and safely. If a condition is described, DO NOT assume that this Service Bulletin applies to your vehicle, or that your vehicle will have that condition.