


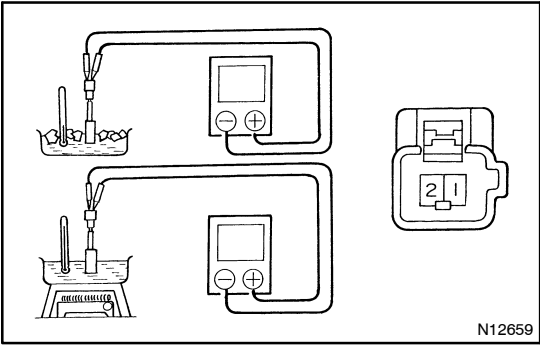

INSPECTION

INSPECT SENSOR RESISTANCE

Measure resistance between terminals at each temperature.

Standard resistance:

0° C (32° F)	50 kΩ or less
40° C (104° F)	2.5 – 2.7 kΩ
100° C (212° F)	0.2 kΩ or less

If resistance is not as specified, replace the sensor.