


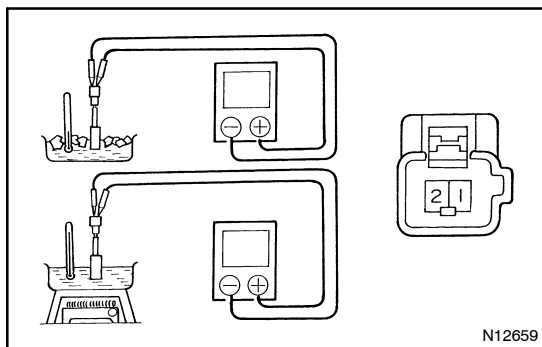

INSPECTION

INSPECT SENSOR RESISTANCE

Measure resistance between terminals at each temperature.

Standard resistance:

at 0°C (32°F): 50 kΩ or less

at 40°C (104°F): 2.5 – 2.7 kΩ

at 100°C (212°F): 0.2 kΩ or less

If resistance is not as specified, replace the sensor.