


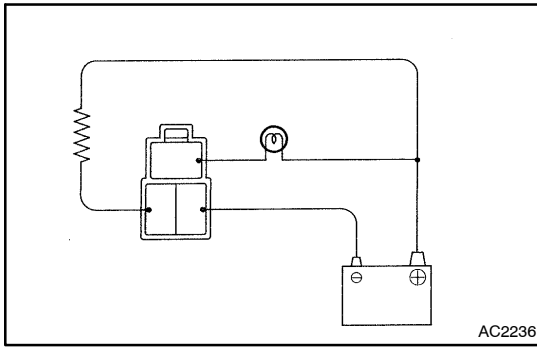

INSPECTION

INSPECT POWER TRANSISTOR OPERATION

- Connect the positive (+) lead from the battery to terminal 1 through a 3.4 W test bulb and terminal 3 of a 120 Ω resistor.
 - Connect the negative (-) lead from the battery to terminal 2 and check that the test bulb lights up.
- If operation is not as specified, replace the transistor.