



MEDIC UPDATE

TECHNICAL SERVICE BULLETIN

SUBJECT:		No: TSB-08-23-001	
CORRECTED SCAN TOOL EQUIPMENT PART NUMBERS - SERVICE MANUAL REVISION		DATE: January, 2008	
		MODEL: 2008 Outlander	
CIRCULATE TO:	☐ GENERAL MANAGER	☒ PARTS MANAGER	☒ TECHNICIAN
☒ SERVICE ADVISOR	☒ SERVICE MANAGER	☒ WARRANTY PROCESSOR	☐ SALES MANAGER

TSB Revision TSB-08-23-001

PURPOSE

The information for equipment associated with the MUT-III Scan Tool is incorrect in the Service Manual. This TSB corrects the information.


AFFECTED SERVICE MANUALS

2008 Outlander w/CVT only page 23A-126

CORRECTIONS

SPECIAL TOOL			
Tool	Tool number and name	Supersession	Application
	MB991955 a: MB991824 b: MB991827 c: MB991910 d: MB991911 e: MB991825 f: MB991826 M.U.T.-III sub-assembly	MB991824-KIT NOTE: G: MB991826 M.U.T.-III trigger harness is not necessary when pushing V.C.I. ENTER key.	CVT check (M.U.T.-III diagnosis code display and service data display) CAUTION For vehicles with CAN communication, use the M.U.T.-III main harness A to send the simulated vehicle speed. If you connect the M.U.T.-III main harness B instead, the CAN communication does not function correctly.
	MB991824		
	MB991827		
	MB991910		
	MB991911		
	MB991825		
	MB991826		
	MB991955		

Corrected Illustration	
	MB991955 a: MB991824 b: MB991827 c: MB991910 d: MB991911 e: MB991825 f: MB991826 g: MB991826 M.U.T.-III sub assembly
	a. Vehicle communication interface (V.C.I.)
	b. M.U.T.-III USB cable
	c. M.U.T.-III main harness A (Vehicles with CAN communication system)
	d. M.U.T.-III main harness B (Vehicles without CAN communication system)
	e. M.U.T.-III main

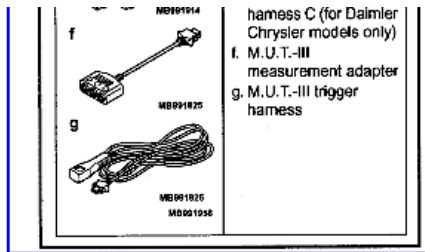

Mitsubishi Motors North America, Inc.

The information contained in this bulletin is subject to change. For the latest version of this document, go to the Mitsubishi Dealer Link, MEDIC, or the Mitsubishi Service Information website (www.mitsubishitechinfo.com).