



RECEIVED

SEP 20 1994

SERVICE BULLETIN


Classification: EM94-007	Section: Engine	Models: Various
Reference: TECHNICAL BULLETIN NTB94-089	Date: September 13, 1994	

VG30 ENGINE OIL DIP STICK CAUTION

APPLIED MODELS: All VG30i/E or VG30DE equipped models

SERVICE INFORMATION

When performing any service that requires removal of the oil pan, always remove the dip stick before replacing the oil pan. If the dip stick is left in the engine the end of it may become caught between the main bearing beam and the windage tray of the oil pan. The only way to remove the dip stick after it has been caught is to remove the oil pan.

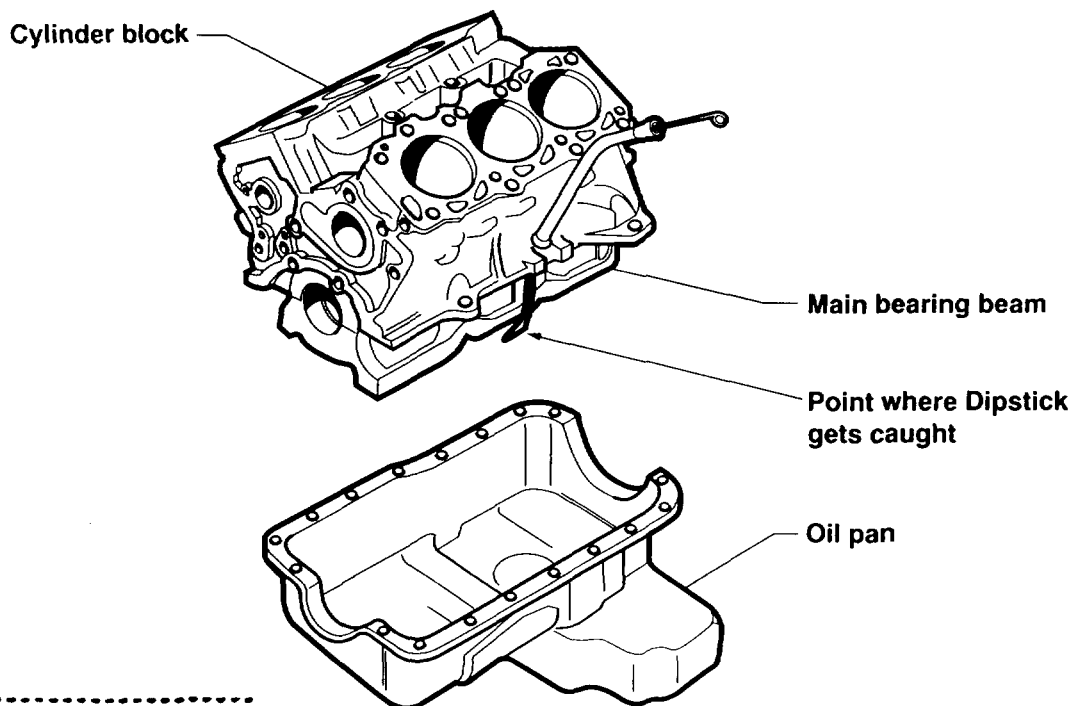

Index # 040069

NISSAN MOTOR CORPORATION U.S.A.
Technical Communications Department