


5. Body Sealing

A: SPECIFICATION

Used material:

THREE BOND 4104 (004403063)

- Common for wagon and sedan model

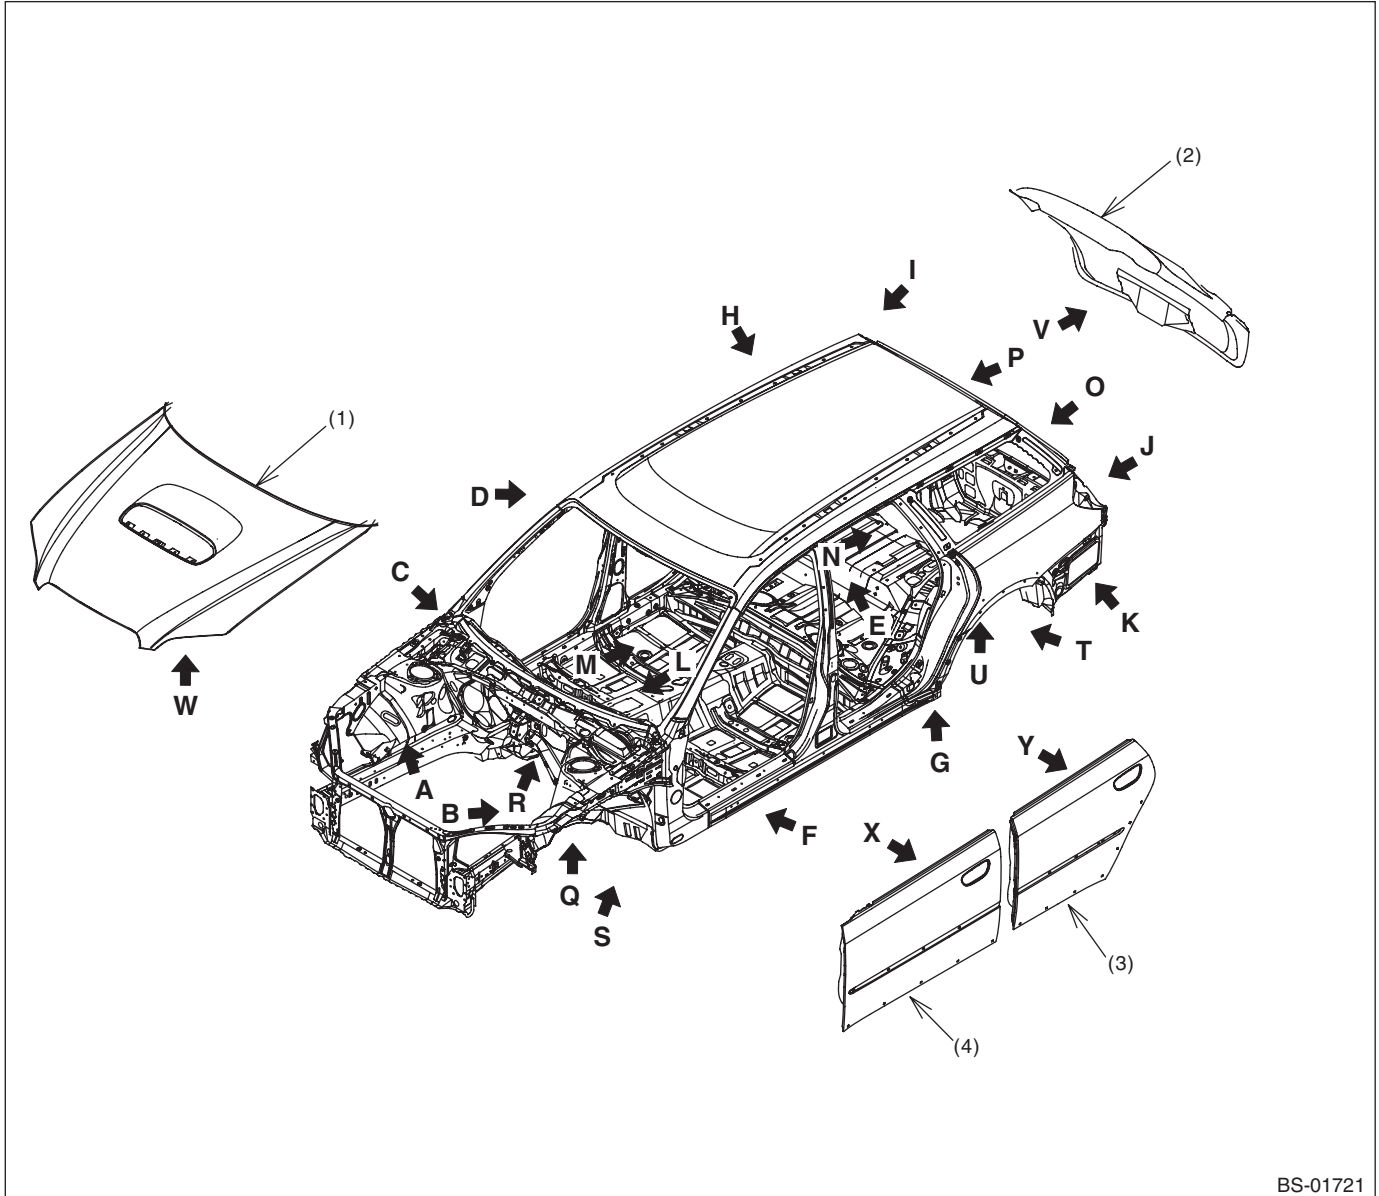

BS-01721


(1) Front hood

(3) Rear door

(4) Front door


(2) Rear gate

View A

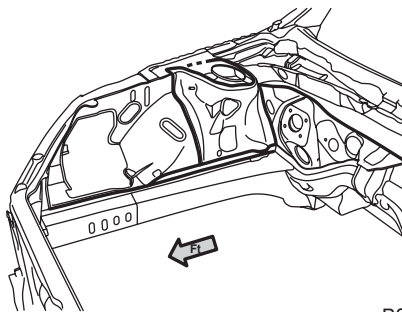

BS-01498

View B

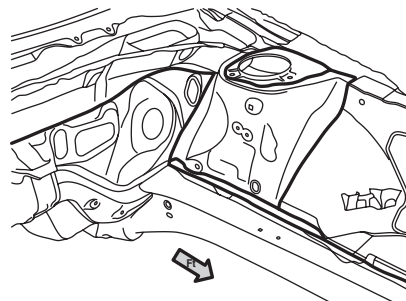


BS-01499

Body Sealing


BODY STRUCTURE

View C

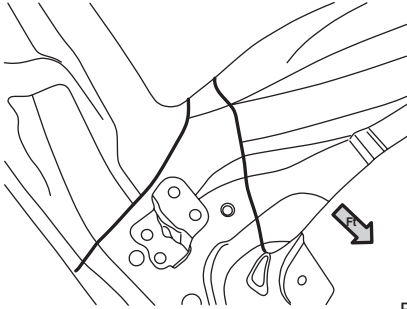


BS-00734

View D

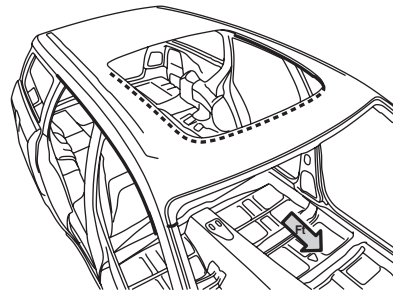


BS-00735

View E

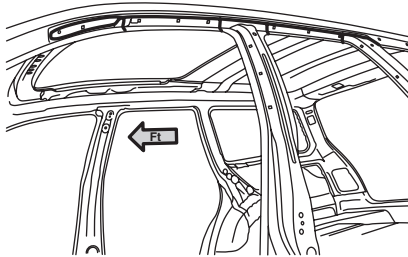


BS-00736

View F

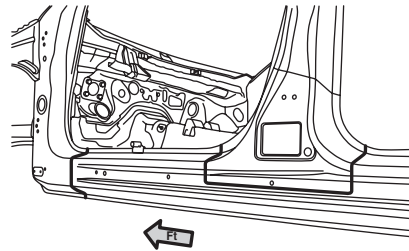


BS-01601

View G

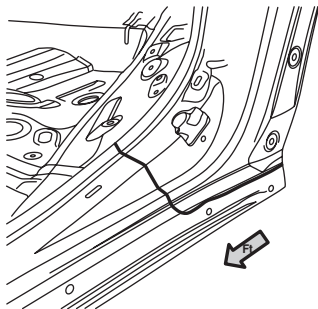


BS-00738

View H

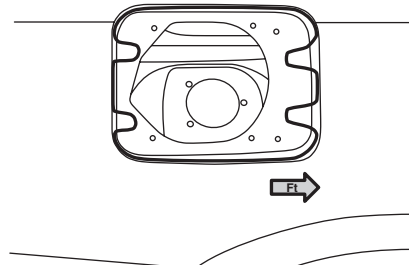


BS-00739

View I

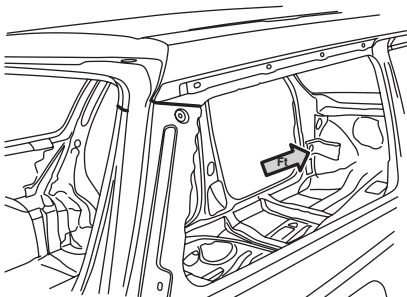


BS-00740

View J

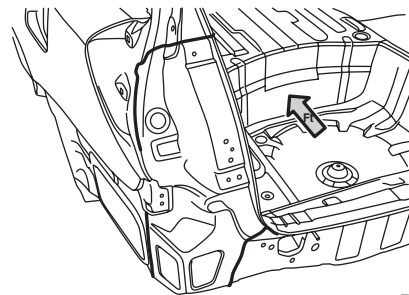


BS-00741

View K

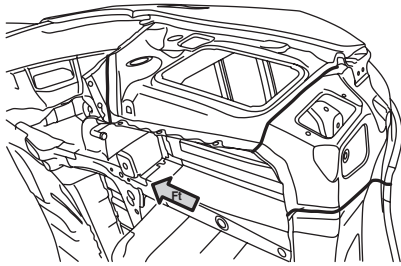


BS-00742

View L

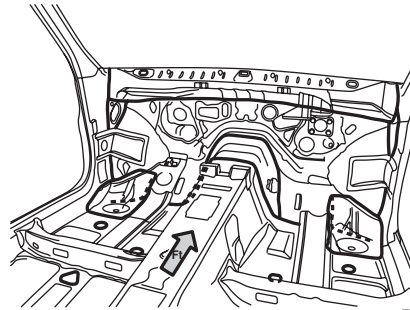


BS-00743

View M

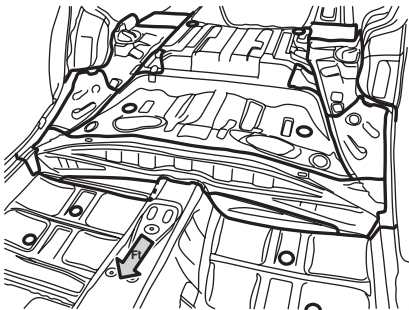


BS-01718

View N

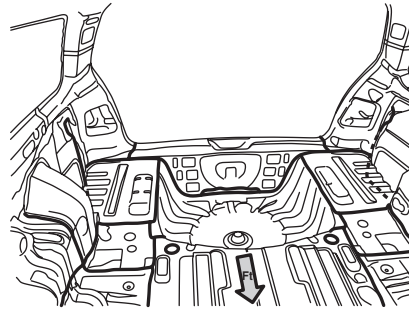


BS-01719

View O

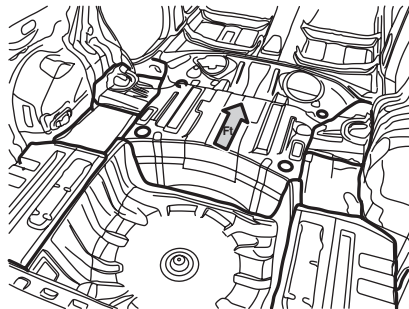


BS-01720

View P

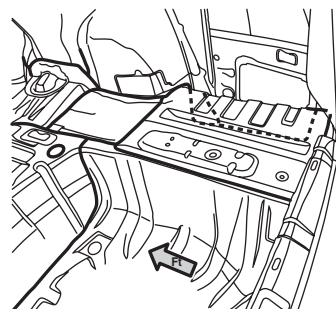


BS-00747

View Q

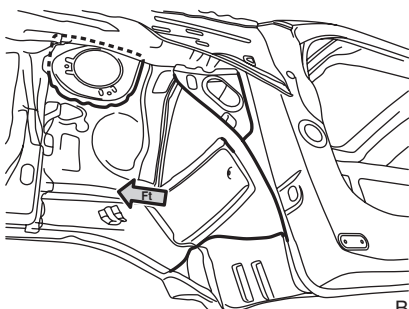

BS-00748








View R

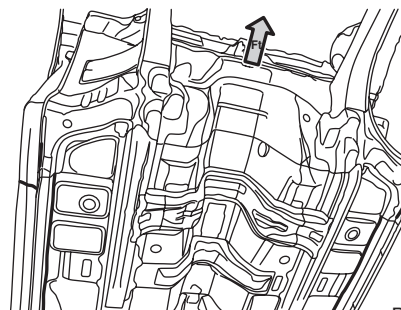

BS-01500


Body Sealing

BODY STRUCTURE
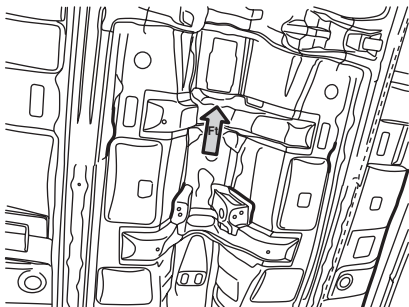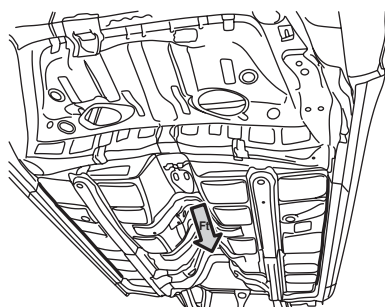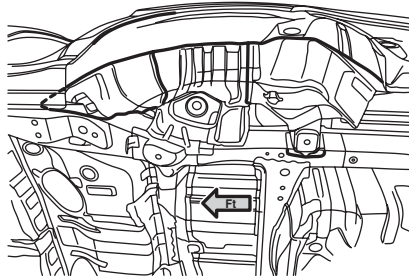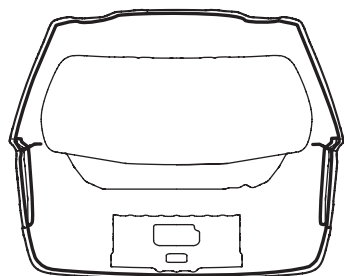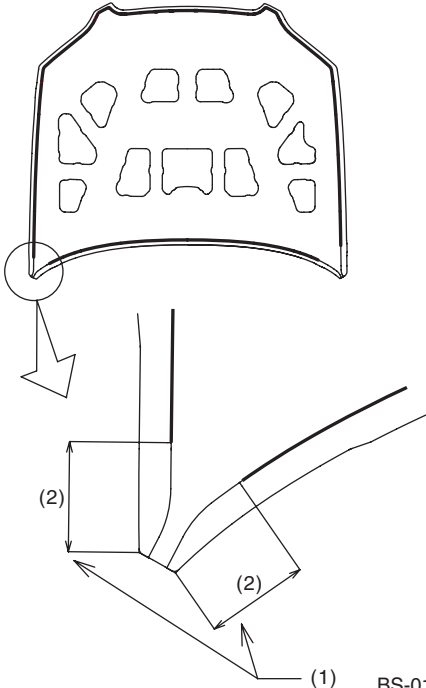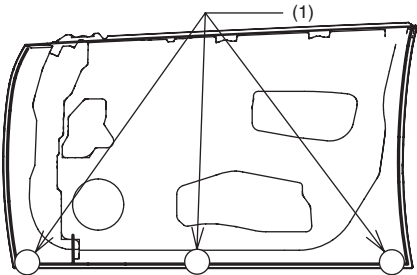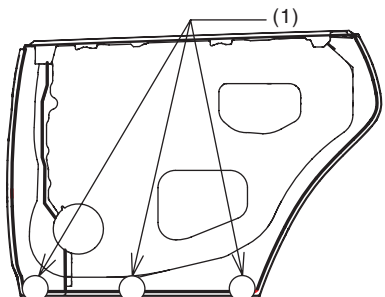
<p>View S</p>  <p>BS-01501</p>	<p>View T</p>  <p>BS-01502</p>
<p>View U</p>  <p>BS-01602</p>	<p>View V</p>  <p>BS-00756</p>
<p>View W</p>  <p>(1) Application not required. (2) 50 mm (1.97 in)</p> <p>BS-01436</p>	<p>View X</p>  <p>BS-00754</p> <p>(1) Do not block the water drain holes.</p> <p>View Y</p>  <p>BS-00755</p> <p>(1) Do not block the water drain holes.</p>

CAUTION:
Sealer already has been applied to hood, door, and rear gate in replacement condition.








- Sedan model

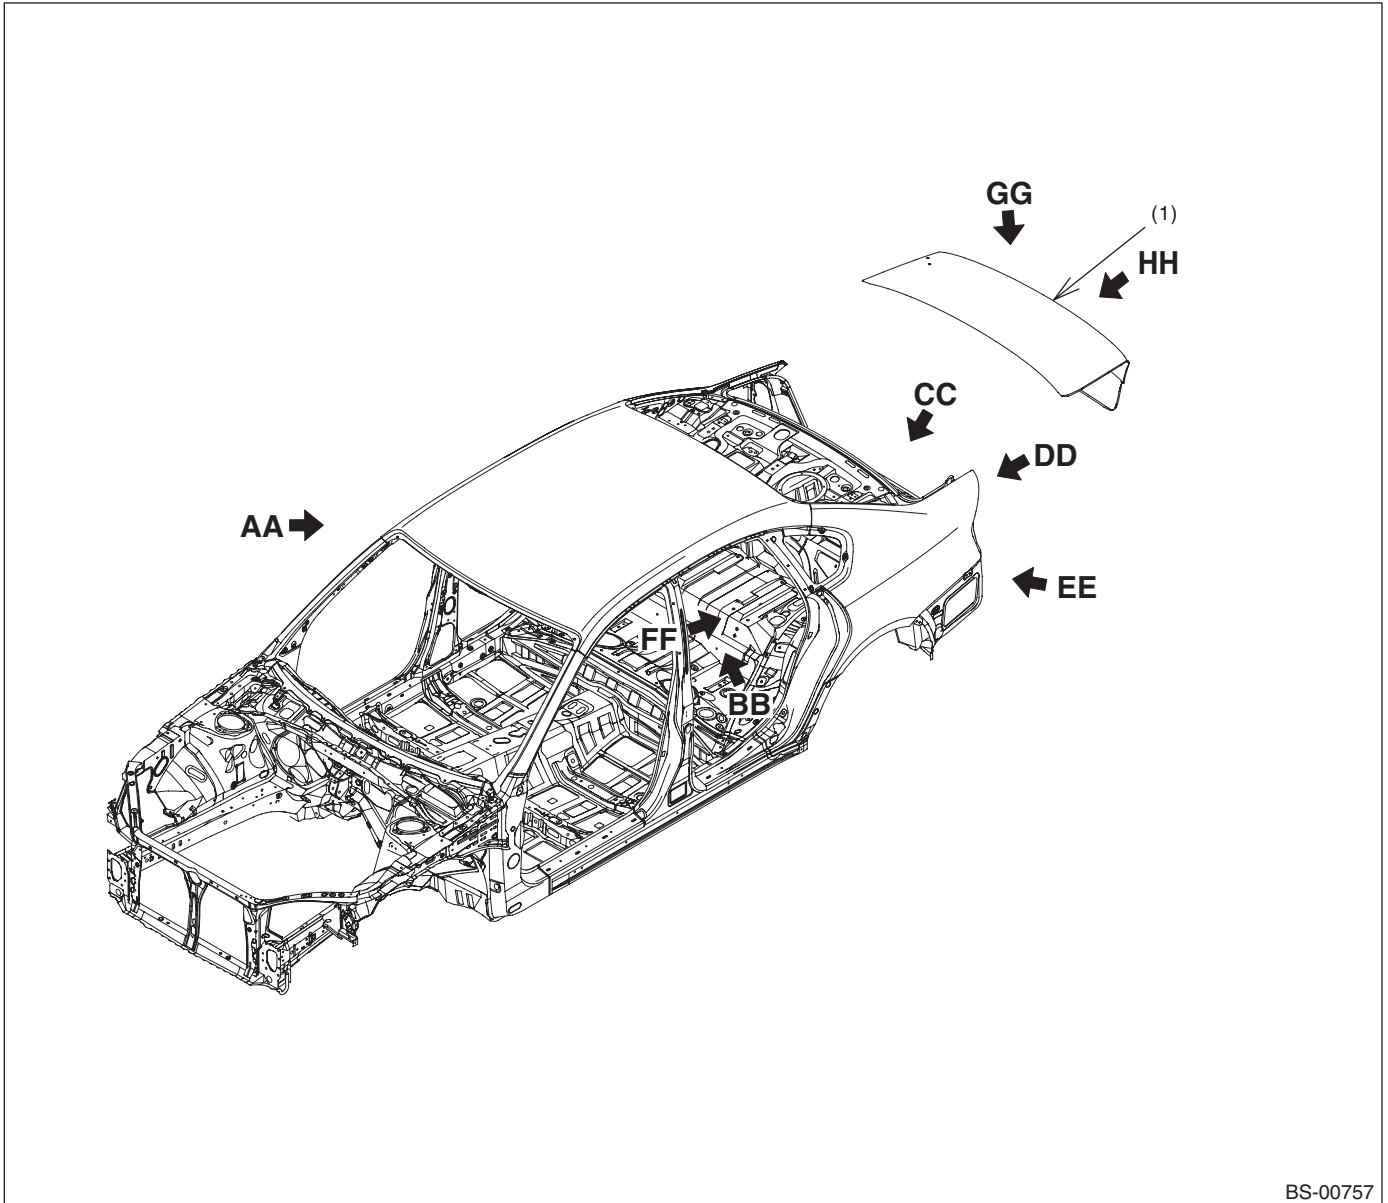

(1) Trunk

Body Sealing

BODY STRUCTURE
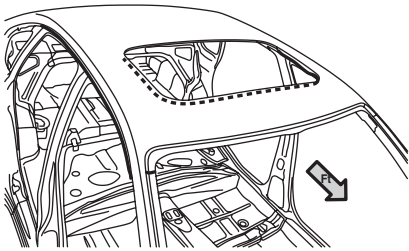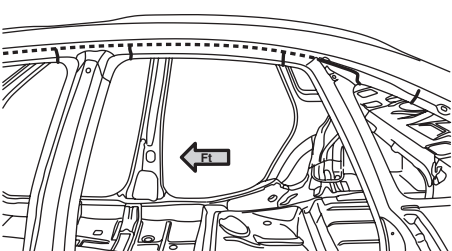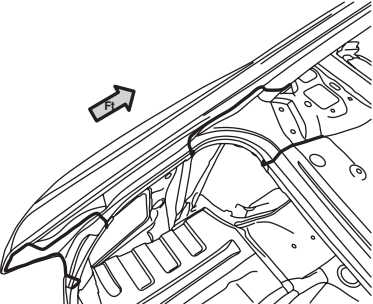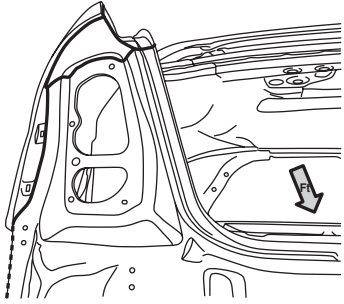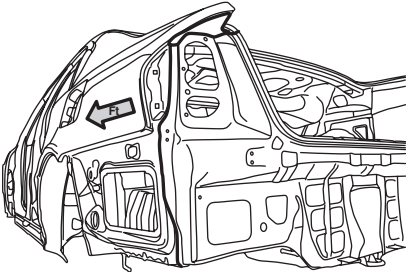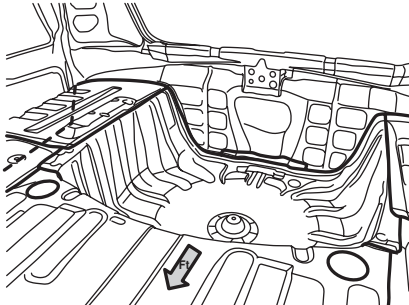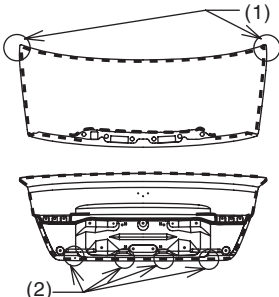
<p>View AA</p>  <p>BS-00758</p>	<p>View BB</p>  <p>BS-00759</p>
<p>View CC</p>  <p>BS-00760</p>	<p>View DD</p>  <p>BS-00761</p>
<p>View EE</p>  <p>BS-00762</p>	<p>View FF</p>  <p>BS-00763</p>
<p>View GG View HH</p>  <p>(1) (2)</p> <p>BS-00764</p> <p>(1) The holes shall be blocked. (2) Do not block the water drain holes.</p>	<p>SUBARU</p>

CAUTION:
Sealer already has been applied to the trunk in replacement condition.