

COWL TOP SIDE INNER PANEL (ASSY)



REPLACEMENT

With the front body pillar lower gusset removed.



F20985-A

REMOVAL

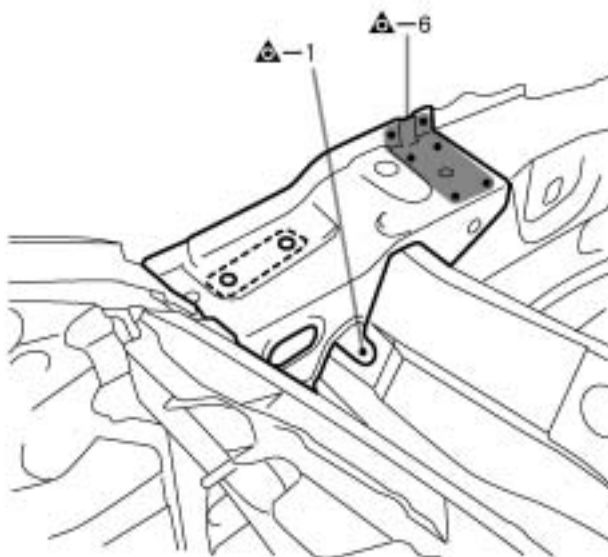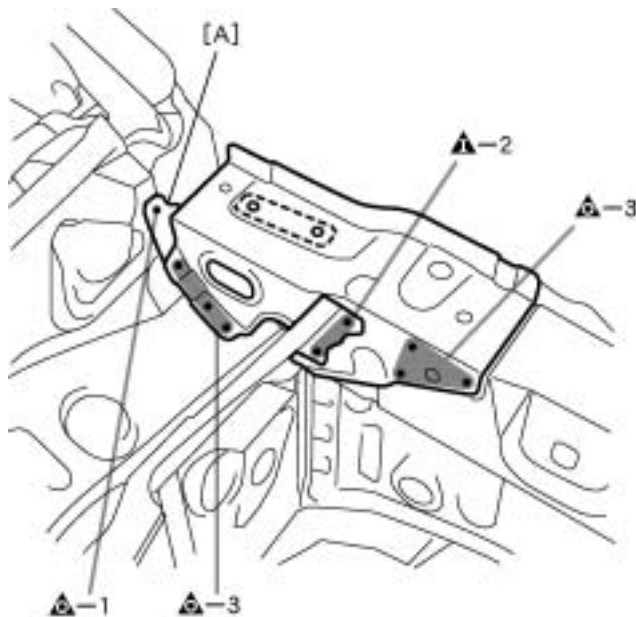

F20985

POINT


- 1 Replace the [A] at the same time.

PART NAME

[A] Cowl Top Side Reinforcement

INSTALLATION

- Temporarily install the new parts and measure each part of the new parts in accordance with the body dimension diagram. (See the body dimension diagram)
- Inspect the fitting of the related parts around the new parts before welding. This affects the appearance of the finish.
- After welding, apply the polyurethane foam to the corresponding parts.
- After welding, apply body sealer and under-coating to the corresponding parts.
- After applying the top coat layer, apply anti-rust agent to the inside of the necked section structural weld spots.

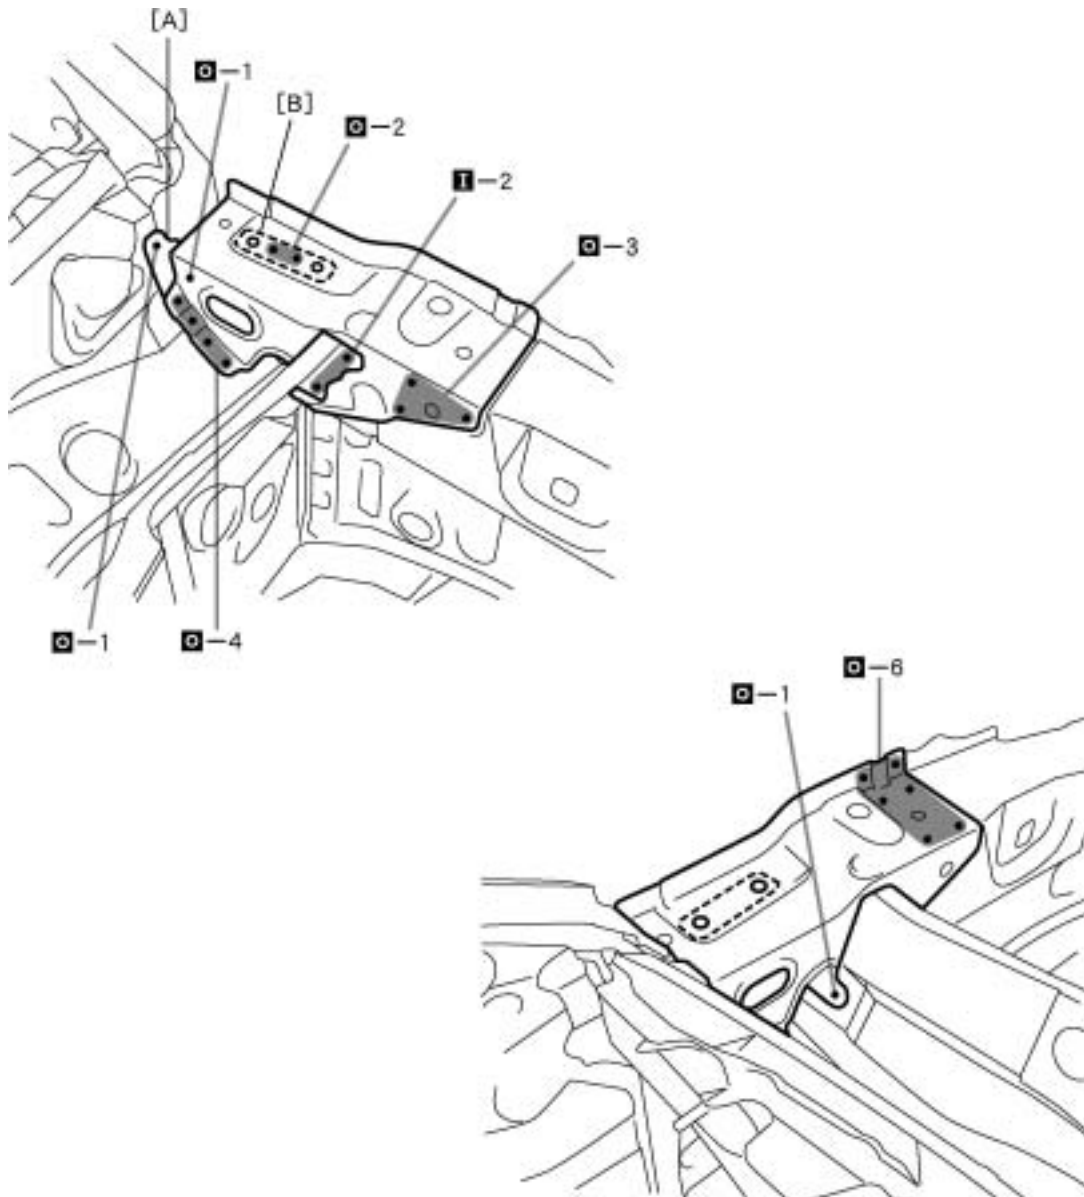

F20986

POINT

- 1 Inspect the fitting of the front fender and hood, etc., before welding, since affects the appearance of the finish.

PART NAME

- [A] Cowl Top Side Reinforcement [B] Hood Hinge Mounting Reinforcement