
CAUTION LABEL ATTACHMENT POSITION


1 After using a degreasing agent to clean the surfaces of the body where the caution labels will be attached, attach the caution labels to the positions shown in the illustration.
HINT:
- *Attach each caution label with its orientation the same as the numbers shown in the illustration.*
- *Make sure the caution label is not attached over a spot weld.*
- *When attaching the caution label, make sure not to touch the label's adhesive surface.*
- *To prevent the edges of the caution label from peeling, apply extra pressure to the label's periphery.*
- *If the work area's temperature is 5°C or less, the caution label's adhesive will deteriorate. It is recommended that you heat the label to 20 to 40°C.*


[USA, Canada]

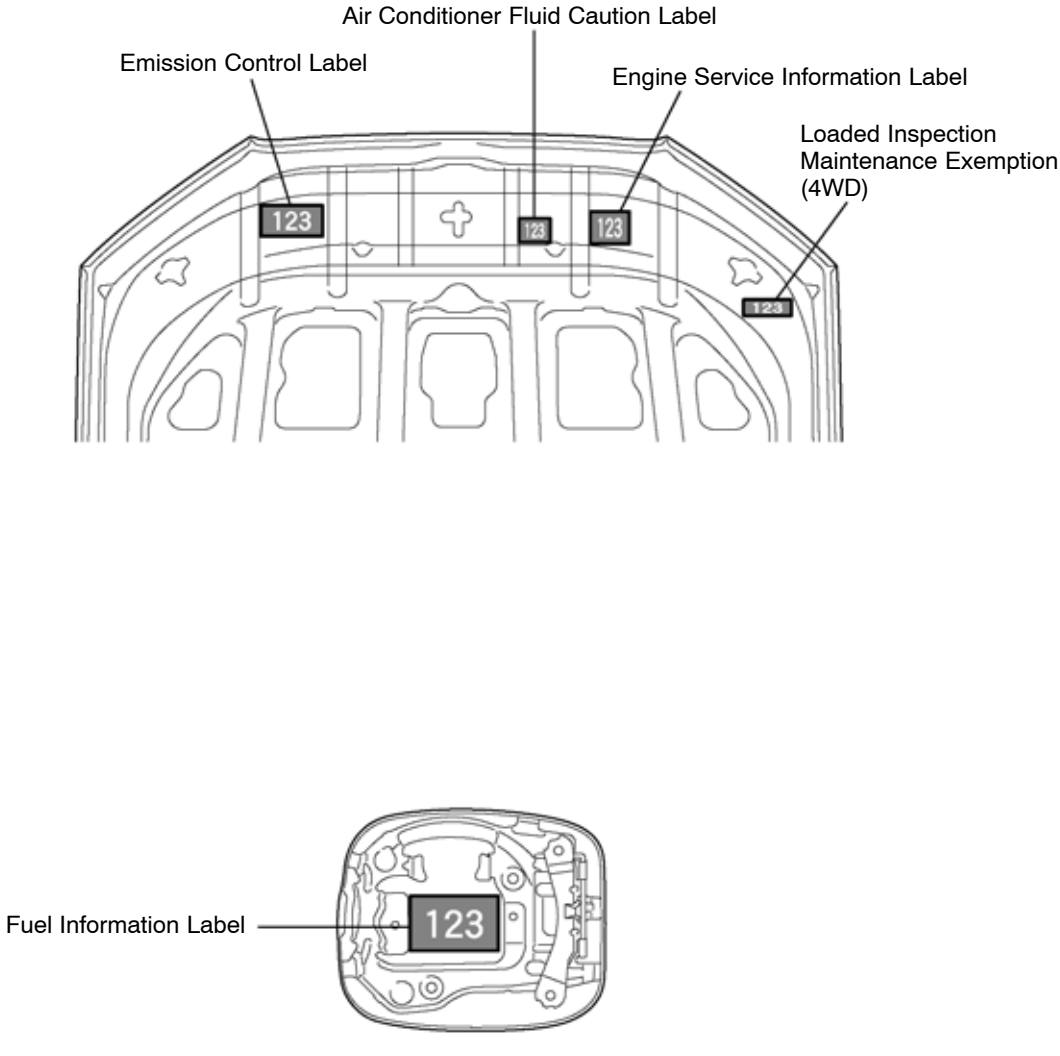

F43005


[USA, Canada]

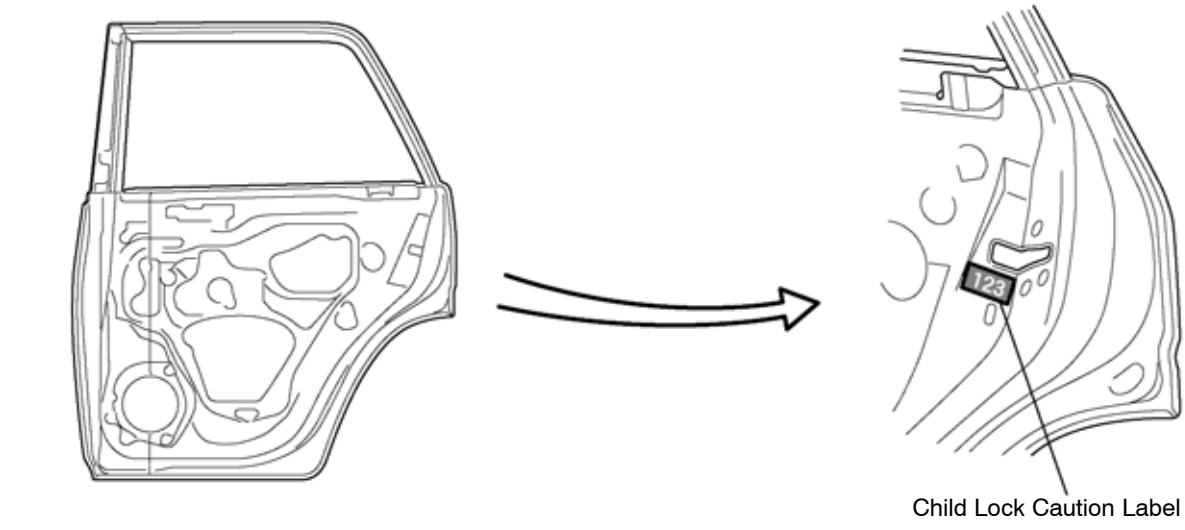


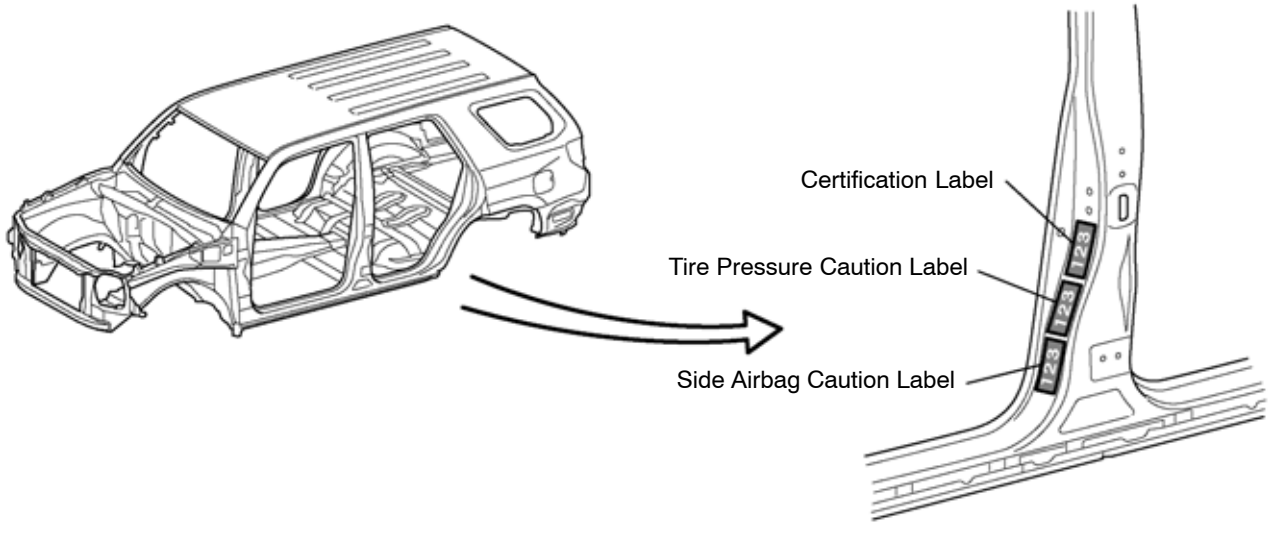

F43006


[Except USA, Canada]

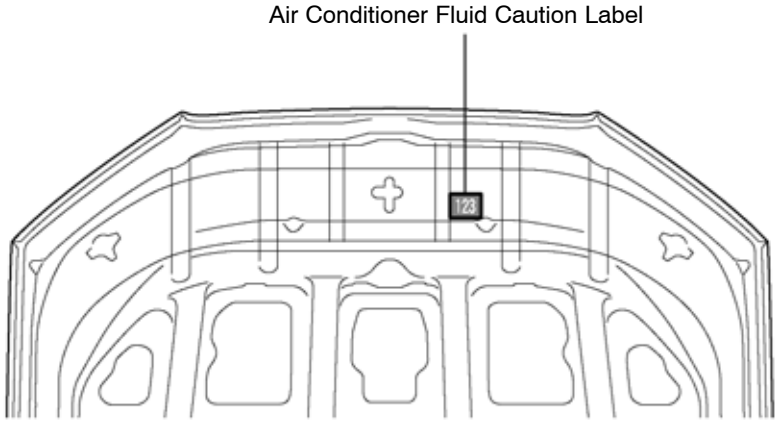


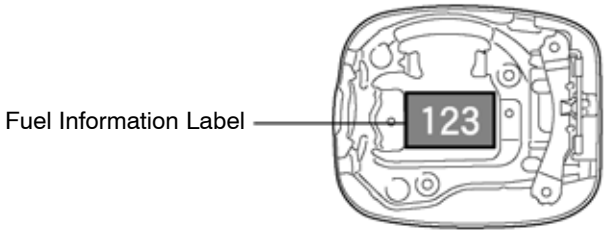

F43007

[Except USA, Canada]

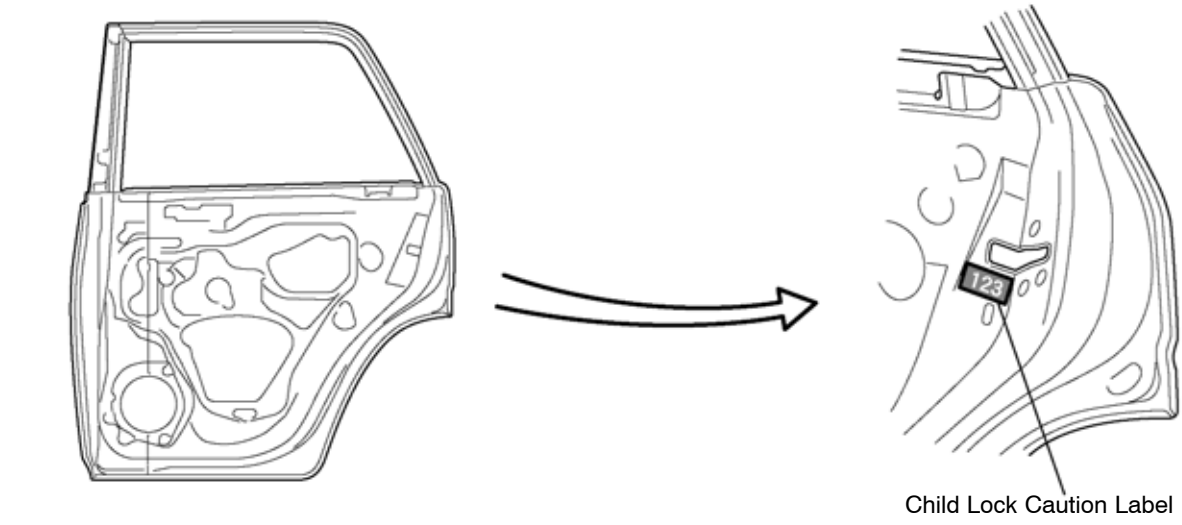

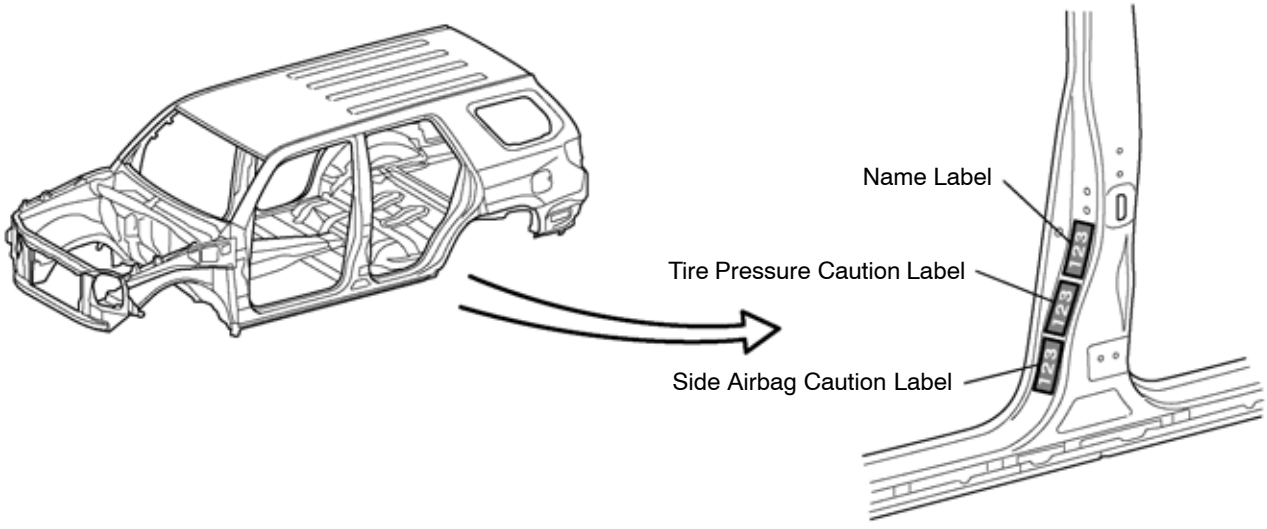

F43008