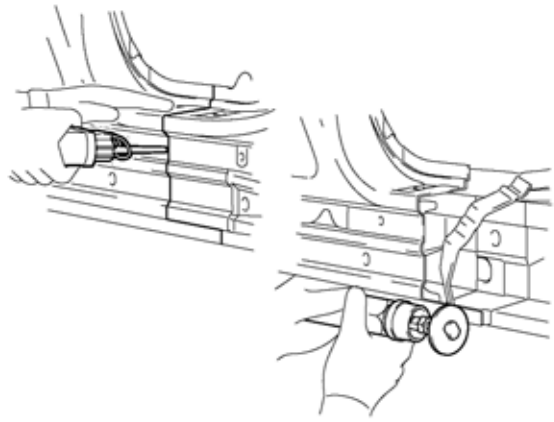
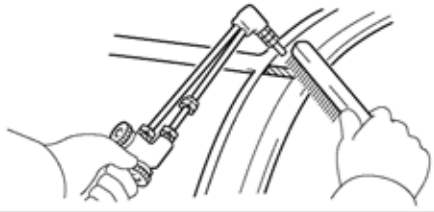
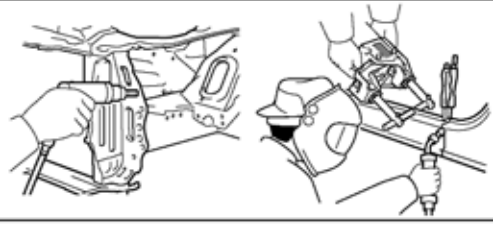
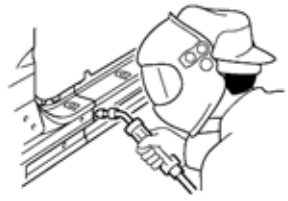
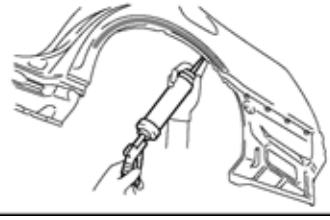

2. SYMBOLS

REPAIR AREA INDICATOR SYMBOLS		REPAIR METHOD INDICATOR SYMBOLS		ILLUSTRATION
-----	CUT		CUT AND JOIN LOCATION (SAW CUT)	
			CUT AND JOIN LOCATION (Cut Location for Supply Parts)	
			CUT LOCATION	
			CUT WITH DISC SANDER, ETC.	
/////	BRAZE		BRAZING OR ARC BRAZING FOR REMOVAL	
OOOO	BRAZE		BRAZE	
M I I M I	WELD POINTS	—	SPOT WELD OR PLUG WELD (refer to “ILLUSTRATION OF WELD POINT SYMBOLS”)	
++++	WELDING		BUTT WELD	
			FILLET WELD	
	BODY SEALER		BODY SEALER	 F31237

REPAIR AREA INDICATOR SYMBOLS		REPAIR METHOD INDICATOR SYMBOLS		ILLUSTRATION
—	ASSEMBLY MARK	⊕	STANDARD HOLE FOR INSTALLATION	—
++++++++++	BODY SEALER	—	FLAT FINISHING	
———			NO FLAT FINISHING	 F31238